



# **CIVIC STADIUM**

## **ASBESTOS INFORMATION & SURVEY REPORT**



8-22-10



## Civic Stadium-Asbestos Building Identification Summary

### **Upstairs Transportation Office:**

Sheet Vinyl Flooring / 30% Chrysotile-Bathroom, South Entrance & Area At Top Of Stairs

Approx. 227 sq. ft.

Sheet Vinyl Wainscot / 30 % Chrysotile-Bathroom

Approx. 116 sq. ft.

Sheetrock Finished Ceiling / Negative For Asbestos

Sheetrock Finished Wall / Negative For Asbestos

Acoustical Ceiling Texture / 2% Chrysotile

Approx. 1860 sq. ft.

Carpet Mastic / Negative For Asbestos, Wood Sub Floor Under Carpet

Cove Base Mastic / Negative For Asbestos

Window Putty / Negative For Asbestos

Roofing Material / Negative For Asbestos

T.S.I. / Assumed Asbestos Containing Material Hidden In Walls

Siding Vapor Barrier / Negative For Asbestos

Electrical Wiring / None Observed On Fixtures Or In Attic Space

Fire Doors / Negative For Asbestos

### **Downstairs Transportation Office:**

Sheet Vinyl Flooring / 30% Chrysotile-Entryway At West Entrance Below Stairs

Approx. 12 sq. ft.

Sheetrock Finished Ceiling / Negative For Asbestos, Bathroom

Sheetrock Finished Wall / Negative For Asbestos, Bathroom

Rubber Stair Material & Mastic / Negative For Asbestos

Cove Base Mastic / Negative For Asbestos

Window Putty / Negative For Asbestos

T.S.I. / Assumed Asbestos Containing Material Hidden In Walls

Siding Vapor Barrier / Negative For Asbestos

Electrical Wiring / None Observed

Fire Doors / Negative For Asbestos

### **Break Room:**

Sheet Vinyl Flooring / 25% Chrysotile

Approx. 1700 sq. ft.

Sheet Vinyl Wainscot / 30% Chrysotile-Men's & Women's Bathroom

Approx. 550 sq. ft.

Sheet Vinyl Flooring Over Plywood, Over Original Sheet Vinyl Flooring-Girl's Bathroom / Negative For Asbestos

Sheetrock Finished Ceilings / Less Than 1% Chrysotile

Approx. 1700 sq. ft.

Sheetrock Finished Walls / 2% Chrysotile "Old Samples" – Less Than 1% Chrysotile "New Samples"  
Approx. 3360 sq. ft.

Cove Base Mastic / Negative For Asbestos

Window Putty / Negative For Asbestos

Roofing Material / Upper Shingle Roof Area / Both Layers, Negative For Asbestos

T.S.I. / Assumed Asbestos Containing Material Hidden In Walls & Under Building

Siding Vapor Barrier / None Found

Electrical Wiring / No Asbestos Wiring Observed On Fixtures Or In Attic Space

Fire Doors / Negative For Asbestos

### **Transportation Shop:**

Sheetrock Finished Walls / Paint Room-2% Chrysotile

Approx. 900 sq. ft.

Sheetrock Finished Walls / Storage Area-Less Than 1% Chrysotile

Approx. 360 sq. ft.

Sheetrock Finished Ceiling / Paint Room-Less Than 1% Chrysotile

Approx. 1150 sq. ft.

Sheet Vinyl Flooring / Negative for Asbestos

Cove Base Mastic / Negative For Asbestos

Window Putty / Less Than 1% Chrysotile

Approx. 85 In.ft. x ½"

Roofing Material / Low Slope Roofs / 3% Chrysotile-Built-up Roofing

Approx. 8000 sq. ft.

Roofing Material / Both Layers, Negative for Asbestos

T.S.I. / Assumed Asbestos Containing Material Hidden In Walls

Siding Vapor Barrier / Negative For Asbestos

Electrical Wiring / No Asbestos Wiring Observed On Fixtures

Chalkboard Mastic / Negative For Asbestos

Fire Doors / Negative For Asbestos

### **Grandstands:**

Sheetrock Finished Walls / Negative For Asbestos, Press Box

Sheetrock Finished Ceiling / Negative For Asbestos, Press Box

Sheet Vinyl Flooring / Men's & Women's Bathroom / 30% Chrysotile

Sheet Vinyl Flooring / Concessions #3 / 45% Chrysotile

Carpet Mastic / Negative For Asbestos

Cove Base Mastic / Negative For Asbestos

Window Putty / None Found

Ceramic Floor & Wall Tile / Assumed Asbestos Containing

Transite Walls / "Home" & "Visitor's" Dressing Room Bathrooms, Room On West Side Of "Visitor's"  
Dressing Room / 17% Chrysotile

Approx. 560 sq. ft.

Roofing Material-Upper Shingle Roof Area / Bottom Layer-30% Chrysotile-Built-up Roofing

Approx. 32,500 sq. ft.

Roofing Material / Above Dressing Rooms / Low Slope Roof / 5% Chrysotile-Built-up Roofing

Approx. 3240 sq. ft.

Roofing Material / Above Showers & Outside Bathrooms / 5% Chrysotile-Built-up Roofing  
Approx. 1,900 sq. ft.

Roofing Material / Team Dug Outs-Shingle Roof Area / Negative for Asbestos

T.S.I. / Assumed Asbestos Containing Hidden In Walls

Siding Vapor Barrier / Negative For Asbestos

Electrical Wiring / No Asbestos Wiring Observed On Fixtures Or In Attic Spaces

Fire Doors / Majority Of Doors Are Negative For Asbestos

Fire Doors / White Powder Detected When Drilled, Door Between "Home" Dressing Room - "Visitor's"  
Dressing Room And South East Door Of Main Storage Room/Assumed Positive

Approx. 50 sq. ft.

Hot Water Tank Insulation / Negative for Asbestos

### **Boiler Room:**

Sheetrock Unfinished Walls / Negative For Asbestos

Window Putty / Negative For Asbestos

Roofing Material / Low Slope Roof / 30% Chrysotile-Built-up Roofing  
Approx. 1000 sq. ft.

T.S.I. / Assumed Asbestos Containing Hidden In Walls

Fire Doors / Negative For Asbestos

Boiler Insulation / Negative For Asbestos

Chimney Mortar / Negative for Asbestos

### **Covered Parking Structure-Next To Boiler Room:**

Roofing Material-Low Slope Roof / 5% Chrysotile-Built-up Roofing  
Approx. 2800 sq. ft.

### **Transportation Storage Unit:**

Roofing Material / Shingle Roof Area / Negative For Asbestos


Fire Door / Negative For Asbestos


### **Main Concession Stand: (North Side Of Boiler Room)**


Roofing Material-Low Slope Roof / Negative for Asbestos

Sheet Vinyl Floors / Negative For Asbestos

Fire Door / Negative For Asbestos

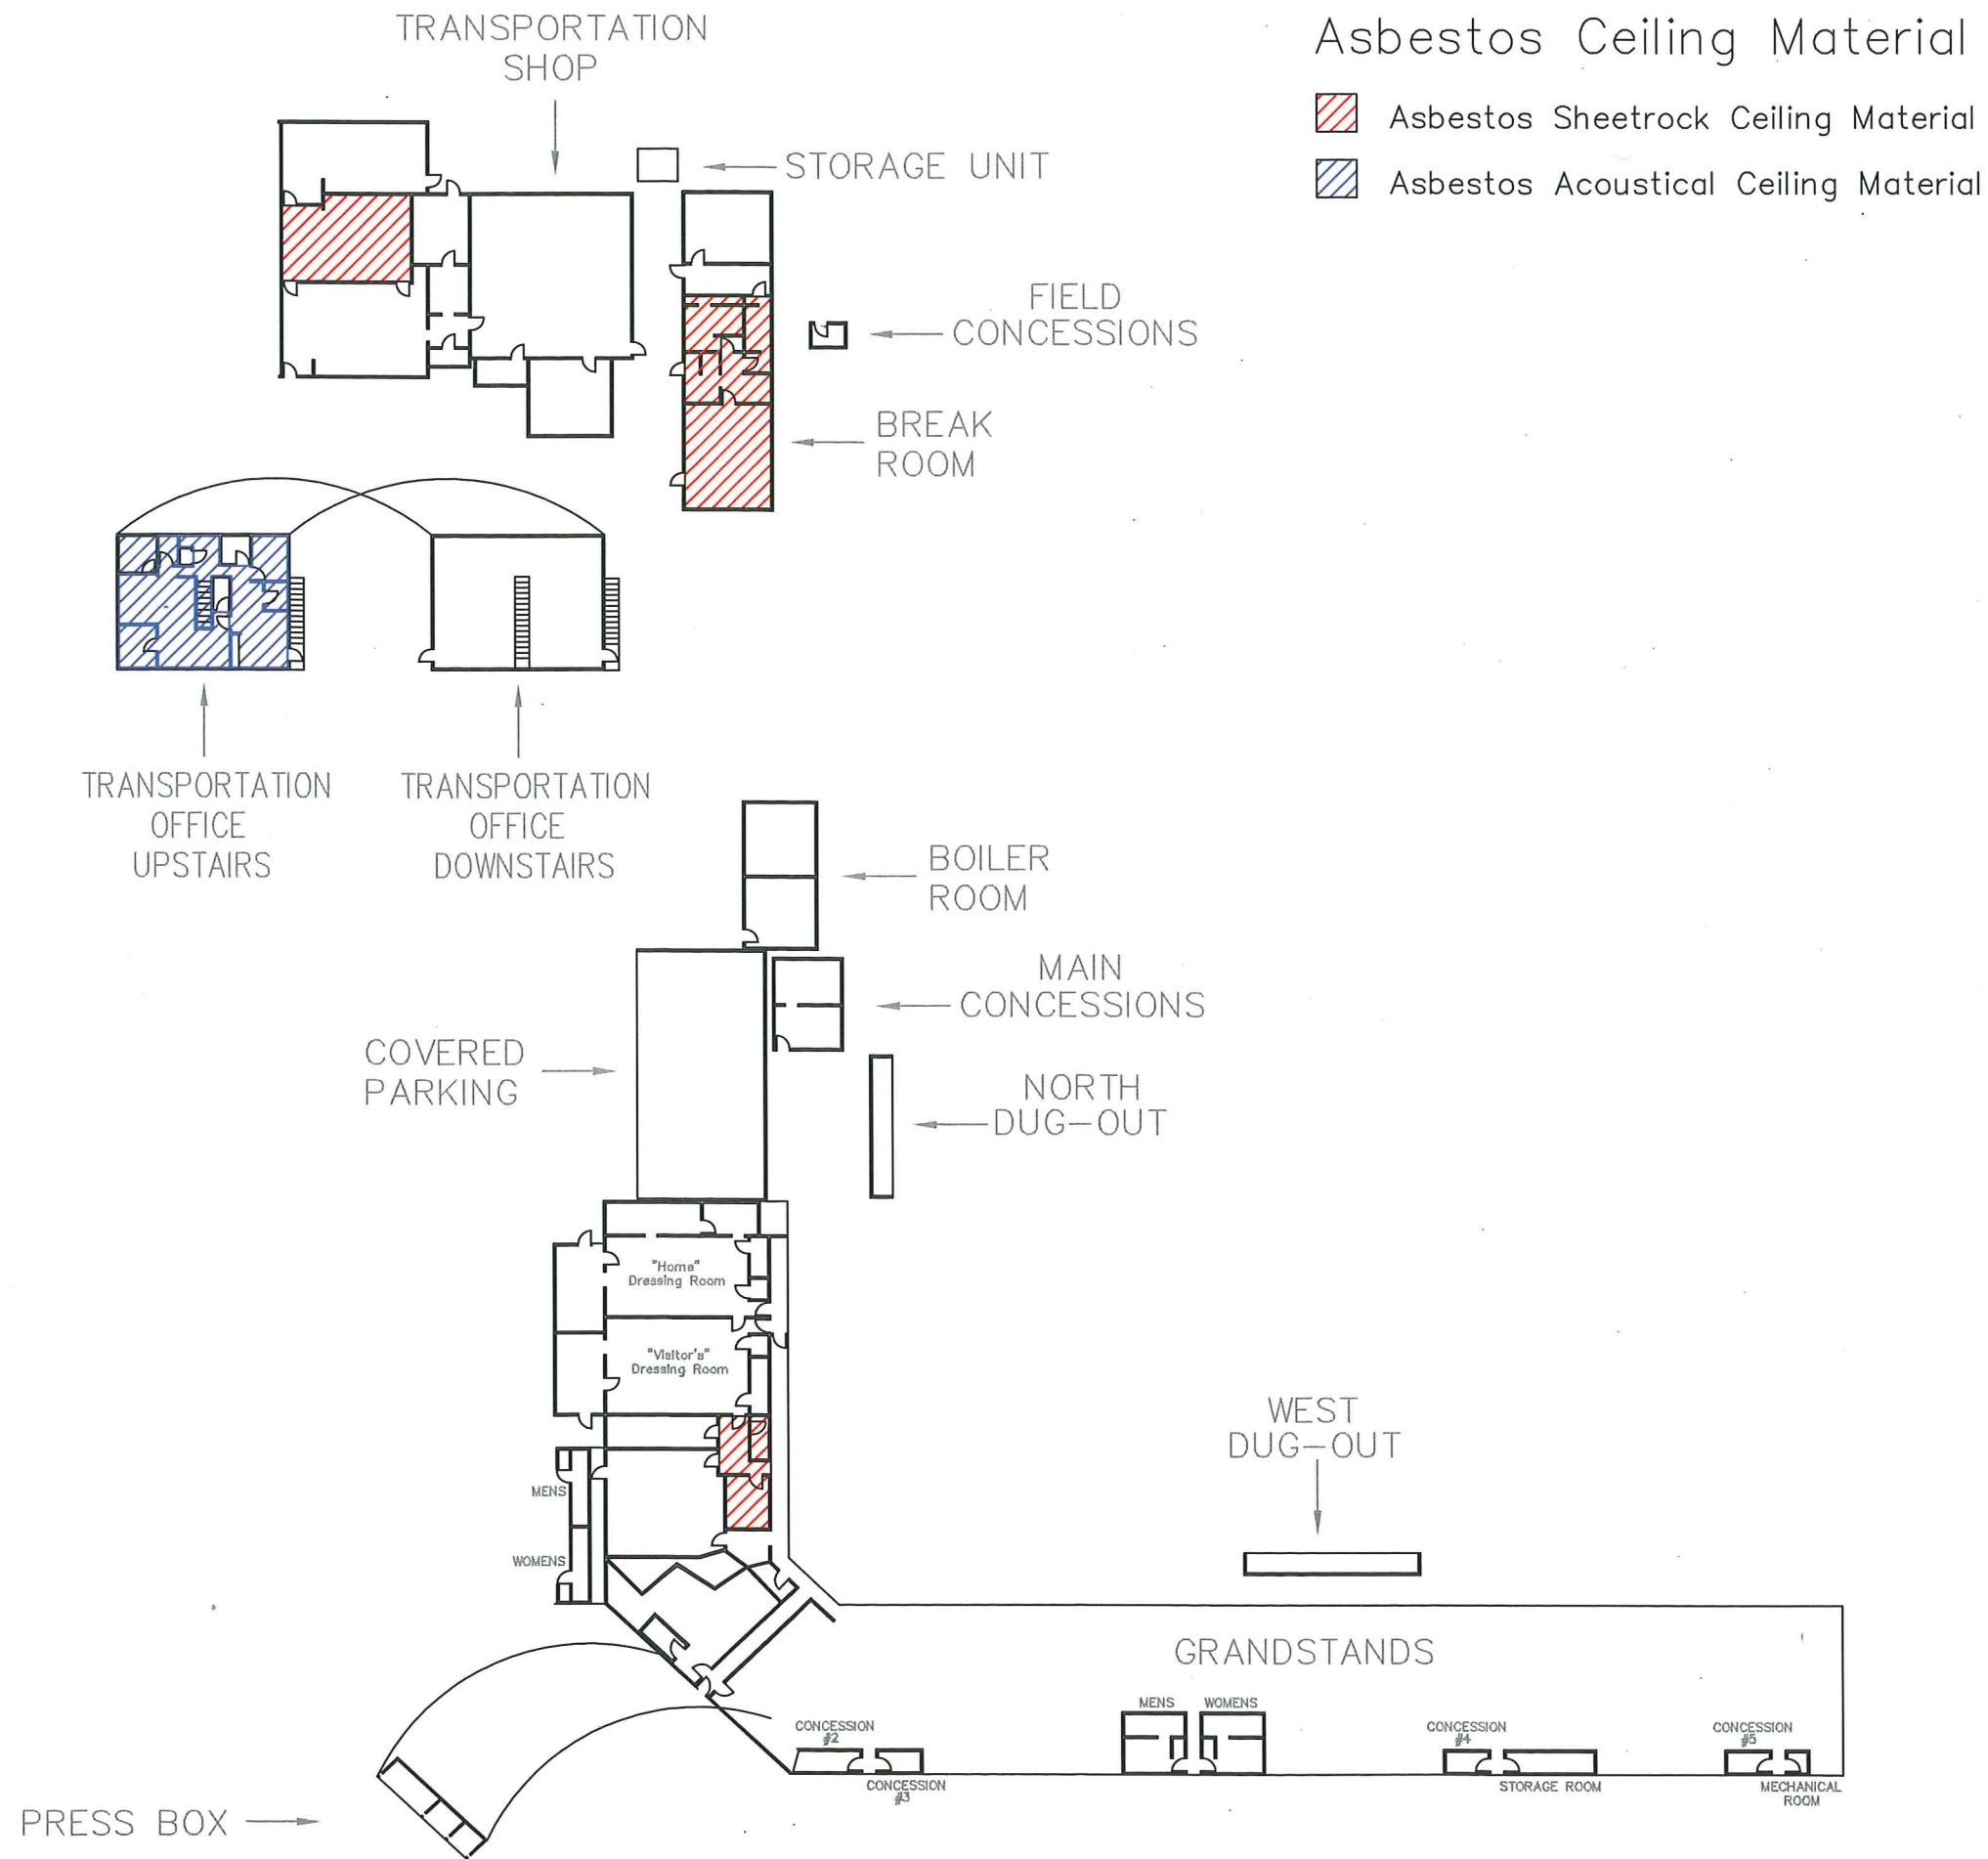


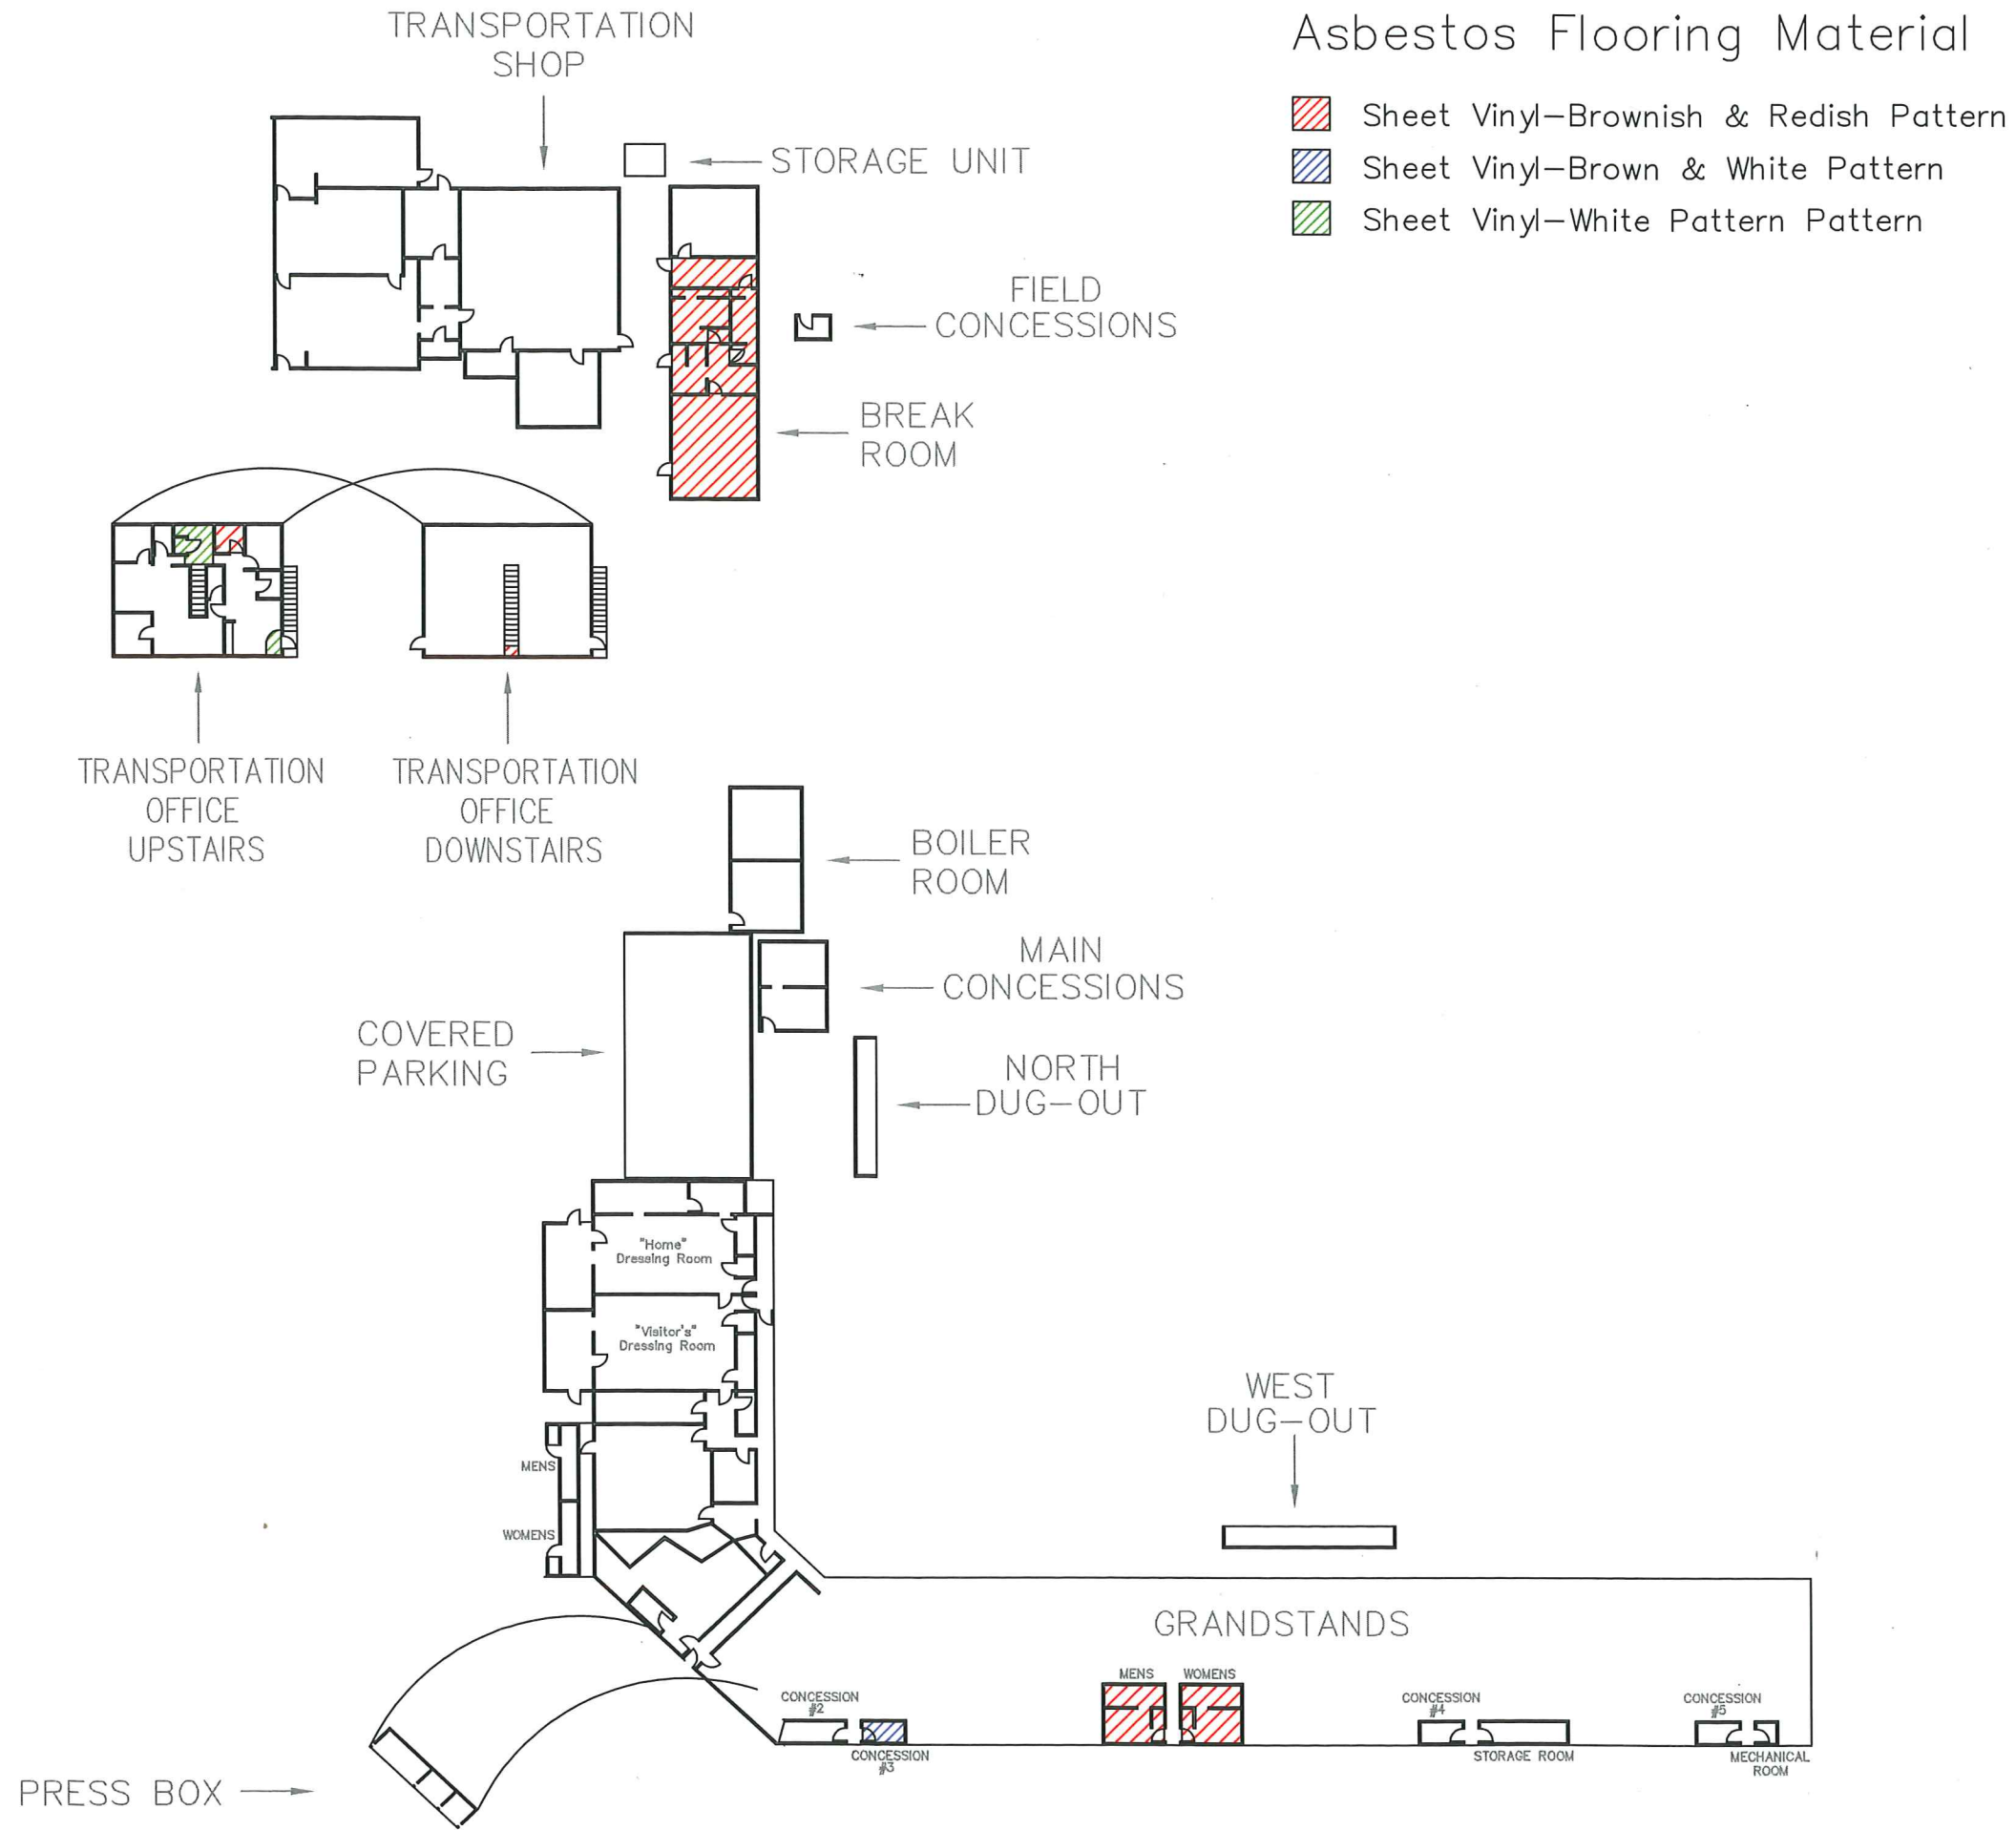

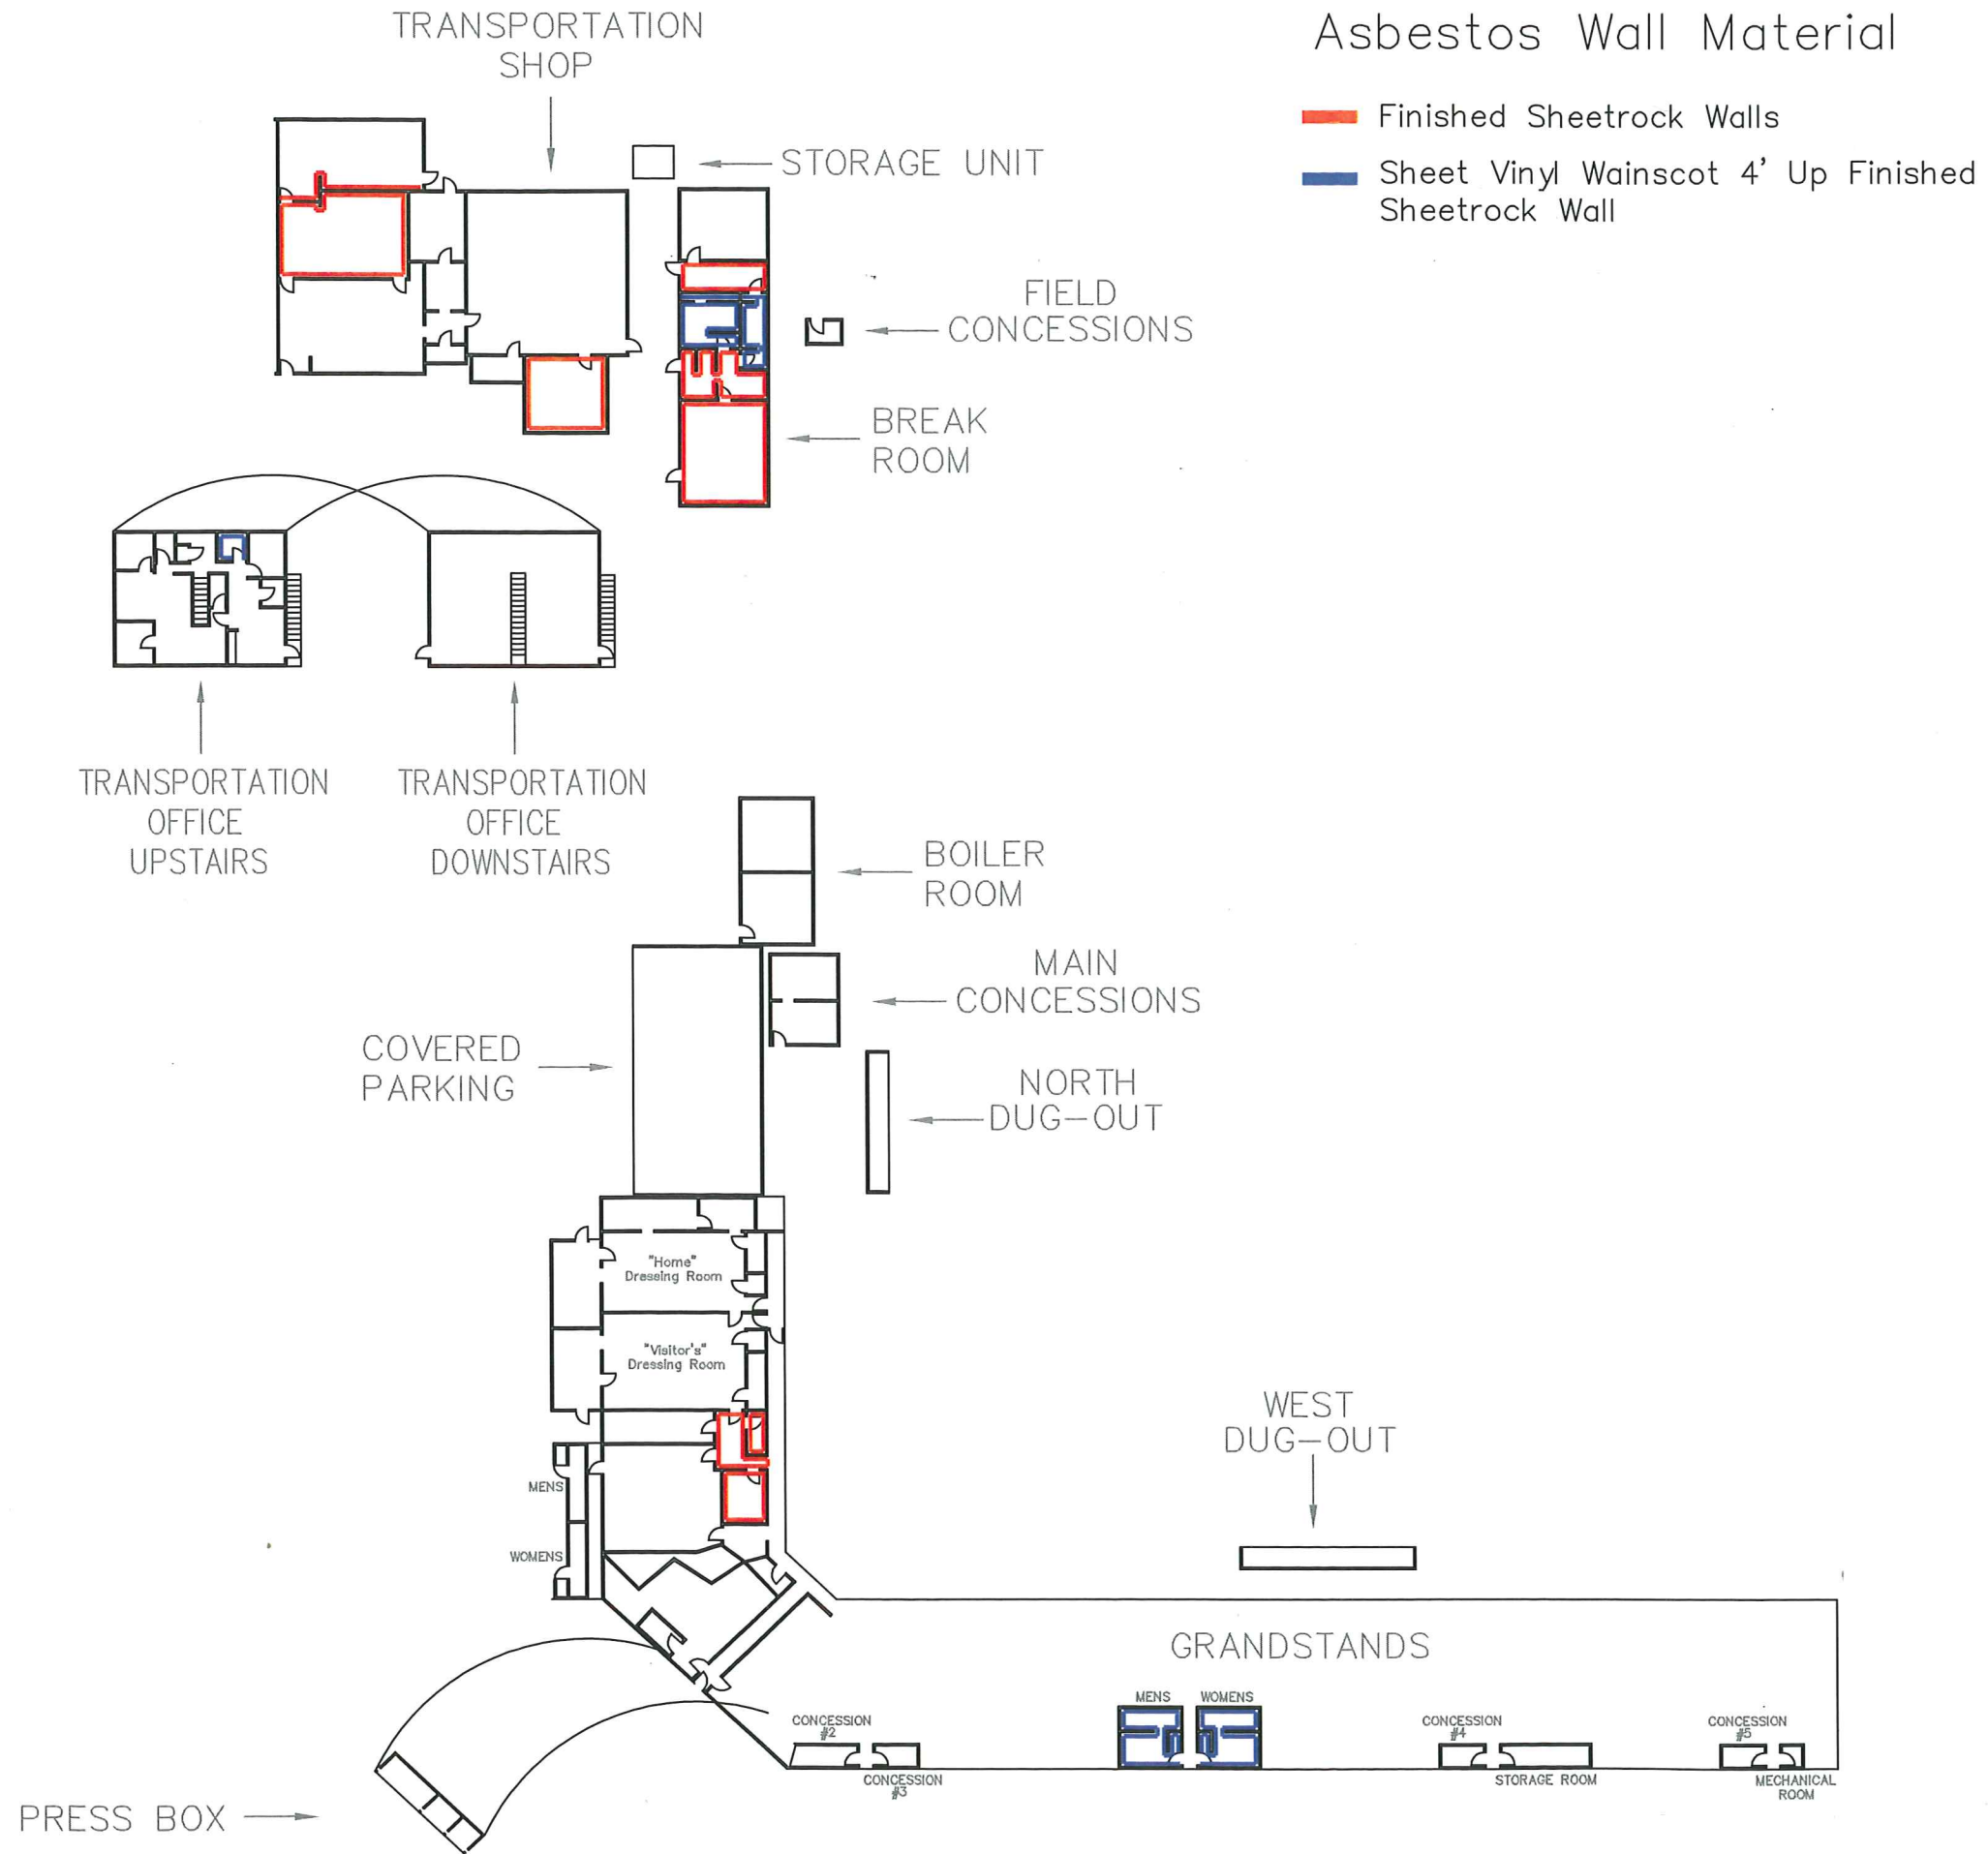



# Asbestos TSI Material

Asbestos TSI Pipe Insulation

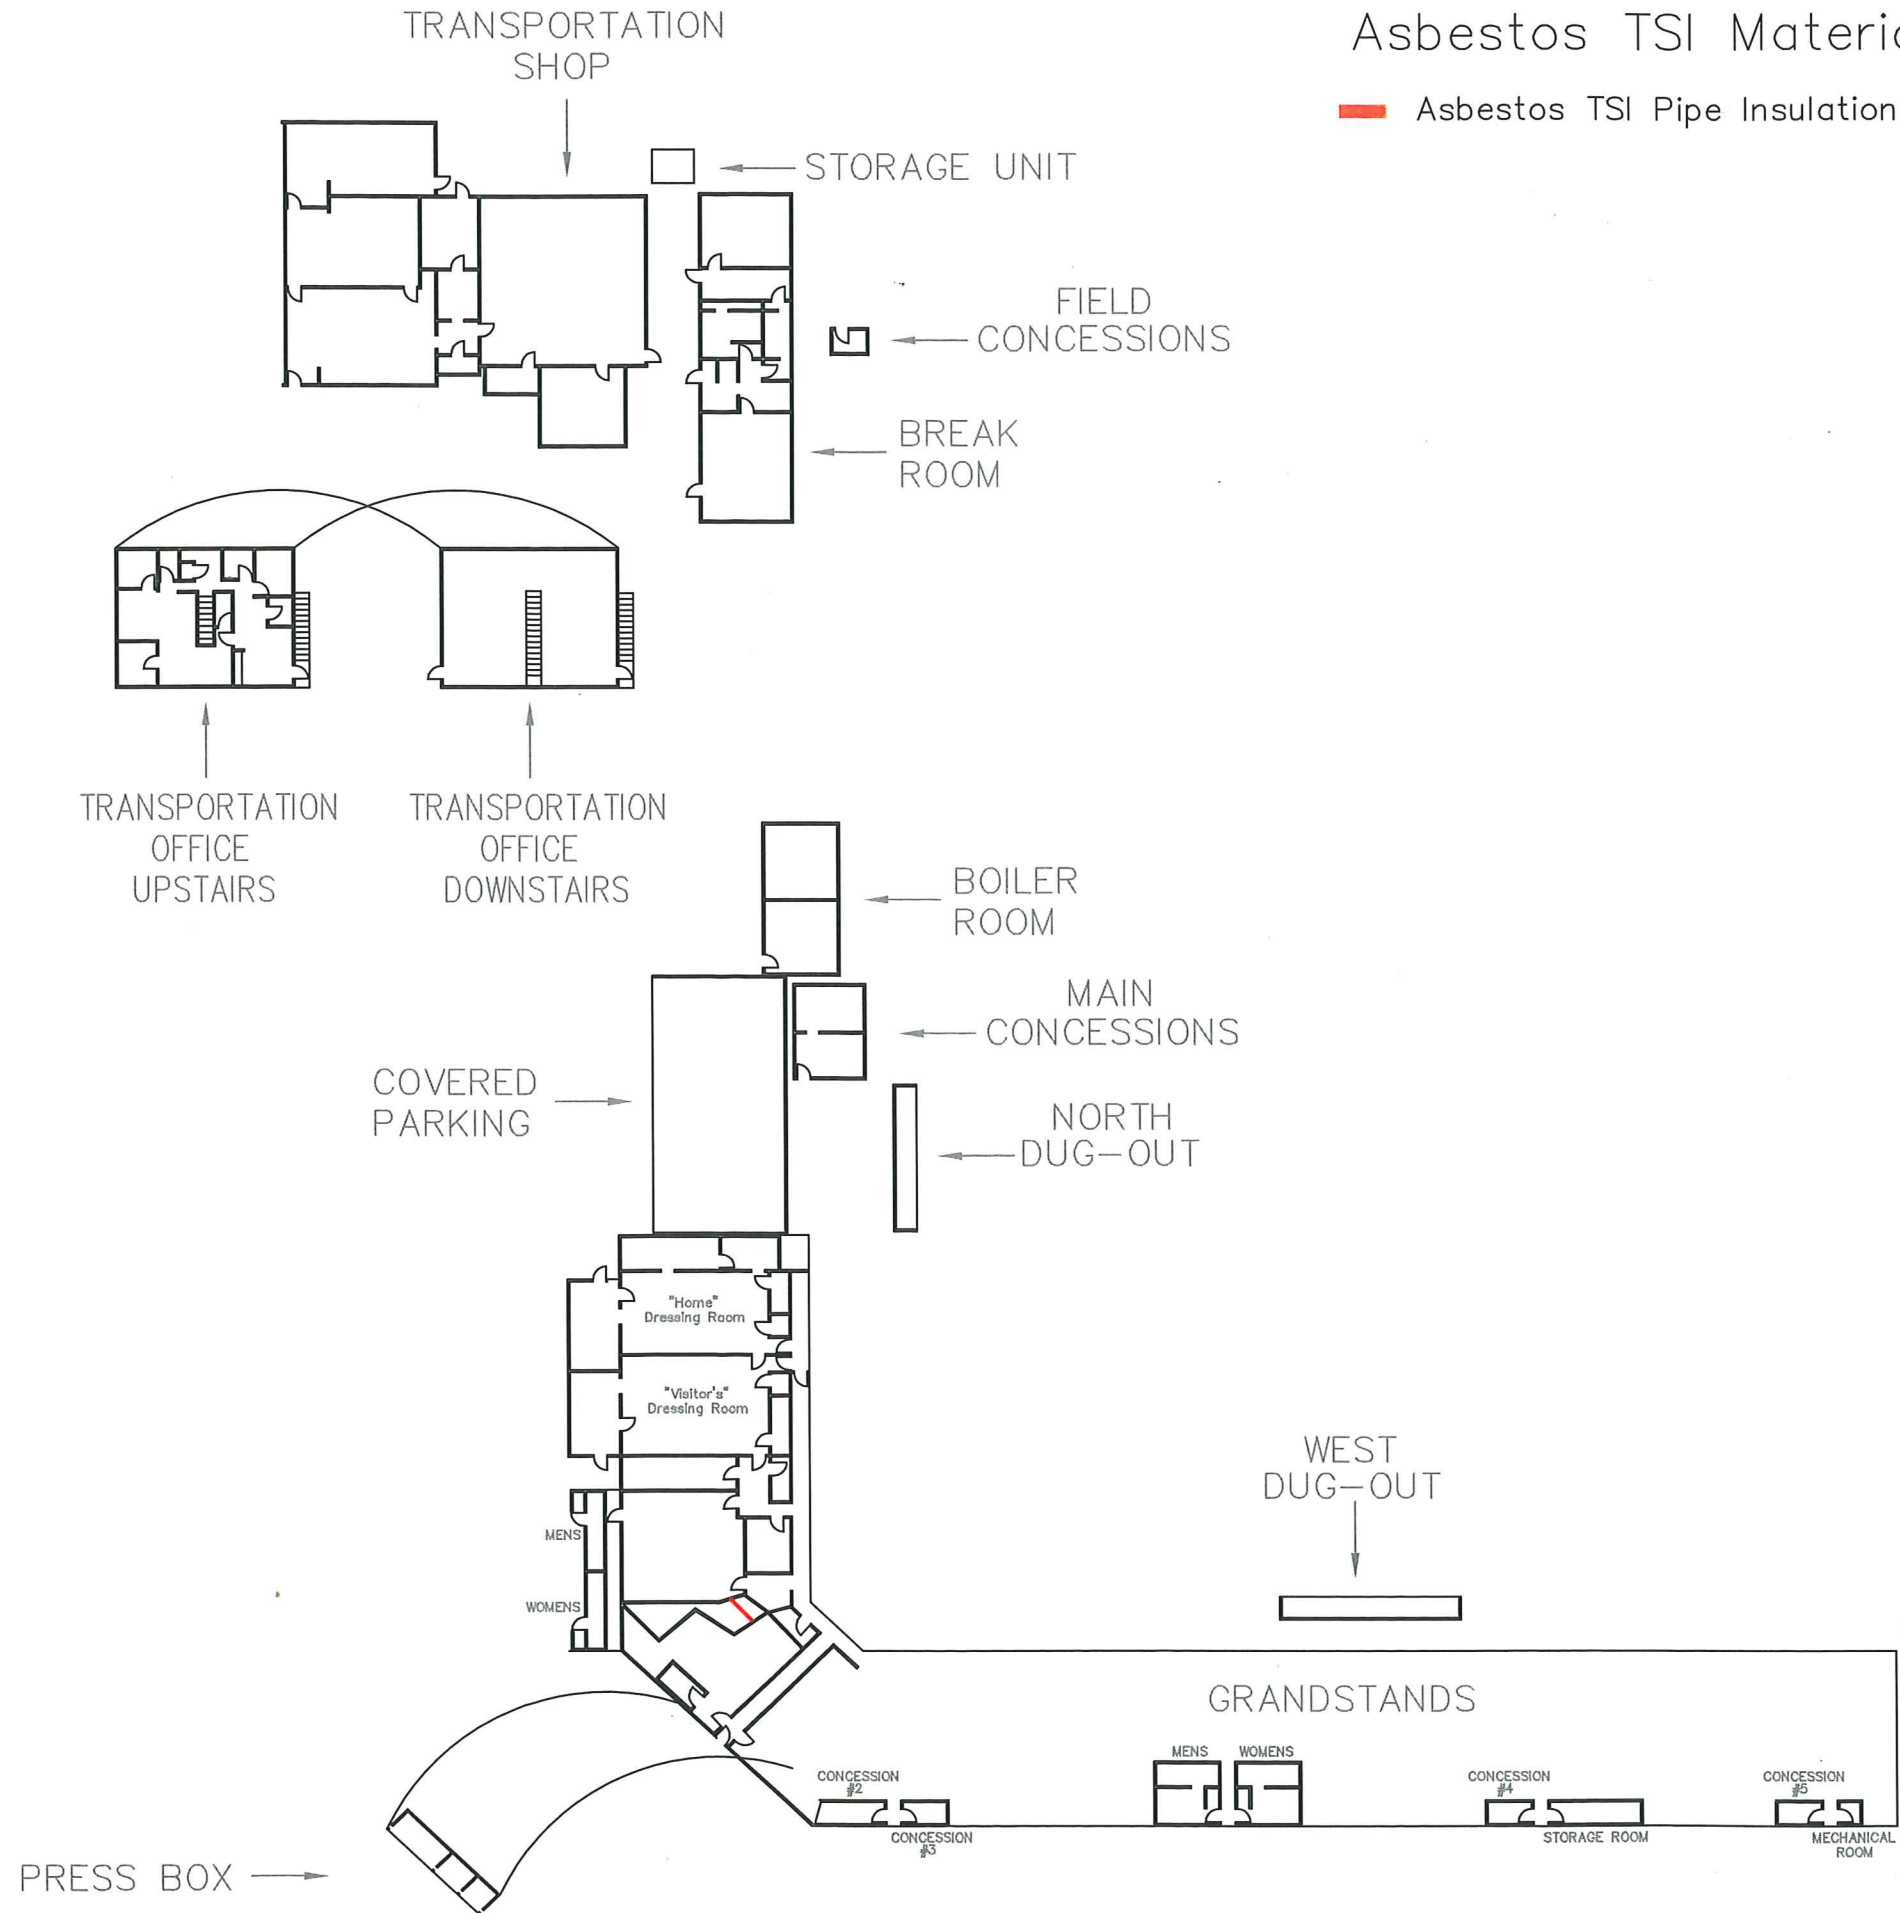




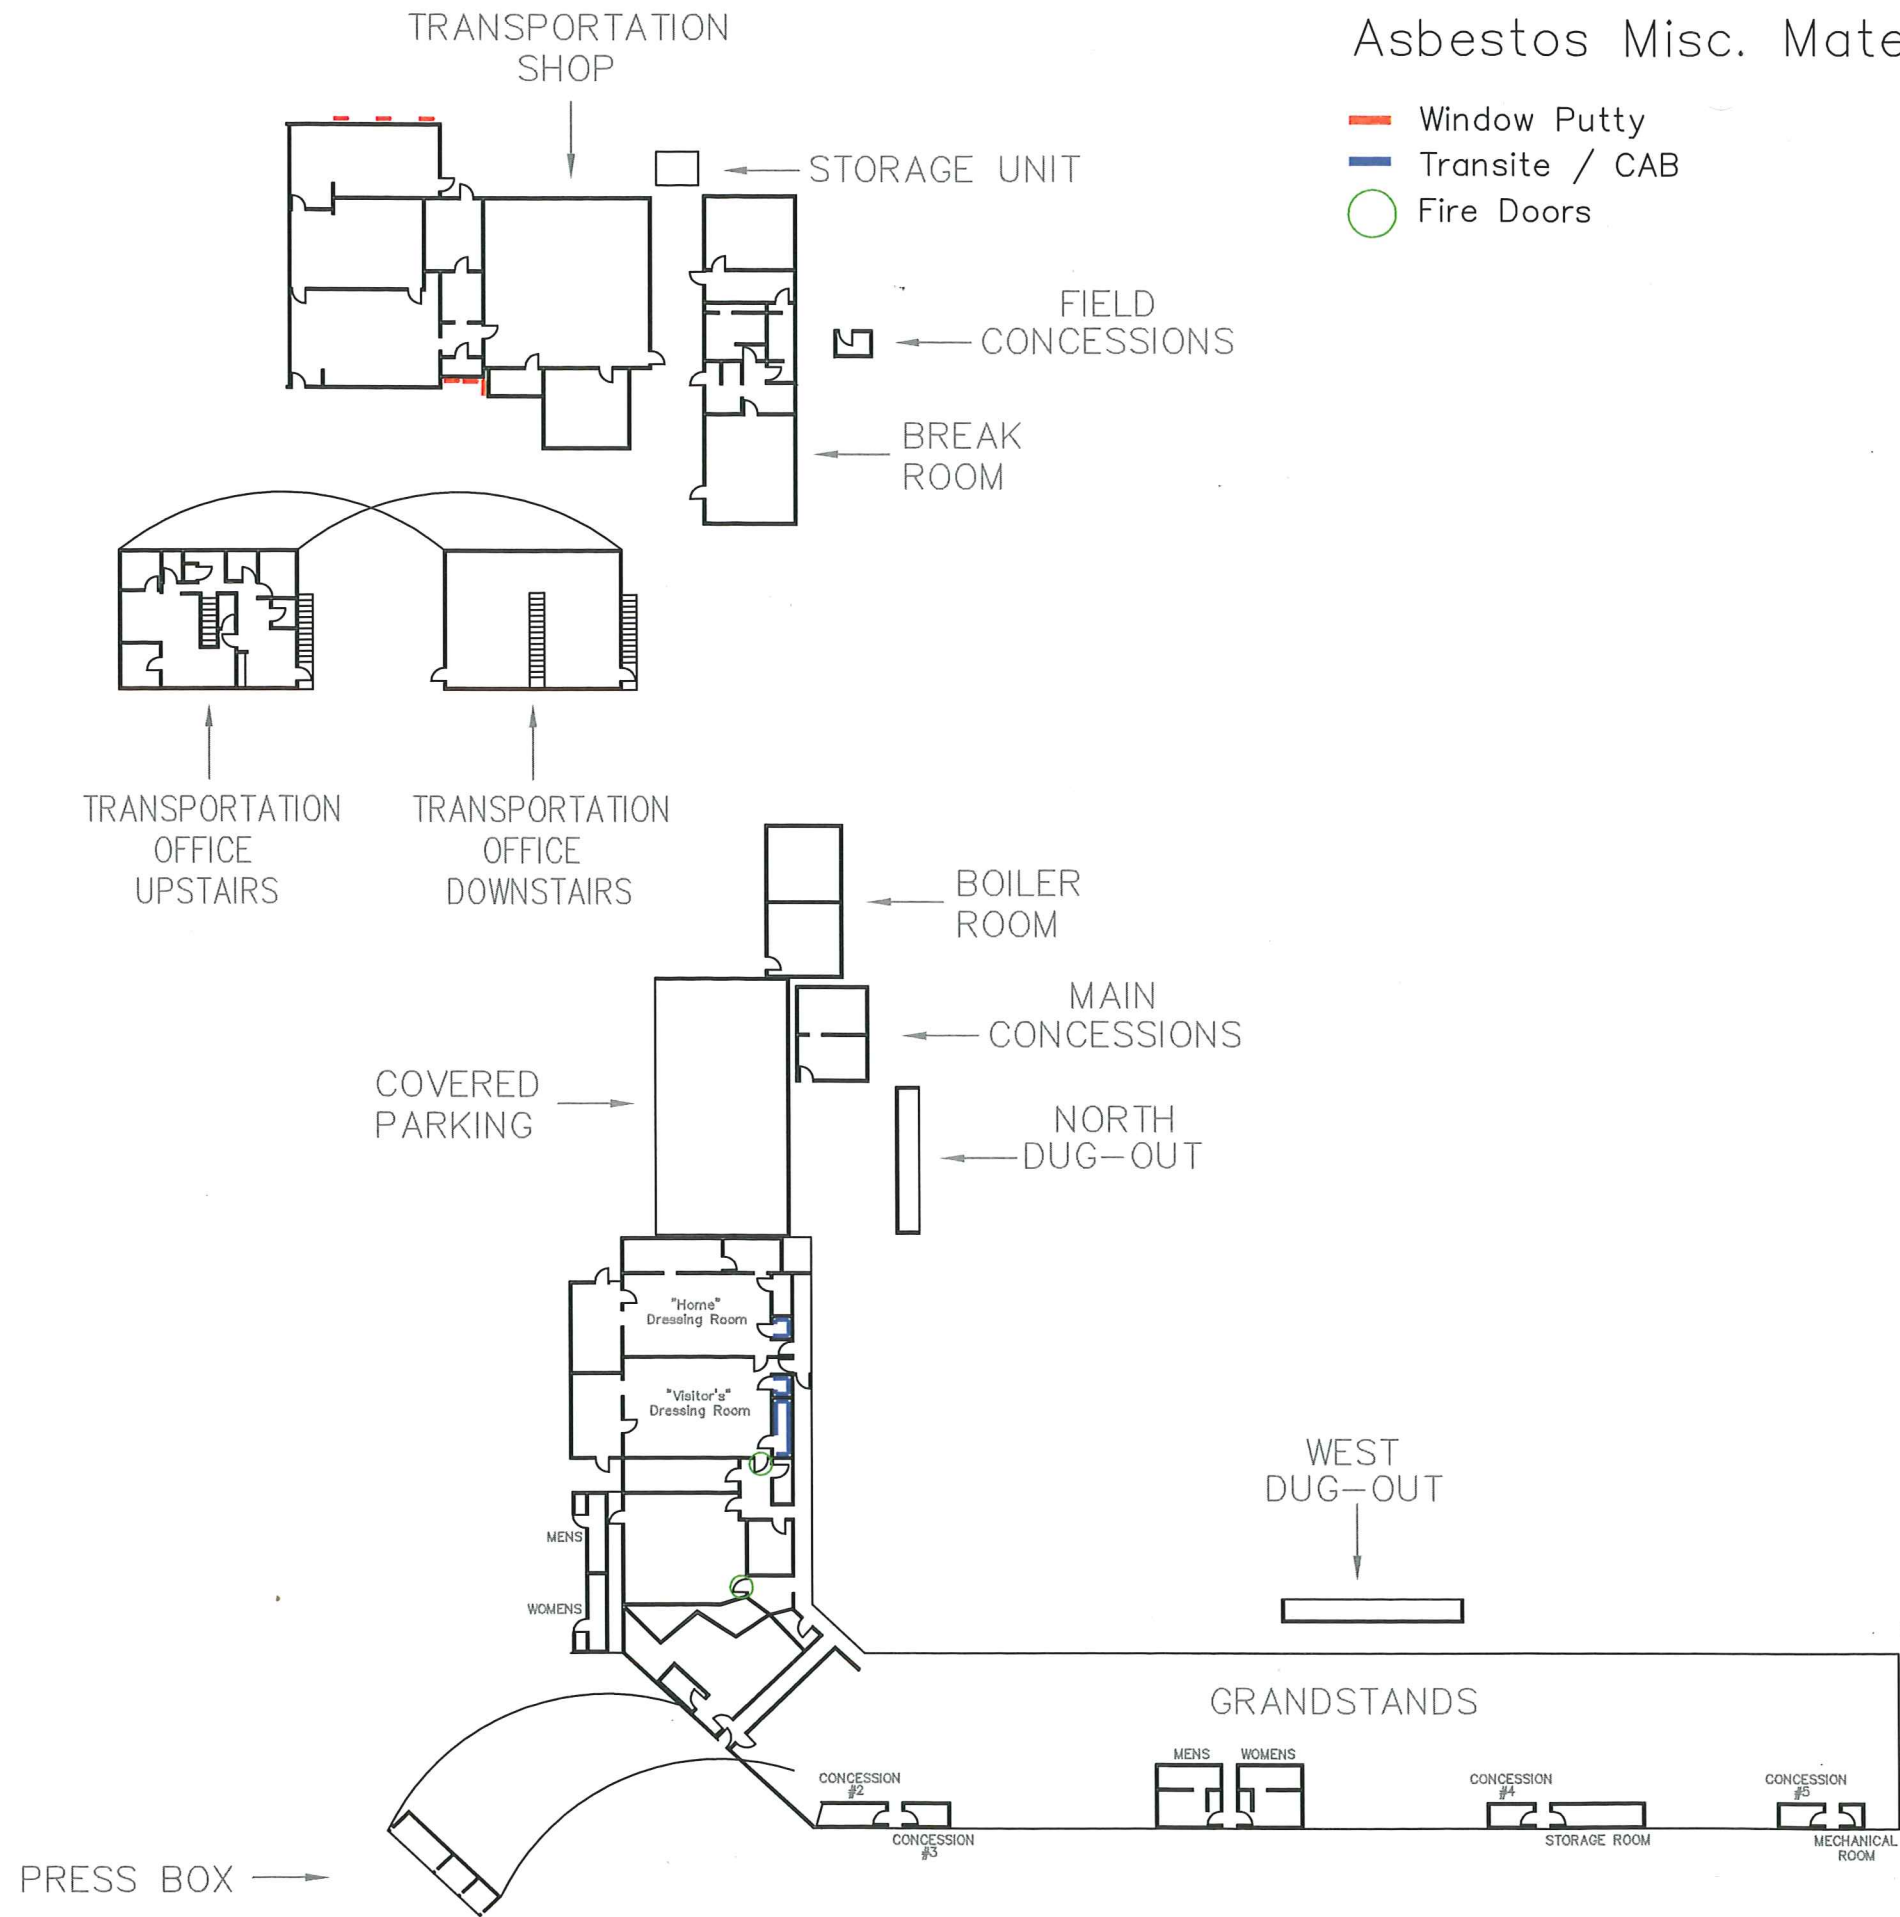

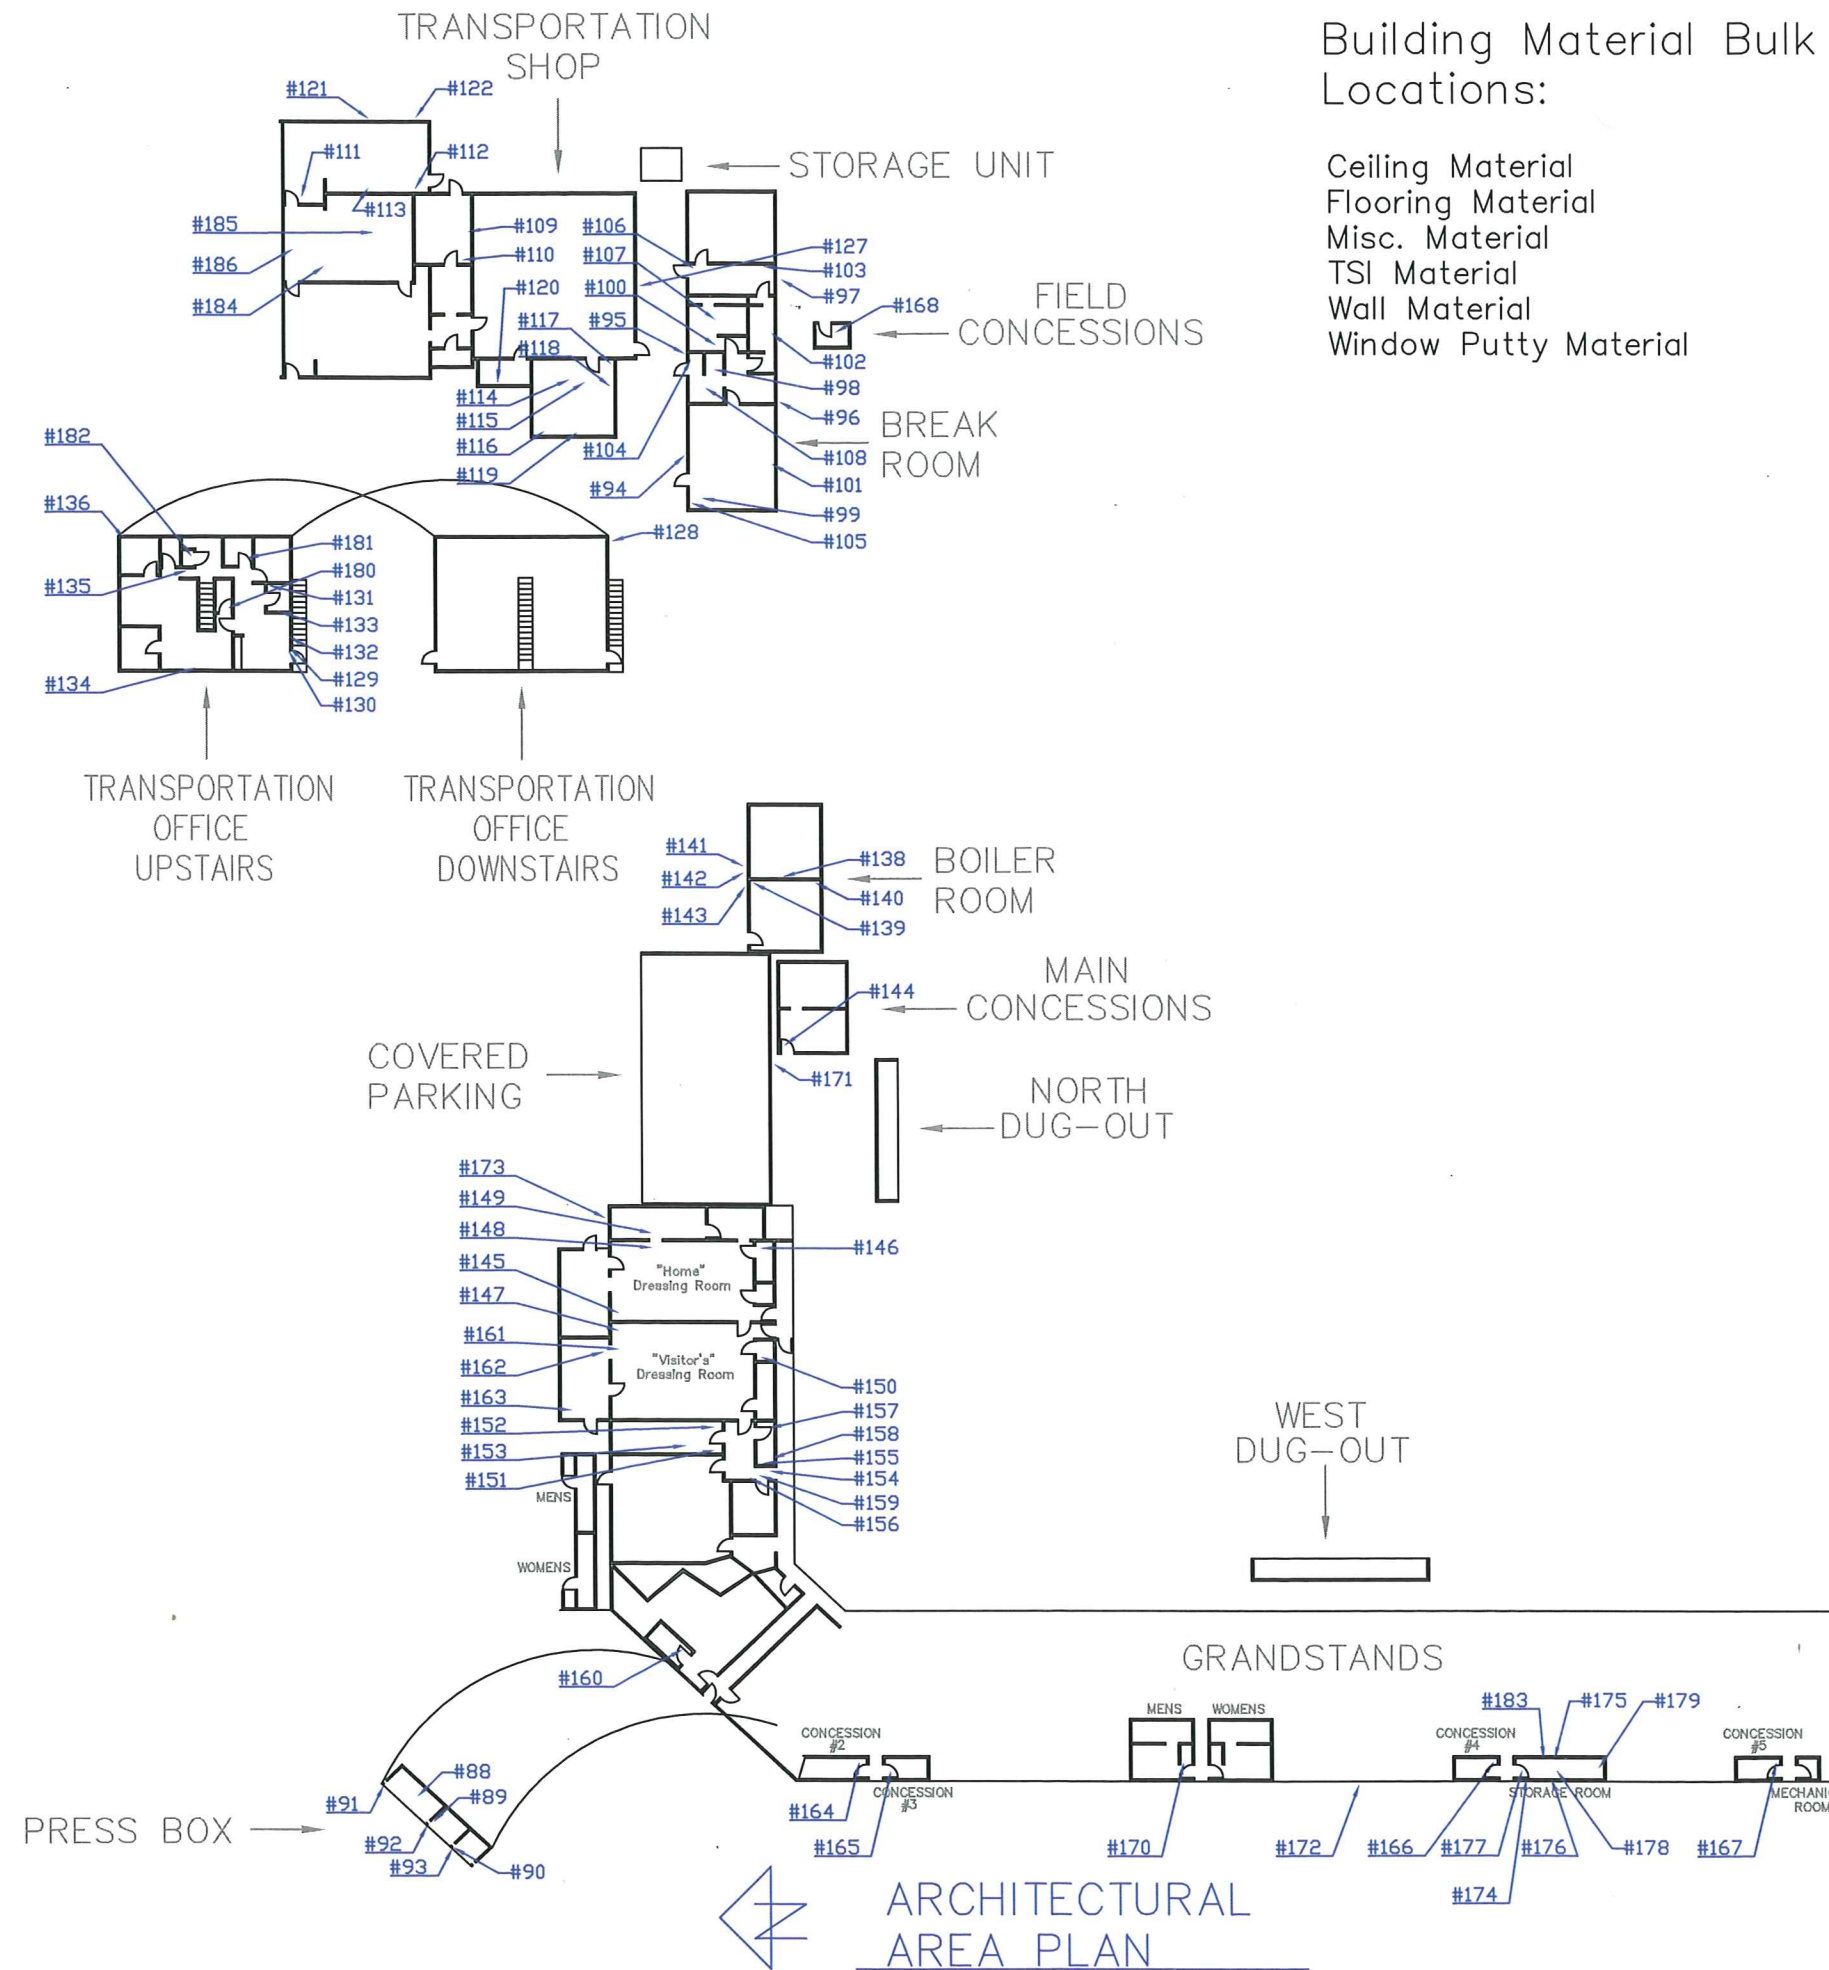

Building Material Bulk Sample Locations:

- Ceiling Material
- Flooring Material
- Misc. Material
- TSI Material
- Wall Material
- Window Putty Material

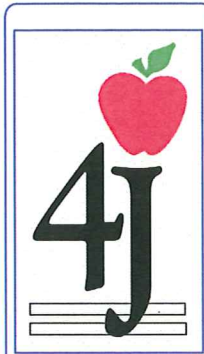


Facilities Management  
 School District 4J  
 715 W. 4th Avenue  
 Eugene, OR 97402  
 (541) 790-7400

CIVIC STADIUM BULK SAMPLE LOCATIONS  
 2079 OAK STREET  
 EUGENE, OREGON 97401

NOT TO SCALE  
 DATE: 8-24-10


DRAWN BY D. LEMONDS

A1

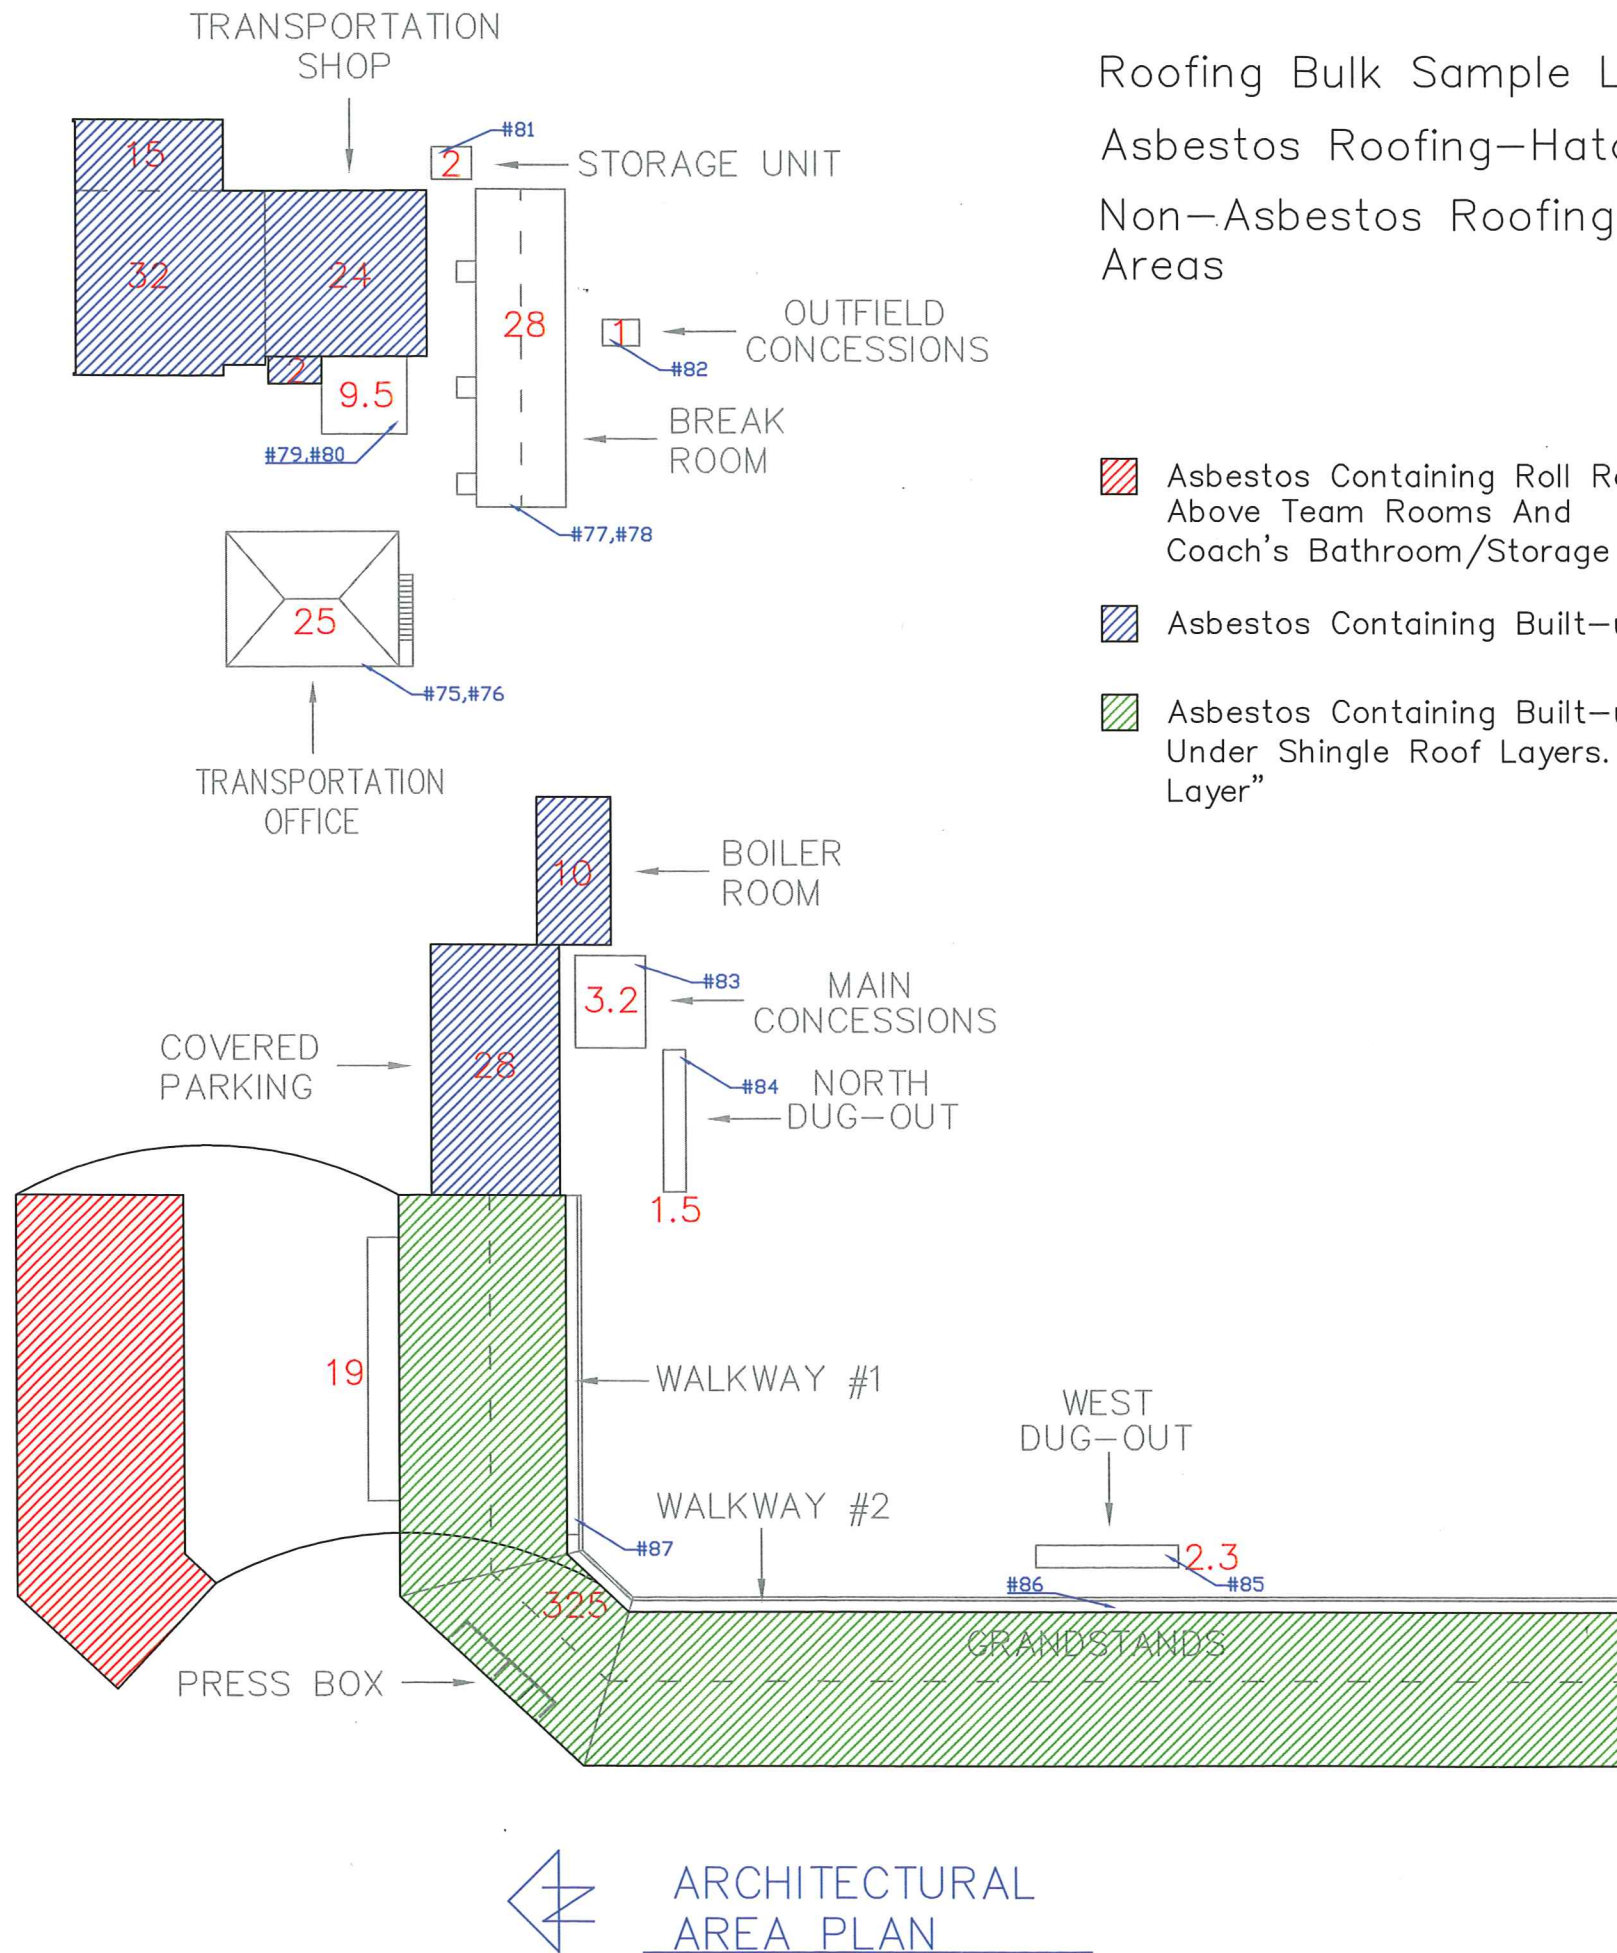

Roofing Bulk Sample Locations  
 Asbestos Roofing—Hatched Areas  
 Non-Asbestos Roofing—Unhatched Areas

- Asbestos Containing Roll Roofing Above Team Rooms And Coach's Bathroom/Storage Rooms
- Asbestos Containing Built-up Roofing
- Asbestos Containing Built-up Roofing Under Shingle Roof Layers. "Bottom Layer"

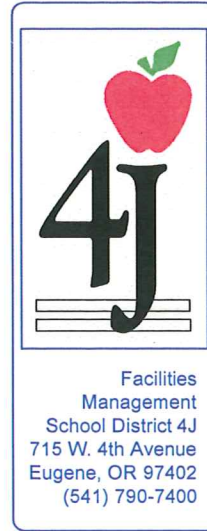

CIVIC STADIUM ROOFING BULK SAMPLE LOCATIONS  
 AND ROOFING SQUARE TOTALS IN RED NUMBERS  
 2079 OAK STREET  
 EUGENE, OREGON 97401

NOT TO SCALE  
 DATE: 8-24-10  
 DRAWN BY D. LEMONDS

A1

ARCHITECTURAL  
 AREA PLAN