

GENERAL NOTES

- THIS DRAWING IS DIAGRAMMATIC. IT IS FOR GENERAL INFORMATION.
- BUILDING DRAWING FOOTPRINT MAYBE INACCURATE OR NOT TO SCALE. CONTRACTOR IS TO FIELD VERIFY ALL MATERIAL LOCATIONS AND QUANTITIES.
- ABATEMENT CONTRACTOR IS TO COORDINATE HIS WORK WITH THE OWNER AND GENERAL CONTRACTOR INCLUDING BUT NOT LIMITED TO; SCHEDULING, PHASING, ACCESS, SECURITY, STAGING, PROTECT AND SAVE ITEMS, SALVAGE, ISSOLATION OR LOCKOUTT/AGOUT OF UTILITIES AND
- IF SUSPECT MATERIALS ARE UNCOVERED DURING
 ABATEMENT, DEMOLITION OR RENOVATION THAT ARE NOT
 IDENTIFIED OR SAMPLED IN THE HAZARDOUS MATERIALS
 SURVEY REPORT OR SHOWN ON THIS DRAWING, STOP WORK
 AND CONTACT THE HAZARDOUS MATERIALS CONSULTANT
 AND THE JOB SUPERINTENDENT FOR ADDITIONAL TESTING. ABATEMENT CONTRACTOR SHALL PERFORM ALL SELECTIVE DEMOLITION AS NEEDED TO ACCESS AND ABATE ASBESTOS-CONTAINING MATERIALS.
- ALL CONTRACTORS AND SUB-CONTRACTOR PERFORMING DEMOLITION OR RENOVATION ACTIVITIES ON PAINTED SURFACES ARE TO COMPLY WITH ALL APPLICABLE LEAD PAINT REGULATIONS IN OAR 437-DIVISION 3, 1926 62 LEAD IN CONSTRUCTION INDUSTRY STANDARDS.
- REFERENCE HAZARDOUS MATERIALS SURVEY REPORT AND PROJECT ABATEMENT SPECIFICATIONS FOR ADDITIONAL INFORMATION.
- BASE BID ESTIMATED QUANTITIES OF HAZARDOUS MATERIALS TO BE REMOVED
- REMOVE APPROX. 5,500 SF OF ASBESTOS- CONTAINING FLOOR TILE AND ASSOCIATED MASTIC AND LEVELING COMPOUND UNDER CARPET (ON CONCRETE). SEE LEGEND. REMOVE APPROX 2,575 SF OF ASBESTOS- CONTAINING FLOOR TILE AND ASSOCIATED MASTIC AND LEVELING COMPOUND (ON CONCRETE). SEE LEGEND
- REMOVE APPROX 48 LF OF ASBESTOS- CONTAINING FLOOR TILE AND ASSOCIATED MASTIC AND LEVELING COMPOUND UNDER NON-ACM WALL SEE LEGEND.



REMOVE APPROX 3,150 SF OF ASBESTOS- CONTAINING FLOOR TILE AND ASSOCIATED MASTIC AND LEVELING COMPOUND UNDER CARPET (ON CONCRETE). SEE LEGEND.

REMOVE APPROX 24 LF OF ASBESTOS- CONTAINING FLOOR TILE AND ASSOCIATED MASTIC AND LEVELING COMPOUND UNDER NON-ACM WALL SEE LEGEND.

FLOORING MATERIAL ABATEMENT PLAN 52212,000


HAZARDOUS




H M M

읶

EUGENE SCHOOL DISTRICT 4J GILHAM ELEMENTARY SCHOOL - PHASE 1 RENOVATIONS 3307 HONEYWOOD STREET **EUGENE, OREGON**





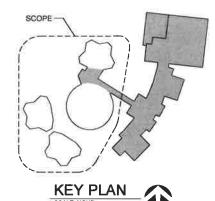

GENERAL NOTES

- 1. THIS DRAWING IS DIAGRAMMATIC, IT IS FOR GENERAL INFORMATION.
- 2. BUILDING DRAWING FOOTPRINT MAYBE INACCURATE OR NOT TO SCALE, CONTRACTOR IS TO FIELD VERIFY ALL MATERIAL LOCATIONS AND QUANTITIES.
- 3. ABATEMENT CONTRACTOR IS TO COORDINATE HIS WORK BUT NOT LIMITED TO: SCHEDULING, PHASING, ACCESS. ISOLATION OR LOCKOUT/TAGOUT OF UTILITIES AND
- 5. ABATEMENT CONTRACTOR SHALL PERFORM ALL SELECTIVE DEMOLITION AS NEEDED TO ACCESS AND ABATE ASBESTOS-CONTAINING MATERIALS
- 6. ALL CONTRACTORS AND SUB-CONTRACTOR PERFORMING DEMOLITION OR RENOVATION ACTIVITIES ON PAINTED SURFACES ARE TO COMPLY WITH ALL APPLICABLE LEAD
- 7. ABATEMENT CONTRACTOR SHALL REMOVE AND PROPERLY RECYCLE ALL MERCURY VAPOR LIGHT TUBES FROM
 FLUORESCENT LIGHTING FIXTURES. CONTRACTOR SHALL FIELD VERIFY THAT FLUORESCENT LIGHTING FIXTURE BALLASTS ARE NON-PCB CONTAINING, ANY BALLASTS NOT SPECIFICALLY LABELED AS "NON-PCB" SHALL BE REMOVED AND PROPERLY DISPOSED OF BY THE ABATEMENT
- 8. REFERENCE HAZARDOUS MATERIALS SURVEY REPORT AND PROJECT ABATEMENT SPECIFICATIONS FOR ADDITIONAL INFORMATION.

HAZARDOUS MATERIALS TO BE REMOVED

- 1. REMOVE APPROX. 188 SE OF ASBESTOS-CONTAINING JOINT COMPOUND AND MASTIC ABOVE CEILING TILE SEE LEGEND
- 2. REMOVE APPROX. 180 SF OF ASBESTOS-CONTAINING CEMENT BOARD AND ASSOCIATED MASTIC. SEE LEGEND.
- ASBESTOS- CONTAINING JOINT COMPOUND AND MASTIC ABOVE CEILING. SEE KEY NOTES.

- 1. REMOVE APPROX. 94 SF OF ASBESTOS-CONTAINING JOINT COMPOUND AND MASTIC ABOVE CEILING TILE. SEE LEGEND.
- BOARD AND ASSOCIATED MASTIC: SEE LEGEND.
- 3. REMOVE APPROX. 80 LF OF PERIMETER CAULK / SEALANT AT GRID AND LOOSE ASBESTOS-CONTAINING JOINT COMPOUND AND MASTIC ABOVE CEILING. SEE KEY NOTES.



EUGENE SCHOOL DISTRICT 4J
ELEMENTARY SCHOOL - PHASE 1 RENOVATIONS
3307 HONEYWOOD STREET
EUGENE, OREGON

GILHAM

HAZARDOUS

TSI AND MISC.

MATERIAL

ABATEMENT

52212.000

OF

PBS

Engineering + Environmental

- WITH THE OWNER AND GENERAL CONTRACTOR INCLUDING SECURITY, STAGING, PROTECT AND SAVE ITEMS, SALVAGE,
- 4. IF SUSPECT MATERIALS ARE UNCOVERED DURING ABATEMENT, DEMOLITION OR RENOVATION THAT ARE NOT IDENTIFIED OR SAMPLED IN THE HAZARDOUS MATERIALS SURVEY REPORT OR SHOWN ON THIS DRAWING, STOP WORK AND CONTACT THE HAZARDOUS MATERIALS CONSULTANT AND THE JOB SUPERINTENDENT FOR ADDITIONAL TESTING
- PAINT REGULATIONS IN OAR 437-DIVISION 3, 1926.62 LEAD IN CONSTRUCTION INDUSTRY STANDARDS.

BASE BID - ESTIMATED QUANTITIES OF

- 3. REMOVE APPROX. 160 LF OF ASBESTOS-CONTAINING PERIMETER CAULK / SEALANT AT GRID AND LOOSE

ALT. BID #1 - ESTIMATED QUANTITIES OF HAZARDOUS MATERIALS TO BE REMOVED

- 2. REMOVE APPROX. 90 SF OF ASBESTOS-CONTAINING CEMENT

PLAN CHECKED FEBRUARY 2016

HM₂

HAZARDOUS TSI AND MISC. MATERIAL ABATEMENT