

Long Range Facility Audit 2009-2019

Clovis Unified School District • August 2009



Clovis West High School



Table of Contents

Section Contents

- 1 Acknowledgements
Executive Summary/Planning Guidelines
 - Project Scope
 - Project Timeline
 - Project Process
 - Project Recommendations
 - Cost Estimation
 - Final Deliverables
 - The Implementation of a 10-Year Facility Needs Master Plan
- 2 District-Wide Project Data
- 3 Site Requested Project List
 - Group 1: Other Schools/David E. Cook Center
 - Group 2: Buchanan Area
 - Group 3: Clovis North Area
 - Group 4: Clovis Area
 - Group 5: Clovis West Area
 - Group 6: Clovis East Area
- 4 Site Package



Acknowledgements

HMC Architects submits the CUSD Facility Needs Assessment with acknowledgement to the District's Facility Division, Maintenance & Operations staff, Director of Construction & Engineering and over-all support from the office of the Assistant Superintendent, Facility Services. HMC would like to acknowledge the District Facility Audit Leadership team (listed below) for their support of the process to clarify and define the District building standards and their ongoing support of the facility audit process.

Board of Education

Sandra A. Bengel
Christopher Casado
Brian D. Heryford
Ginny Hovsepian
Elizabeth J. Sandoval
Scott Troescher
Jim van Volkinburg, DDS

District Superintendent

Terry Bradley, Ed.D, Superintendent

Steering Committee

Don Ulrich, Assistant Superintendent, Facility Services
Steve Ward, Associate Superintendent, Business Services
John Poytress, Director of Plant Operations
Stan Kawaguchi, Grounds Supervisor
Brad Pawlowski, Maintenance Supervisor
Chris Allen, Custodial Supervisor
Bill Rice, Custodial Supervisor
Robert Schram, Food Services Supervisor
Rick Lawson, Director of Construction Services
Dan Resciniti, Director of Technology Services
Joe Bjerke, Director of Transportation

Acknowledgements (cont'd)

HMC Architects and Harris Construction also recognize the following team of local consultants for their diligence in conducting a detailed assessment of the current facilities on 33 school sites and 12 District support facilities constructed prior to 2001 in the time schedule outlined by the District. In addition, all District facilities were assessed for the condition of technology. Their recommendations and insights are based on over 100 years of collective experience in public school construction.

Consultant	Company	Role
Scott Griffith	HMC Architects	Principal in Charge
Walt Byrd	HMC Architects	Project Manager
Jeff Berrios, Mandie Abels, Rick Sacksteder, Stanley Ng	HMC Architects	Building Conditions
Doug Reitz	Harris Construction	Cost Estimation & Scheduling
Tyler Arrigoni, John Fowler, Gil Galvan	OneInterface.net	Electrical & Technology
Gary Lindeman, David Oustad	Lawrence, Nye, Anderson	Mechanical & Plumbing
Sean Smith, Fred Wong	Blair, Church & Flynn	Site, Turf, Irrigation

Our team recognizes the extraordinary commitment of the Clovis community for supporting five local school bond measures, and the Clovis Unified School District Governing Board and Superintendent for their commitment to providing “world class” facilities for the students, staff and community. Faced with significant encroachments to the general fund, the CUSD Governing Board continues to prioritize funding for the construction of new schools, modernization and improvement of existing facilities, and Maintenance & Operation. Although our team has identified a significant amount of work for the District for over the next 10 years, every consultant commented on the excellent condition of the facilities targeted in this audit. Our team also recognizes the on-going efforts of the Plant Operations staff for their commitment to maintain all District facilities in excellent condition.

Last but not least, our team would like to express appreciation to HMC's Ontario Office for their support of this project. In particular, we would like to recognize Amanda Ishak and Matt Endsley. Amanda and Matt proved to be an invaluable resource for our team in producing a final product that will serve as a roadmap to provide outstanding facilities for the students and staff of the Clovis Unified School District.



Executive Summary/Planning Guidelines

The primary goal of the CUSD Long Range Facility Audit was to provide the same “standard” of learning environment for all students, and working environment for all employees. The Clovis Unified School District issued a Request for Proposals on October 12, 2008 to select a firm to conduct a Long Range Facility Needs Assessment. On December 1, 2008, the District selected HMC Architects, in partnership with Harris Construction, to clarify the District’s building and equipment standards, and to conduct a detailed facility needs assessment of existing facilities constructed prior to 2001. The condition of the technology infrastructure was assessed for all District sites, as well.

The objectives of the CUSD Facility Audit Request for Proposals were:

- Identify standards for the District’s infrastructure
- Assess District facilities constructed prior to 2001 against these standards
- Assess all District facilities against standards for technology infrastructure
- Identify , prioritize, and estimate costs for projects that will move all District facilities toward approved standards
- Identify projects into a 10 Year Facility Master Plan, with projects prioritized for 1-2 years, 3-5 years, and 6-10 years

Project Scope

The scope of work for the CUSD Long Range Facility Audit included conducting a comprehensive audit of all current CUSD facilities constructed prior to 2001 (all sites were assessed for the condition of the technology infrastructure), including facilitating multiple meetings with site and District staff to clarify building and equipment standards for the following disciplines:

- Site Work
- Architectural/Building Conditions
- HVAC
- Plumbing
- Electrical
- Technology on all District facilities



Project Timeline

Phase 1: Completed by January 31, 2009


- Facilitate multiple meetings with District personnel to establish facility and equipment standards for disciplines identified

Phase 2: Completed by May 31, 2009

- Conduct an assessment of all facilities constructed prior to 2001 and identify projects that will bring identified deficiencies up to approved District standards

Phase 3: Completed by June 30, 2009

- Conduct a Governing Board workshop to update the Board and District Administration regarding the status of the CUSD Long Range Facility Audit
- Present a final report to District Leadership and CUSD Governing Board in both a written and electronic format

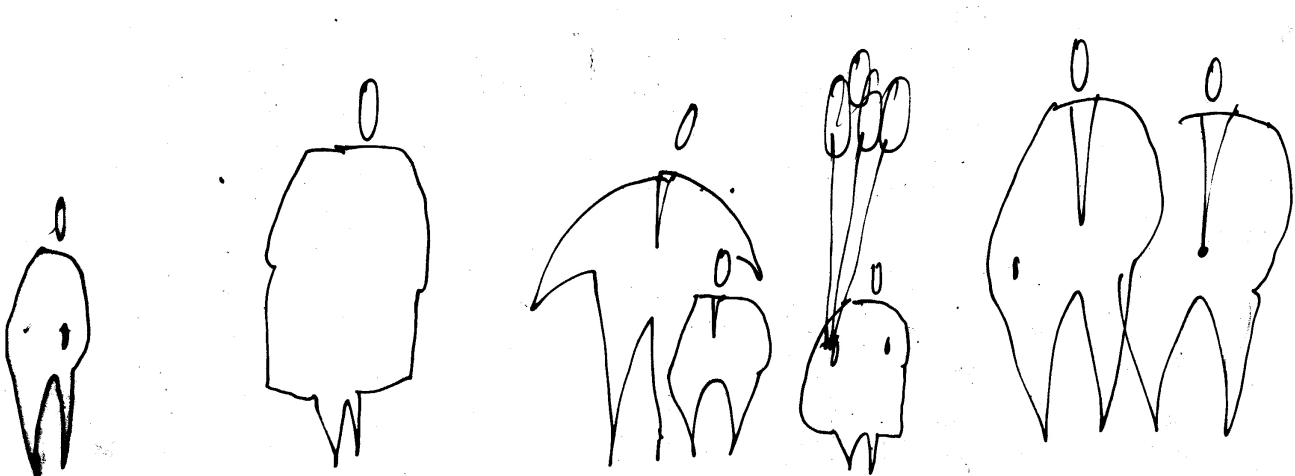



Project Process

The following phases of work were established to address the scope of the CUSD Long Range Facility Audit within the timeframe established by the District. The expected outcome was to deliver a 10-Year Facility Master Plan, based on professional experience, and aligned with current and future funding opportunities.

Phase 1: Meet with District Facility Leadership Team to clarify District Building Standards

- Task 1: Introduce Facility Needs Audit process to District Leadership through multiple District forums (Supt. Cabinet, Supt. Staff, Area Leadership meeting, District SART)
- Task 2: Review the following data related to the standard and condition of current facilities
- Elementary Education Specifications and Building Standards
 - District maintenance records
 - 10-year deferred maintenance program
 - 10-year District Facilities Master Plan
- Task 3: Meet with District Facility Leadership Team
- Scheduled milestones for the project
 - Clarify educational program goals and District Strategic Plan
 - Clarify the program for District Support Facilities
 - Establish sustainability goals and green practices for the project
 - Clarify equity standards and community expectations for each school
 - Establish District Building & Equipment Standards
- Task 4: Meet with site Principals and designated District staff of targeted sites:
- The facility audit process and purpose
 - Schedules and tasks
 - Site/facility self-assessment Zoomerang model
 - Clarify difference between District maintenance projects and facility audit projects

Phase 2: Comprehensive Assessment of Facilities to identify deficiencies to District Standards

- Task 1: Project Monitoring Schedule
- Establish milestone meetings to include:
 - Site kick-off meetings
 - Site self-assessment schedule
 - Site visitations
 - Summery schedule with site staff
 - Conduct "mock" facility audit of elementary, secondary and support site
 - Train consultants for consistency
 - Establish common check lists for consultant to report findings from site visits
 - Provide results of site self-assessment surveys to consultants prior to visitation of the sites
 - Create and distribute a Site-Self Assessment Tool for the Principal and the Plant Supervisors to complete prior to consultant visits to sites
 - The Principal survey focused on how the facilities on their sites are addressing the following District Aims:
 - Maximizing Student Achievement
 - Ensuring a safe and positive learning environmentPrincipals and Directors were also asked to prioritize up to three facility projects on their campus
 - The Maintenance & Operations Survey focused on how the facilities are addressing the

Project Process (cont'd)

following District Aim:

Operating with increasing efficiency and effectiveness

- Conduct facility audit to evaluate condition, and relationship to District Standards for each building
 - Consultants submit visitation schedules for site review
 - Site custodial staff and District maintenance staff available as needed to assist the audit team
- Conduct regular “milestone” meetings with consultants at the conclusion of each group of site visitations
 - Site observation checklist are submitted to Harris Construction for cost estimating, escalated to time of construction
- Consultants complete a summary report of findings, including, but not limited to, the following:
 - Itemized and detailed list of equipment condition, replacement schedule, infrastructure upgrades, modernizations/facility improvements to bring all sites into compliance with current accessibility, building codes, District educational specs, and/or standards sorted by site and by building
 - Make recommendations for future projects: 1-2 years, 3-5 years and 6-10 years
 - Project scope and schedule of work
 - Estimate costs to the date of construction for each project

Phase 3: Final Deliverable for the District Facility Assessment Projects

- Task 1: Prepare milestone meeting report for the District Board Sub Committee
- Task 2: Prepare final deliverable document for Principals, Facility & Plant Op Departments, Governing Board, and Superintendent
- Facility Master Plan sorted by site which includes replacement and repair schedules
 - Projects sorted by Energy, Deferred Maintenance, Health & Safety, and ADA
 - Prioritize projects for the next 1-2 year, 3-5 years and 6-10 years
 - Escalate cost of each project to date of construction
- Task 3: Present findings and “draft” deliverable to the Governing Board
- Schedule a Board Workshop to present findings
- Task 4: Final Deliverable
- Governing Board to receive summary report of findings, including identified projects (including cost estimates) for all sites
 - The District Facility Leadership Team to receive a detailed summary of findings, including identified projects (included cost estimates) for all sites in a written and electronic format
 - The District will have ability to adjust and manipulate the database to respond to changing conditions within the District.
 - Site Principals/directors will receive a summary report of findings and projects for their school/ District site (including cost estimates)
- Task 5: Implementation of the Long Range Facility Audit
- Update Elementary and Secondary Educational Specifications
 - Conceptual Design for projects based on educational specifications
 - Create an implementation schedule for identified projects



Project Recommendations

District Administrators, Principals, and Directors were provided an opportunity to identify projects they believed would enhance the efficiency and effectiveness of the District Mission “to be a quality educational system, providing the opportunity for all students to reach their potential in mind, body and spirit.” A wide variety of projects were suggested by the District. Individual projects were evaluated by our team of consultants, based on the following criteria, to determine their feasibility and practicality for the District:

- Alignment to the approved District building standards and educational specifications
- Alignment to the current educational program need(s) requested with the project
- Feasibility of cost to the District (based on our opinion) and space availability on the site

Cost estimations were only done on projects that our consultants felt aligned to the components of our “decision-making” criteria. Only projects that were determined to be feasible and practical were included in the site narratives.

Cost Estimation

Potential project costs were estimated according to the cost index at the time of construction. An inflation calculator was incorporated into the detailed Excel spreadsheets for each site. Costs were estimated using a baseline average for equipment, materials & labor, and should be considered “estimates”. An additional 25% was added to each project that includes the “fees” for testing, inspection, and architectural/engineering. These costs (are in addition to the project construction costs) will need to be considered when the District chooses to schedule the project.



Final Deliverables

Results were presented to the District in various formats depending on the needs of the end user. Below is a summary of the contents for these reports.

District Staff

Governing Board and District Superintendent

Office of Facility Services

Office of Maintenance and Operations

Site Principals

CUSD Facility Audit Report

District overview, including a Power Point presentation

District summary, summary of all schools and support facilities (including supporting detailed spreadsheets and consultant checklists)

School Site Summary Report





The Implementation of a 10-Year Facility Needs Master Plan

The CUSD Facility Needs Audit will provide the District access to a significant amount of data, information, and recommendations regarding the condition of District facilities constructed prior to 2001 (and the technology infrastructure for all facilities). The primary goal of the CUSD Facility Needs Assessment was to develop a long range plan to bring all District school facilities, and support facilities, up to current approved District building and equipment standards. How the District chooses to use this data, information and recommendations to guide their decision making process, will be critical to the success of this effort.

It is our recommended that the District consider the CUSD Facility Audit within the context of a long range (10-year) Facility Master Plan. A 10-Year Facility Master Plan should be flexible and adaptable to changing conditions within the District and community. We feel that it will be essential to base decisions on a well crafted set of Elementary and Secondary Educational Specifications.

Another critical factor to be considered by the District will be the availability of state and local funding. It is our recommendation that an open dialogue begin immediately with the community to illustrate the need to upgrade current facilities well in advance of a formal campaign for a bond measure.


Important components that we recommend the District to consider, is to fully implement the results of the Long Range Facility Audit, are the following:

1. A thorough review and update of the District's current Elementary and Secondary educational specifications and building standards to insure alignment to curriculum and instructional methodologies to appropriate space relationships requirements.
2. Development of a conceptual design master plan, based on the educational specifications, for each building modernization, addition and expansion. These conceptual diagrams should identify the size, configuration and location of new facilities and reconfiguration of existing facilities.
3. Review current funding sources and begin to develop strategies for a future bond campaign. Evaluate the potential community tolerance for future bond initiatives for CUSD.
4. Strategically create a project implementation schedule for future projects indentified in the 10-Year Facility Needs Assessment Master Plan. This schedule must be based on maximizing current and potential funding sources.



District-Wide Project Data

District Summary





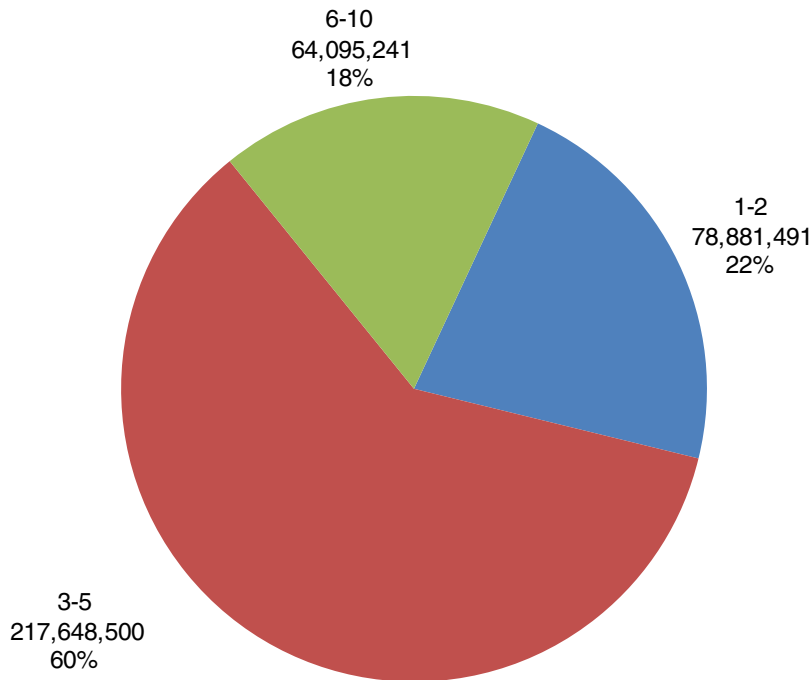


Total District Needs Assessment

Summary by Area	Total
Group 1 - David E. Cook Center	50,304,840
Group 2 - Buchanan Area	77,683,445
Group 3 - Clovis North Area	17,534,207
Group 4 - Clovis Area	91,537,174
Group 5 - Clovis West Area	74,897,993
Group 6 - Clovis East Area	48,667,574
Total	\$ 360,625,232




Breakdown by Project Category

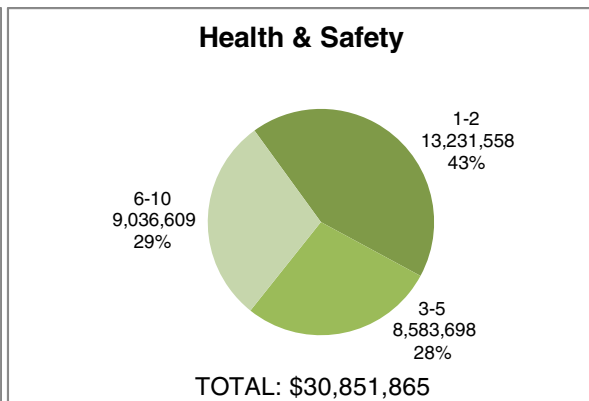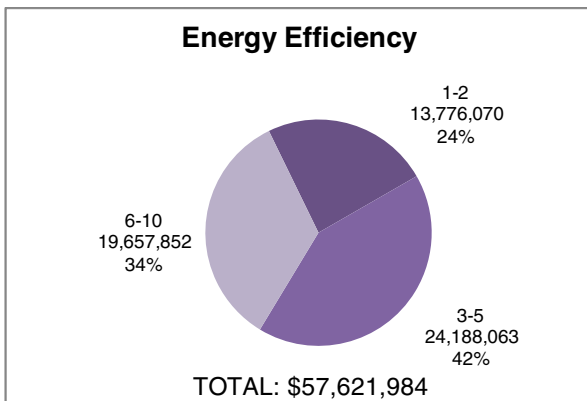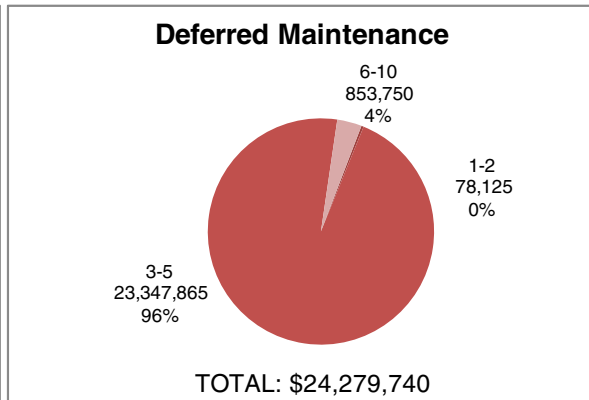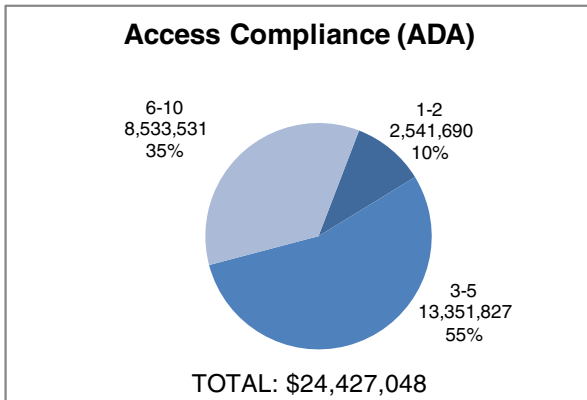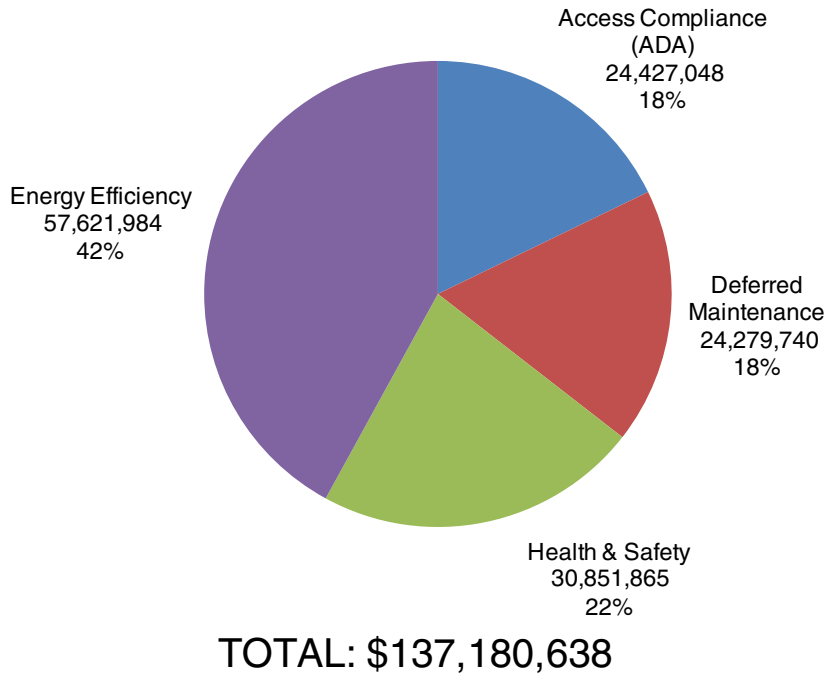



Total by Discipline

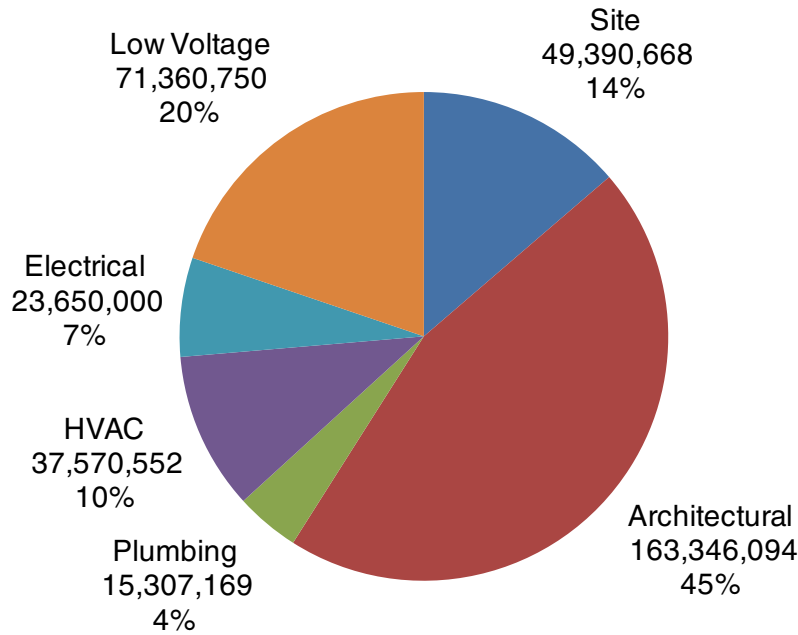







TOTAL: \$360,625,232

Total District-Wide Needs Assessment

Summary by Discipline	1-2	3-5	6-10	TOTAL BY PROJECT CATEGORY
Site	13,085,930	20,967,763	15,336,975	49,390,668
Architectural	58,125	163,287,969	-	163,346,094
Plumbing	747,078	2,580,297	11,979,794	15,307,169
HVAC	9,138,608	14,504,597	13,927,347	37,570,552
Electrical	9,400,000	6,832,500	7,417,500	23,650,000
Low Voltage	46,451,750	9,475,375	15,433,625	71,360,750
Total	\$ 78,881,491	\$ 217,648,500	\$ 64,095,241	\$ 360,625,232




Breakdown by Discipline

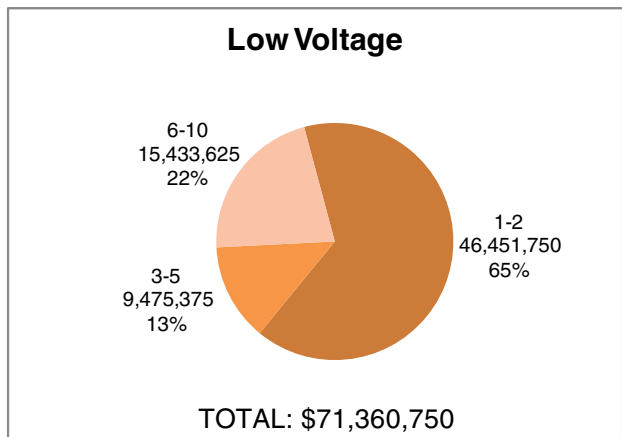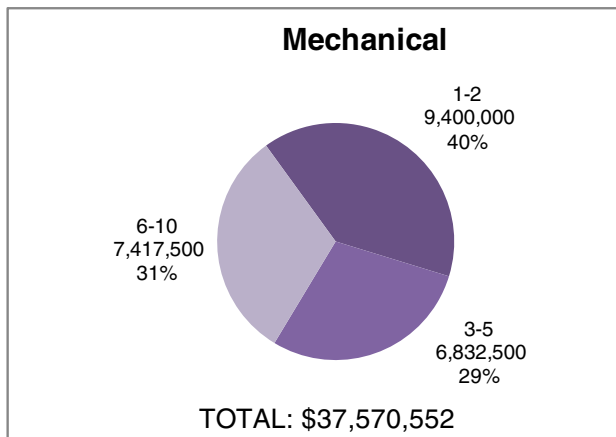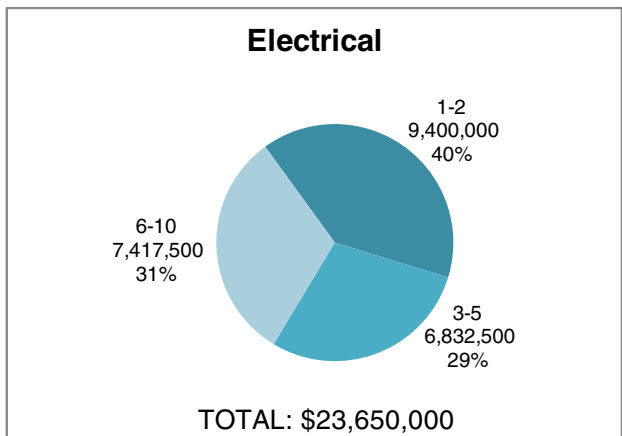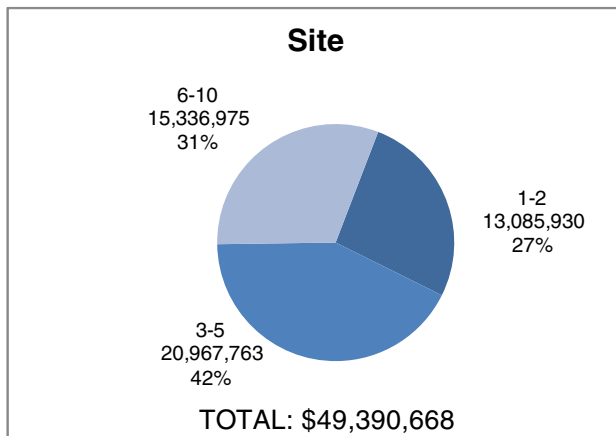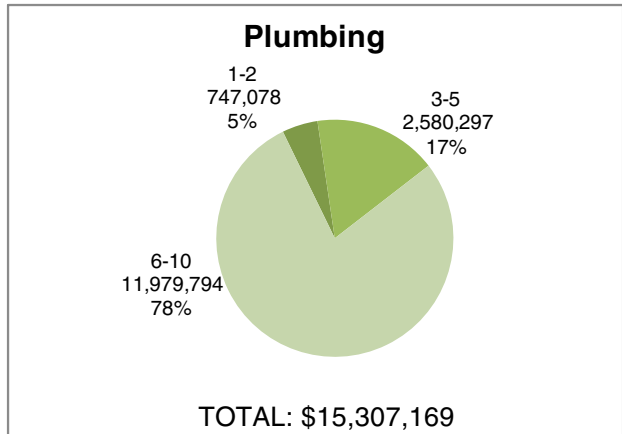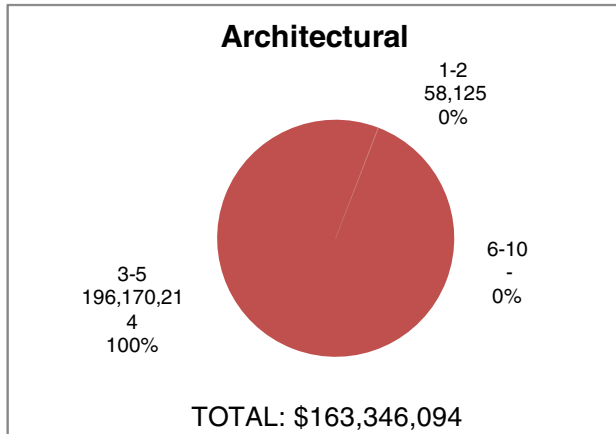




Total by High School Attendance Area

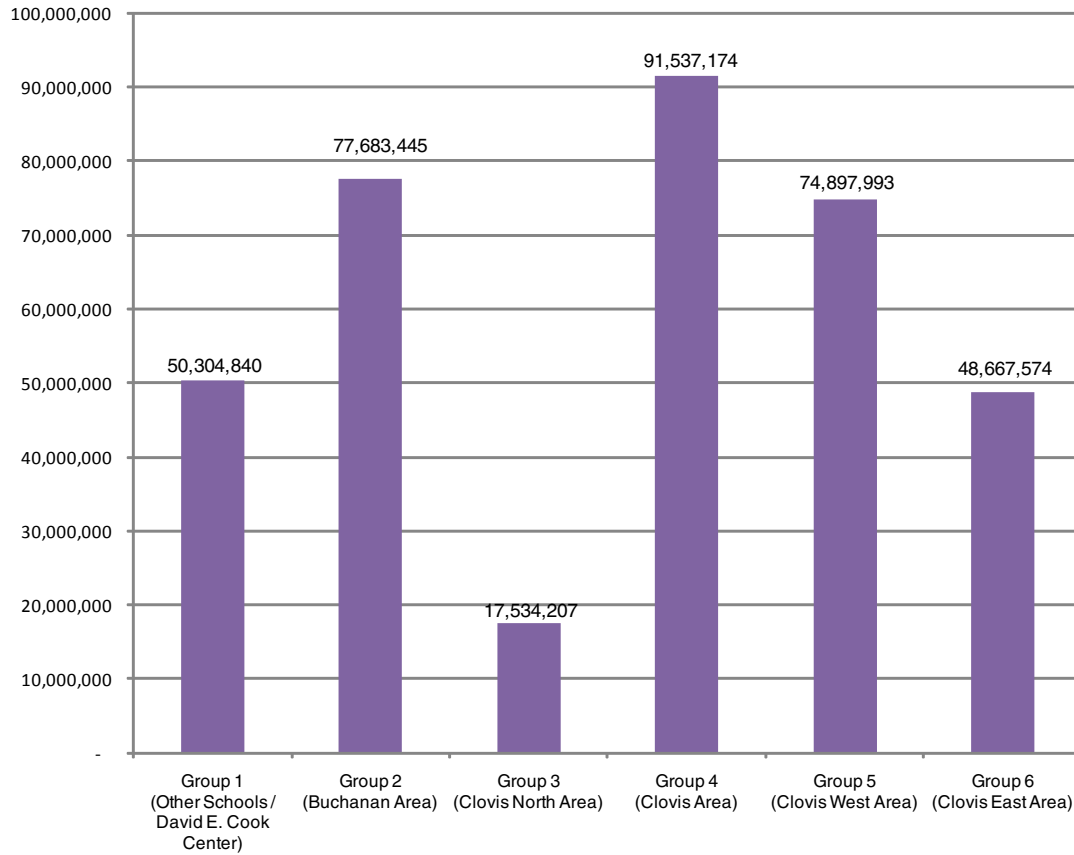

Summary by Year of Construction

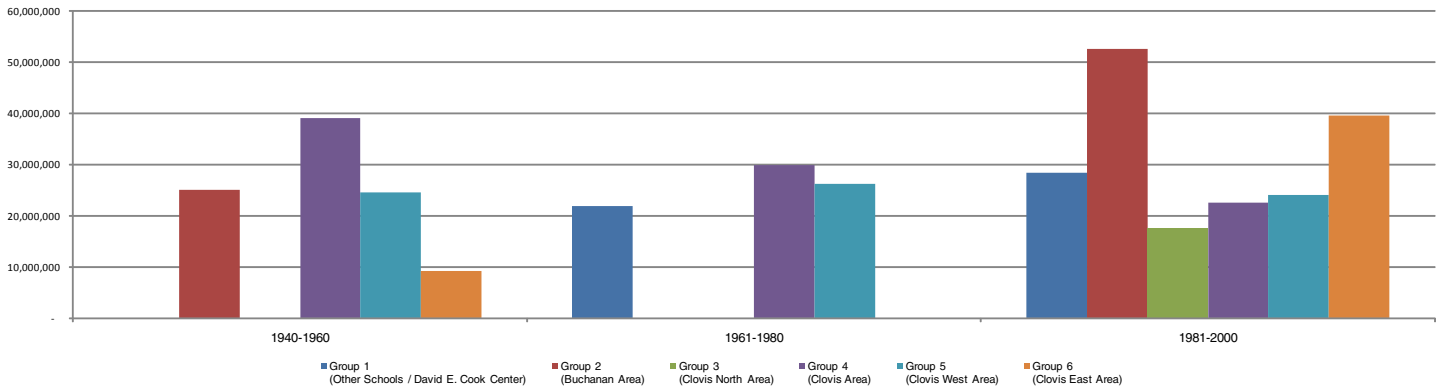



District Wide Summary

School	1-2	3-5	6-10	TOTALS
Alta Sierra Intermediate School	2,496,910	5,216,060	2,096,841	9,809,811
Buchanan High School	2,186,412	21,113,939	6,053,820	29,354,171
Bud Rank Elementary School	110,000	0	263,125	373,125
Cedarwood Elementary School	1,436,885	2,494,889	600,128	4,531,902
Center for Advanced Research and Technology	1,196,649	223,846	3,290,386	4,710,881
Century Elementary School	1,417,335	2,656,039	1,667,101	5,740,475
Clark Intermediate School	2,474,515	11,935,481	3,538,113	17,948,109
Clovis Adult School	932,248	1,147,288	771,922	2,851,457
Clovis East High School	2,314,387	7,211,415	3,167,906	12,693,708
Clovis Elementary School	1,100,364	1,428,374	1,369,444	3,898,181
Clovis High School	2,410,497	15,979,777	6,308,134	24,698,408
Clovis North Educational Complex	16,250	0	0	16,250
Clovis West High School	3,061,024	8,037,810	3,922,954	15,021,788
Cole Elementary School	2,028,375	6,622,411	618,425	9,269,211
Community Day School	993,923	92,800	324,500	1,411,223
Copper Hills Elementary School	1,129,439	3,332,618	866,839	5,328,896
David E. Cook Center	4,113,934	10,129,830	2,608,958	16,852,721
Dry Creek Elementary School	2,934,689	3,401,961	861,266	7,197,916
Fancher Creek Elementary School	2,719,828	3,640,398	505,943	6,866,169
Fort Washington Elementary School	1,384,638	2,223,079	817,482	4,425,198
Freedom Elementary School	928,750	238,125	786,250	1,953,125
Fugman Elementary School	457,500	168,750	1,521,875	2,148,125
Garfield Elementary School	1,732,454	3,540,405	1,246,270	6,519,130
Gateway/Enterprise Alternative Education	568,218	3,035,519	1,460,165	5,063,902
Gettysburg Elementary School	2,631,511	5,551,824	982,827	9,166,161
Jefferson Elementary School	2,230,678	3,693,616	637,967	6,562,261
Kastner Intermediate School	1,828,375	7,082,309	2,336,927	11,247,611
Liberty Elementary School	2,189,887	4,008,284	337,368	6,535,539
Lincoln Elementary School	1,972,780	2,832,691	969,173	5,774,643
Maple Creek Elementary School	1,166,640	3,864,558	1,131,446	6,162,644
Mickey Cox Elementary School	1,444,861	3,077,500	725,055	5,247,416
Miramonte Elementary School	1,473,484	4,932,677	1,105,791	7,511,951
Mountain View Elementary School	2,203,822	4,700,859	624,754	7,529,436
Nelson Elementary School	2,330,241	2,987,061	517,735	5,835,037
Pinedale Elementary School	1,601,134	11,778,223	973,842	14,353,199
Reagan Elementary School	72,500	0	291,875	364,375
Red Bank Elementary School	1,999,173	2,079,408	888,234	4,966,814
Reyburn Intermediate School	1,609,284	5,748,866	2,748,988	10,107,138
Riverview Elementary School	864,000	298,125	976,250	2,138,375



District Wide Summary

School	1-2	3-5	6-10	TOTALS
Sierra Outdoor School	802,875	18,460,531	151,250	19,414,656
Sierra Vista Elementary School	2,254,104	5,064,534	544,542	7,863,179
Tarpey Elementary School	2,216,081	5,631,262	790,013	8,637,355
Temperance-Kutner Elementary School	2,858,873	5,295,594	1,016,641	9,171,108
Valley Oak Elementary School	2,597,333	2,702,636	242,364	5,542,333
Weldon Elementary School	2,337,383	3,930,881	386,479	6,654,743
Woods Elementary School	51,250	56,250	1,047,875	1,155,375
Total:	\$ 78,881,491	\$ 217,648,500	\$ 64,095,241	\$ 360,625,232



Site Requested Project List

(as submitted by site Principals)

Group 1: Other Schools/David E. Cook Center

Clovis Adult School

- None

Center for Advanced Research and Technology

- HVAC system needs to be analyzed and repaired to assure a comfortable temperature for student learning. Some rooms exceed 85 degrees on a regular basis
- Replace locks on classroom doors to give teachers capability to lock from inside in the event of threat
- Repair/replace outside security cameras

Gateway/Enterprise Alternative Education

- None

Sierra Outdoor School

- Upper classroom building modernization
- Lower classroom building modernization
- New Gymnasium
- Irrigation to ball field
- Bus loading and unloading area
- Maintenance and Transportation Building
- Amphitheater stage

Maintenance and Transportation Building

- Additional office space in the maintenance/transportation building
- Install restroom upstairs in work control area
- Push fence in north parking lot towards Herndon: redevelop parking lot
- Additional T-shed in outside storage area

District Office West

- Landscape face-lift

District Office East

- None

Grounds Building

- Additional grounds building north of the existing grounds building: bays for storage
- Move mechanics shop to new building
- Add concrete and landscaping between Professional Development Building and warehouse

Security and Attendance Building

- None

Warehouse and Graphic Arts Building

- None

District Services Building

- None

Construction Services Building

- None



Group 2: Buchanan Area

Century Elementary School

- Rain gutters added to buildings
- Fix drainage problems around school
- Gates on Kindergarten parking lot to prevent people from driving on campus during off hours
- Review of main parking lot and bus loading zone
- Upgrade planter areas

Cole Elementary School

- Technology Infrastructure
- New Multipurpose Room/Cafeteria/Teacher Lounge
- New Administrative office, reception and office staff area

Dry Creek Elementary School

- Construction of a new academic building to house all 4-6 grade classes, music, and special education
- Landscape upgrade

Garfield Elementary School

- A new addition to our library
- Landscaping and concrete areas need to be renovated
- Remodeling of the front office
- Kindergarten storage upgrade

Tarpey Elementary School

- Main office expansion/upgrade
- Landscape upgrade

Woods Elementary School

- None

Alta Sierra Intermediate School

- Library demo kiosk
- Phone systems tech infrastructure
- Landscaping: hills planter flatten mounds

Buchanan High School

- Heating and cooling system needs to be fixed
- Need a new counseling center
- Need a new bathroom facility at the pool

Group 3: Clovis North Area

Bud Rank Elementary School

- None

Copper Hills Elementary School

- Extend student drop off zone

Fugman Elementary School

- None

Mountain View Elementary School

- HVAC upgrade

Riverview Elementary School

- None

Granite Ridge Intermediate School

- None

Clovis North High School

- None



Site Requested Project List (cont'd)

(as submitted by site Principals)

Group 4: Clovis Area

Cedarwood Elementary School

- Add dry wells on #2 and #3 baseball fields (very poor drainage)

Clovis Elementary School

- Have bollards placed throughout the campus so people would not drive on the campus
- Have more signage and red painted curbs for entire frontage road that goes through the campus
- Area, lighting, and sound
- Multipurpose Room window coverings

Mickey Cox Elementary School

- Lighting: improved in kindergarten classrooms, cafeteria and amphitheatre areas
- Air condition corrections: students get irritable and act out when the temperature gets too high in the classrooms and library

Gettysburg Elementary School

- We would love to have a new snack bar, like newer schools have, out by our ball fields. This would also allow us some much needed storage space

Jefferson Elementary School

- Public address/bell system
- Air conditioning both chiller and boiler need to be replaced
- Cameras need to be repaired to work correctly

Red Bank Elementary School

- HVAC
- Teacher workroom expansion
- Access to greater technology in the classroom (projector, wireless, etc.)

Sierra Vista Elementary School

- Library expansion
- Moderization of Multipurpose Room
- AC/Heating system replaced
- Cement upgrade and repair

Weldon Elementary School

- Concrete project in front of A wing and blacktop
- Classroom technology renovation (electrical access, ceiling mounts for LCD, pull down screens)
- Multipurpose Room/Kitchen renovation

Clark Intermediate School

- New gym floor (scheduled: added athletic facilities, field space: Rodeo Grounds)
- Technology that would allow classrooms to have video capabilities
- Amphitheater landscape upgrade
- Room for stagecraft and storage for the MET
- Landscaping, irrigation, and playfield improvements

Clovis High School

- The lockers in the girls locker room need to be replaced from 1969 to provide larger lockers for students to store their backpacks in during PE class to prevent thefts including enough lockers for each student
- Modernization of facilities to have all classrooms have LCD mounts and wiring in the ceiling, computers labs, field houses, band and folklorico practice rooms, etc.



Group 5: Clovis West Area

Fort Washington Elementary School

- None

Liberty Elementary School

- Renovate the main office/library
- Get a new AC/Heating system
- Additional areas for teacher collaboration and storage

Lincoln Elementary School

- New restrooms adjacent to the playground.
Currently the only restrooms close by are in the snack bar area and face away from supervision
- Walkway-cement work: cement curbs for flower beds, cement work for raised planter boxes
- Regrading grass: drainage issues

Maple Creek Elementary School

- Air conditioning and heating unit replaced
- Fire alarm system-heat sensors
- Traffic calming devices and speed bumps in parking lot

Nelson Elementary School

- Multipurpose Room modernizing
- HVAC upgrades
- Updating of paint/landscaping
- Technology infrastructure

Pinedale Elementary School

- Multipurpose Room modernizing
- Library Media Center
- Classroom space and design to meet the vision of our schools
- Improvement in technology in the buildings so that it supports our vision, and improvement in the cooling and heating systems
- Remodel Classroom

Valley Oak Elementary School

- Window replacement

Kastner Intermediate School

- Need upgrade technology labs
- Locker room lockers sorely need to be replaced
- Chiller and air handler in Multipurpose Room/ Bandroom always down
- Replace gym bleachers as wood bleachers are a safety hazard
- Need to retrofit the woodshop with safer equipment
- Replace gymnasium bleachers

Clovis West High School

- Camera Installation
- More fob systems for doors so access into A building by staff does not require the need to leave the doors unlocked
- Completion of appropriate counseling center



Site Requested Project List (cont'd)

(as submitted by site Principals)

Group 6: Clovis East Area

Fancher Creek Elementary School

- A new addition to our library
- Landscaping and concrete areas need to be renovated
- Remodeling of the front office

Freedom Elementary School

- None

Miramonte Elementary School

- Landscape upgrade
- Modernize main office

Reagan Elementary School

- None

Temperance-Kutner Elementary School

- Build a main office
- A new AC/Heating system
- security alarm system for entire school
- Technology infrastructure

Reyburn Intermediate School

- HVAC upgrades
- Bell/alarm sensors
- Water main cracks

Clovis East High School

- Athletic office modernization
- New restrooms for baseball stadium



Site Areas

Group 1: Other Schools/David E. Cook Center

- Clovis Adult School
- Center for Advanced Research and Technology
- Gateway/Enterprise Alternative Education
- Community Day School
- Sierra Outdoor School
- Maintenance and Transportation Building
- District Office West
- District Office East
- Grounds Building
- Security and Attendance Building
- Warehouse and Graphic Arts Building
- District Services Building
- Construction Services Building
- Professional Development Building

Group 2: Buchanan Area

- Century Elementary School
- Cole Elementary School
- Dry Creek Elementary School
- Garfield Elementary School
- Tarpey Elementary School
- Woods Elementary School
- Alta Sierra Intermediate School
- Buchanan High School

Group 3: Clovis North Area

- Bud Rank Elementary School
- Copper Hills Elementary School
- Fugman Elementary School
- Mountain View Elementary School
- Riverview Elementary School
- Clovis North Educational Center

Group 4: Clovis Area

- Cedarwood Elementary School
- Clovis Elementary School
- Mickey Cox Elementary School
- Gettysburg Elementary School
- Jefferson Elementary School
- Red Bank Elementary School
- Sierra Vista Elementary School
- Weldon Elementary School
- Clark Intermediate School
- Clovis High School

Group 5: Clovis West Area

- Fort Washington Elementary School
- Liberty Elementary School
- Lincoln Elementary School
- Maple Creek Elementary School
- Nelson Elementary School
- Pinedale Elementary School
- Valley Oak Elementary School
- Kastner Intermediate School
- Clovis West High School

Group 6: Clovis East Area

- Fancher Creek Elementary School
- Freedom Elementary School
- Miramonte Elementary School
- Reagan Elementary School
- Temperance-Kutner Elementary School
- Reyburn Intermediate School
- Clovis East High School



Clovis West High School

1070 E. Teague, Fresno, CA 93720 • t. 559-327-2000, f. 559-327-2490



General Information

Grade Level Configuration:	9-12
Enrollment Capacity:	2,451
Site Acreage:	60
Total Plan Square Footage:	242,386

Overview: Clovis West High School was opened in 1976. Clovis West High School currently has 79 permanent classrooms and 16 portable classrooms to accommodate a student body of 2451. Along with an administration building, library media center, multipurpose room, two gymnasiums, snack bar and restroom the facilities adequately support the instructional programs. Clovis West High School has numerous athletic playfields and play courts to accommodate school and community programs. In addition, are District operates and manages the Olympic Swim Complex on the Clovis West Campus. Various community groups utilize the school and district facilities and play courts outside the normal school day. At this time, the school is operating near capacity.

Year Built/Renovated/Modernized

Based on available drawings and discussions with District maintenance personnel, we obtained the following information regarding year constructed and Division of the State Architect (DSA) approval for campus construction projects.

Opened: 1976
Architect: Darden

Building/Rooms:	DSA Application Number:	Approval Date:	MODERNIZATION ELIGIBILITY	
			25 Years + 12 Months:	50 Years + 12 Months:
Cafeteria Receiving J, M, N Buildings	38587	10/1/1975	Done	10/1/2026
A, B, C, D, E, K, L Bldg West Gym/Snack Bar	37205	8/20/1974	Done	8/20/2025
S Building East Gym	58832	3/12/1993	3/12/2019	3/12/2044


Site Plan Legend

-  Classroom Building
-  Kindergarten
-  Multipurpose Room
-  Snack Bar
-  Administration
-  Library/Media Center
-  Locker Room
-  Wrestling/Weights
-  Restroom
-  Gymnasium
-  Shop Building
-  Maintenance
-  Cluster Office
-  Storage Building
-  Concert Hall
-  Field House
-  Pool Office
-  Portables
-  Large Gym
-  Small Gym





Site Plan

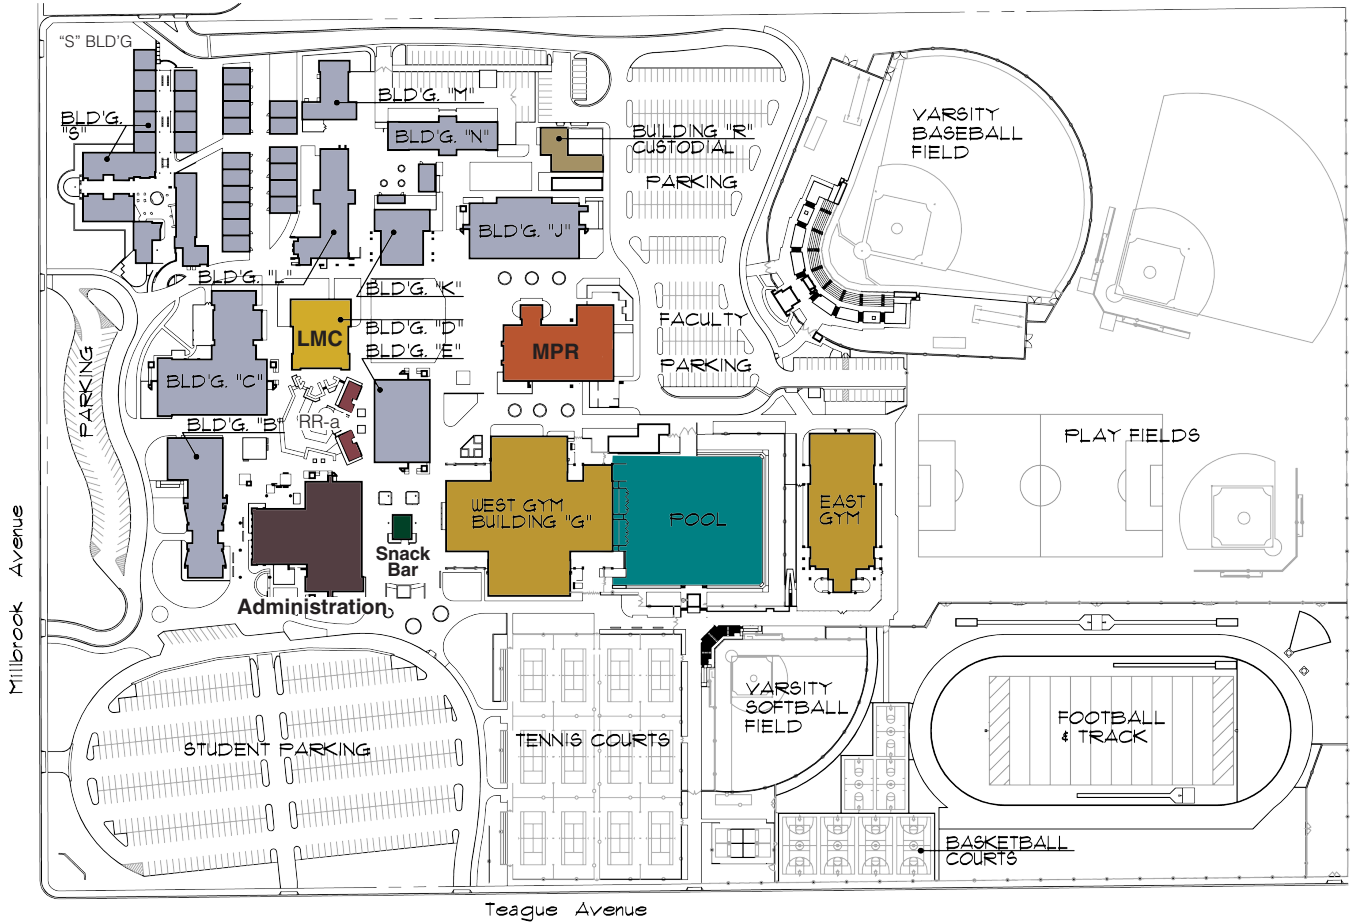

Civil Engineering

ADA Compliance

Observations: The concrete condition is fair. There are many locations of cracking and trip hazards. The sidewalk cross-slopes and curb ramps do not meet ADA requirements. The accessible stall signage and striping require moderate changes. ADA detectable warning surface is required in various locations. Storm drain inlet grates do not meet ADA requirements for maximum grate openings. Walk gates do not meet ADA requirements. Some of the drinking fountains do not meet ADA requirements.

Recommendations: Reconstruct concrete improvements to eliminate trip hazards and meet ADA slope requirements.

- Add accessible stall signage and striping as required.
- Add ADA detectable warning surface at various locations.
- Replace storm drain inlet grates in accessible paths of travel with ADA compliant grates.
- Replace walk gates with ADA compliant gate hardware.
- Replace drinking fountains with ADA compliant drinking fountains.

Site Drainage

Observations: The storm drain system is in fair working condition. There is evidence of standing water in various campus areas and many locations in the playfields. There is an insufficient amount of storm drain inlets in the playfields around the junior varsity baseball and freshman softball fields.

Recommendations: Reconstruct concrete improvements where slope can be improved. • Add additional storm drain inlets and dry wells to prevent standing water. • Repair and regrade rutted turf to storm drain inlets.

Transportation Facilities

Observations: There are 770 standard parking stalls on the campus – meeting the District Standard of 650. There are also 21 accessible parking stalls – meeting ADA requirements. Bus loading zone length complies with District Standards. Parent drop-off zone length complies with District Standards. There are bicycle racks for 54 bicycles.

Recommendations: Evaluate the need for additional bicycle racks.

Athletic Facilities

Observations:

The varsity football practice field is inside of the track and the athletic field north of the track. No competition games are held on site.

The varsity baseball stadium is in good working condition, but the exterior stadium stairs do not meet ADA requirements. The concrete dugouts and team bench lengths are shorter than District Standards, there are no drinking fountains in the dugouts, and the drinking fountains outside of the dugouts are not ADA compliant. There is no vertical lift for the press box and no ADA access from the stadium to the baseball field.

The junior varsity baseball backstop does not have ADA compliant field access, backstop backboards are mostly wood, dugout playfield access openings are not ADA compliant, and the drinking fountain is not ADA compliant. There are 1 5-row and 1 10-row bleachers, no foul ball poles, no PA system, and no electrical outlets.

The freshmen baseball backstop does not have ADA compliant field access, backboards are mostly wood, dugout playfield access openings are not ADA compliant, additional concrete is needed around the dugouts, and new backstop horizontal rails are required to meet District Standards. There are 2 10-row bleachers and one of the bleachers has damaged seat planks. The drinking fountain is not ADA compliant and there are no electrical outlets.

The varsity softball stadium is in good work condition, but the site has no drinking fountains or ticket booth. The backstop backboards are partially wood.

The junior varsity softball backstop is located across the street in the City of Fresno Keith Tice Park. The backstop backboards are mostly wood, drinking fountains are not ADA compliant, dugout playfield access openings are not ADA compliant, and there are no electrical outlets.

The freshmen softball backstop backboards are mostly wood, dugout playfield access openings are not ADA



Civil Engineering (cont'd)

compliant, and there is no drinking fountain. There are 2 5-row bleachers and no electrical outlets.

Soccer fields meet District Standards, but the field turf needs minor weed control.

Track and field facilities are generally in good condition, but 1 additional long jump practice pit is required to meet District Standards. There are no timers, starting blocks, or concession stand.

Tennis courts meet District Standards.

The playcourts do not meet District Standards, but there are 3 turf volleyball courts.

Recommendations: At the varsity baseball stadium, add a colored, slip-resistant strip to the nose of each stair tread on all of the exterior stairs. • Expand varsity baseball dugouts and team bench areas, add a vertical lift to the press box, and provide ADA compliant access from stadium to baseball field. • On junior varsity baseball, freshmen baseball, junior varsity softball, and freshmen softball fields, reconstruct dugout playfield access openings to be ADA compliant. • Replace all wood and worn HDPE backboards with new HDPE backboards. • Add additional concrete around dugouts and add horizontal rails to meet District Standards. • Replace 1 5-row bleacher at junior varsity baseball with 1 10-row bleacher, replace 1 10-row bleacher at freshman baseball, and replace 2 5-row bleachers at freshman softball with 2 10-row bleachers. • Add 1 long jump practice pit. • Add timers, starting blocks, and a concession stand to meet District Standards. • Modify tennis court access walk gates to be ADA compliant. • Add 7 additional basketball courts and 11 additional volleyball courts to meet District Standards.

Landscape

Observations: All of the campus facilities meet the District Standard of 95% for landscaping coverage. All of the campus facilities do not meet the District Standard for a weed condition of less than 25%, except for the Varsity Baseball and Varsity Softball Fields. There are a few locations of bare planters and turf areas.

Recommendations: Add shrubs, ground cover, and trees to bare planters. • Replace turf in bare areas. • Eradicate weeds as required.

Irrigation System

Observations: The irrigation system is 6 years old and is in good working condition. The irrigation system is controlled by a central ready E.T. irrigation controllers and act as standalone units now. The irrigation supply is domestic water supply boosted by a duplex pump with single VFD pump control. Manual irrigation switches to operate the baseball and softball dirt infield sprinklers are missing. Minor irrigation repairs are required in various planter and turf areas to keep the irrigation system operating efficiently.

Recommendations: Upgrade the existing irrigation control system to a central computer controlled system. • Replace the existing VFD pumping system with a new dual VFD pump control. • Install manual irrigation switchers to operate the dirt infield's sprinklers. • Repair and modify irrigation system as required.

Architectural

Administration Building

Observations: The Nurse's office, work room and storage spaces are either lacking or undersized relative to the District standards.

Recommendations: Provide an addition to this building near the existing Nurse's area to accommodate additional space to meet the District standards.

Observations: This building is lacking storage and rooms suitable for meetings and conferences. Provide an addition to

Architectural (cont'd)

meet the needs of added meeting rooms and storage spaces.

Library Media Center

Observations: The building does not function for its intended use and is undersized in meeting District standards. This space is lacking a library classroom as well as sufficient storage.

Recommendations: Provide an addition to accommodate an enclosed library classroom space and storage spaces. Refer to cost sheet for minor recommendations.

Multi-Purpose Building

Observations: The building functions for its intended use and adequately provides for a quality space.

Recommendations: Refer to cost sheet for minor recommendations.

Classroom Buildings B, C, E, K, L, M, N & S

Observations: The buildings function for their intended use and adequately provide for a quality space.

Recommendations: Refer to cost sheet for minor recommendations.

Gymnasium Buildings, West & East

Observations: The buildings function for their intended use and adequately provide for a quality space.

Recommendations: Refer to cost sheet for minor recommendations.

Locker Buildings

Observations: The buildings function for their intended use and adequately provide for a quality space.

Recommendations: Refer to cost sheet for minor recommendations.

Snack Bar Building

Observations: The building functions for its intended use and adequately provides for a quality space.

Recommendations: Refer to cost sheet for minor recommendations.

Toilet Building RR-a

Observations: The building functions for its intended use and adequately provides for a quality space.

Recommendations: Refer to cost sheet for minor recommendations.

Portable Classrooms

Observations: The buildings function for its intended use and adequately provide for a quality space.

Recommendations: Refer to cost sheet for minor recommendations.

Pool Complex and Maintenance Buildings

Observations: The buildings function for their intended use and adequately provide for a quality space.

Recommendations: Refer to cost sheet for minor recommendations.



Architectural (cont'd)

Athletic Fields & Stadium

Observations: Athletic fields do not have a facility for field support spaces and equipment storage.

Recommendations: Provide a Field House to meet the needs of the Athletic fields.

Observations: The Press Boxes at Stan Bledsoe Stadiums does not meet current code relative to wheel chair accessibility.

Recommendations: Add an elevator to the press box at this baseball stadium.

Plumbing Engineering

Administration Building

Observations: Most plumbing fixtures meet the district standard. Most fixtures are ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested.

Library Media Center

Observations: Most plumbing fixtures meet the district standard. Most fixtures are ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested.

Multi-Purpose Building

Observations: Most plumbing fixtures meet the district standard. Most fixtures are ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested. • Replace fixtures with low flow fixtures to lower water use.

Classroom Building B

Observations: Most plumbing fixtures meet the district standard. Most fixtures are ADA compliant. All fixtures are in good condition.

Recommendations: No modernization is required before 6-10 years. • ADA retrofit is suggested.

Classroom Building C

Observations: Most plumbing fixtures meet the district standard. Most fixtures are ADA compliant. All fixtures are in fair condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested.

Classroom Building E

Observations: Most plumbing fixtures meet the district standard. There is no standard on lab fixtures. Most fixtures are not ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested.

Plumbing Engineering (cont'd)

Classroom Building J

Observations: Most plumbing fixtures meet the district standard. Most fixtures are ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 3-5 years. • ADA retrofit is suggested.

Classroom Building K

Observations: Most plumbing fixtures meet the district standard. Most fixtures are not ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested.

Classroom Building L

Observations: Most plumbing fixtures do not meet the district standard. Most fixtures are ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 3-5 years. • ADA retrofit is suggested.

Classroom Building M

Observations: All plumbing fixtures meet the district standard. All fixtures are not ADA compliant. All fixtures are in good condition.

Recommendations: No modernization is required until after 10 years. • ADA retrofit is required.

Classroom Building N

Observations: Most plumbing fixtures meet the district standard. Most fixtures are not ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested.

Classroom Building S

Observations: Most plumbing fixtures meet the district standard. Most fixtures are not ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested. • Replacing some fixtures with low flow fixtures may reduce water use.

East Gymnasium Building

Observations: Most plumbing fixtures meet the district standard. Most fixtures are ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested.

West Gymnasium Building

Observations: Most plumbing fixtures meet the district standard. Most fixtures are ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested. • Replacing some fixtures with low flow fixtures may reduce water use.



Plumbing Engineering (cont'd)

RR-a Building

Observations: Some plumbing fixtures meet the district standard. Most fixtures are ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 3-5 years. • ADA retrofit is suggested. • Replacing some fixtures with low flow fixtures may reduce water use.

Snack Bar Building

Observations: Some plumbing fixtures meet the district standard. Most fixtures are not ADA compliant. Most fixtures are in fair condition.

Recommendations: No modernization is required before 3-5 years. • ADA retrofit is suggested.

Custodial Building

Observations: Some plumbing fixtures meet the district standard. Most fixtures are ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 3-5 years. • ADA retrofit is suggested.

Site

Observations: Some drinking fountains meet the district standard. Most fixtures are not ADA compliant. Most fixtures are in good condition.

Recommendations: No modernization is required before 1-2 years. • ADA retrofit is suggested.

Portable Buildings

Observations: There are no plumbing fixtures.

HVAC

Administration Building

Observations: Most package units do not meet the district standard. Most exhaust fans operate. The EMS is full DDC.

Recommendations: This building is energy efficient. • No modernization is required before 1-2 years. • Replace units with high efficiency units at modernization. • Provide CO2 sensors and fan VFDs for improved energy efficiency.

Library Media Center

Observations: Most package units do not meet the district standard. Most exhaust fans operate. The EMS is full DDC.

Recommendations: This building is energy efficient. • No modernization is required before 1-2 years. • Replace units with high efficiency units at modernization. • Provide CO2 sensors and fan VFDs for improved energy efficiency.

Multi-Purpose Building

Observations: Most package units meet the district standard. Most exhaust fans operate. The EMS is full DDC.

Recommendations: This building is energy efficient. • No modernization is required until after 10 years. • The building

HVAC (cont'd)

energy efficiency would benefit from adding VFDs and CO2 sensors to the units.

Classroom Building B

Observations: Most package units meet the district standard. The makeup air unit does not meet the district standard. All exhaust fans operate. The EMS is full DDC.

Recommendations: This building is energy efficient. • No modernization is required before 1-2 years. • The building energy efficiency would benefit from adding VFDs and CO2 sensors to the units.

Classroom Building C

Observations: Most package units do not meet the district standard. Some exhaust fans operate. The EMS is full DDC.

Recommendations: This building is energy efficient. • No modernization is required before 1-2 years. • The building energy efficiency would benefit from adding VFDs and CO2 sensors to the units.

Classroom Building E

Observations: Most package units meet the district standard. Some exhaust fans operate. The EMS is full DDC.

Recommendations: This building is energy efficient. • No modernization is required before 1-2 years. • The building energy efficiency would benefit from adding VFDs and CO2 sensors to the units.

Classroom Building J

Observations: Most package units meet the district standard. All exhaust fans operate. The EMS full DDC.

Recommendations: This building is energy efficient. • No modernization is required before 1-2 years. • The building energy efficiency would benefit from adding VFDs and CO2 sensors to the air handlers.

Classroom Building K

Observations: All package units meet the district standard. The EMS is full DDC.

Recommendations: This building is very energy efficient. • No modernization is required before 6-10 years. • The building energy efficiency would benefit from adding VFDs and CO2 sensors to the units.

Classroom Building L

Observations: All package units meet the district standard. All exhaust fans do not operate. The EMS is full DDC.

Recommendations: This building is energy efficient. • No modernization is required before 1-2 years

Classroom Building M

Observations: All package units meet the district standard. All exhaust fans do not operate. The EMS is full DDC.

Recommendations: This building is very energy efficient. • No modernization is required before 3-5 years

Classroom Building N

Observations: All units do not meet the district standard. All exhaust fans do not operate. The EMS is full DDC.

Recommendations: This building is energy efficient. • No modernization is required before 1-2 years.



HVAC (cont'd)

Classroom Building S

Observations: The boiler and chiller do meet the district standard. The package units meet the district standard. The rooms use air handlers and unit ventilators served from the central plant. All exhaust fans operate. The snack bar does not have air conditioning and does not meet the district standard. The EMS is not full DDC.

Recommendations: This building is energy efficient. • No modernization is required before 3-5 years. • Replace or refurbish air handlers and unit ventilators at modernization. • The building energy efficiency would benefit from adding full DDC controls.

East Gymnasium Building

Observations: All units do not meet the district standard. All exhaust fans operate. The EMS is full DDC.

Recommendations: No modernization is required before 3-5 years. • Replace units at modernization.

West Gymnasium Building

Observations: Most units meet the district standard. Most exhaust fans operate. The EMS is full DDC.

Recommendations: No modernization is required before 1-2 years. • Replace units at modernization.

RR-a Building

Observations: Some exhaust fans operate. The EMS is full DDC.

Recommendations: No modernization is required before 1-2 years. • Replace exhaust fans at modernization.

Snack Bar Building

Observations: The building is not air conditioned and does not meet district standards. All exhaust fans operate. The EMS is not full DDC.

Recommendations: Provide air conditioning. • No modernization is required until after 10 years.

Custodial Building

Observations: All units do not meet district standards. All exhaust fans operate. The EMS is full DDC.

Recommendations: The building is not energy efficient. • No modernization is required before 1-2 years. • Replace units at modernization.

Pool Building

Observations: There is no HVAC equipment.

Portable Buildings

Observations: All units do not meet district standards. All exhaust fans operate. The EMS is not full DDC.

Recommendations: The buildings are not energy efficient. • No modernization is required before 6-10 years. • Replace units at modernization and add DDC controls. • Energy efficiency may benefit from retrofitting to high efficiency heat pumps and adding full DDC control.

Electrical Engineering

Site Electrical Distribution System

Observation: The Clovis West site electrical distribution system is in fair condition. The main switchboard is not compliant with current electrical codes.

Recommendation: Replace existing main switchboard and feeder cables.

Site Electrical Lighting System

Observation: Parking lot and pathway lighting provides adequate coverage and is compliant with current electrical codes.

Recommendation: Clovis West is in need of surveillance lighting controls to provide adequate lighting coverage for the surveillance camera system.

Electrical Distribution System

Observation: The electrical distribution system for each building at Clovis West is in fair condition and is compliant with current electrical codes.

Recommendation: Replace receptacles, circuits, and panels.

Electrical Lighting System

Observation: The electrical lighting system is in fair condition with good coverage and is compliant with current electrical codes.

Recommendation: Replace light fixtures in approximately 25% of buildings.

Site Theatrical Lighting System

Observation: The Clovis West theatrical lighting system is in poor condition and is not compliant with District standards. Light fixtures are not energy efficient.

Recommendation: Replace light fixtures, wiring, controls, and electronics.

Site Sound Reinforcement System

Observation: The sound reinforcement system is in poor condition and is not compliant with District and industry standards.

Recommendation: Replace loudspeakers, wiring, controls, and electronics.

Low Voltage

Site Fire Alarm System

Observation: The Fire Alarm system is in poor condition and is not compliant with current electrical codes.

Recommendation: Replace Fire Alarm system, devices, and wiring.

Site Telephone System

Observation: The telephone system at Clovis West is in fair condition but does not meet District standards. Telephone cabling does not comply with current industry standards and electrical codes.



Low Voltage (cont'd)

Recommendation: Replace telephone system, cabling, and handsets.

Site CATV System

Observation: The CATV system is in poor condition and does not meet current District standards.

Recommendation: Replace CATV system cabling and electronics.

Site Clock System

Observation: The current clock system at Clovis West does not meet District standards.

Recommendation: Replace clock system and devices.

Site Public Address System

Observation: The Clovis West public address system is in poor condition. Public Address cabling is in poor condition and is not compliant with current electrical codes.

Recommendation: Replace public address system, cabling, and devices.

Site Camera Surveillance System

Observation: The camera surveillance system is in fair condition and has adequate coverage. The surveillance electronics and cabling do not meet District standards.

Recommendation: Replace system electronics and cabling.

Site Audio Visual System

There are approximately (110) locations at Clovis West that do not have an audio visual system or the current system does not meet District standards.

Recommendation: Install projector, projection screen, loudspeaker, and audio visual controls for each location.

Data System

Observation: The Clovis West data system is not compliant with current District and industry standards. Data system spaces do not provide adequate room or cooling. Network cabling does not have the capabilities to run high speed networks as required by District standards. Telecom spaces do not have a District standard UPS for power backup.

Recommendation: (1) Data system space requires architectural improvements to meet District and industry standards.
• Approximately (9) new data system spaces are required. • All network cabling should be replaced. • (6) data system enclosures are also required to extend the network to smaller buildings. • Each data space requires a new UPS and cooling system. • This site requires (2) environmentally controlled pedestals to contain data system electronics and terminations for portable buildings.

Project Request

Site Faculty: "Technology in the buildings so that it supports our vision."

Response: Accommodated in next modernization.



Summary by Discipline and Priority

Clovis West High School		1-2	3-5	6-10	TOTALS
Site		822,407	330	1,470,697	2,293,434
Architectural		0	5,545,580	0	5,545,580
Plumbing		45,913	253,463	577,500	876,875
HVAC		140,000	273,876	787,166	1,201,043
Electrical		218,000	280,000	0	498,000
Low Voltage		1,222,500	77,000	303,000	1,602,500
	Subtotals:	\$ 2,448,819	\$ 6,430,248	\$ 3,138,363	\$ 12,017,431
Contingency	5%	122,441	321,512	156,918	600,872
Haz Mat Abatement	5%	122,441	321,512	156,918	600,872
A/E Fees	10%	244,882	643,025	313,836	1,201,743
Testing and Inspections	5%	122,441	321,512	156,918	600,872
	Total:	\$ 3,061,024	\$ 8,037,810	\$ 3,922,954	\$ 15,021,788

An additional 25% was added to each project that includes the “fees” for testing, inspection, and architectural/engineering. These costs (are in addition to the project construction costs) will need to be considered when the District chooses to schedule the project.



Projects by Discipline and Sub-Categories

Clovis West High School	TOTALS
Site	
Landscaping, Irrigation, and Play Field Improvements	1,401,911
Transportation and Parking Lot Improvements	571,342
Site Plumbing Renovations	201,250
Site Concrete, Ramps, Stairs, and ADA Improvements	579,201
Fencing and Gates Upgrades	4,913
Site Drainage Improvements	108,175
Architectural	
Replace and/or repair roofing, roof fences and fascia	593,750
ADA Required upgrades	1,116,094
Expand and/or reconfigure Administration building	1,225,000
Expand and/or reconfigure Classroom building	612,500
Expand and/or reconfigure Library Media Center building	612,500
Paint interior and/or exterior walls	104,625
Repair and/or replace interior ceilings	425,469
Renovate toilet rooms	213,500
Repair and/or replace floors and floor coverings	1,674,756
Repair and/or replace interior wall finishes	199,125
Repair and/or replace window, door and hardware systems	92,359
Repair and/or Replace casework	62,297
Plumbing	
Toilet Room Plumbing Replacement.	520,125
Classroom Plumbing Replacement	575,969
HVAC	
HVAC/Chiller Upgrade and/or Replacement	1,501,303
Electrical	
Building Power Distribution Energy Improvements	145,000
Exterior Lighting Efficiency Improvements	82,500
Exterior Power Distribution Energy Improvements	157,500
Building Lighting Efficiency Improvements	237,500
Low Voltage	
Fire Alarm/Life Safety	156,250
Exterior Lighting Efficiency Improvements	16,250
Technology System Improvements	1,830,625
Total	\$ 15,021,788



Summary by Location, Priority and Special Categories

Clovis West High School	1-2	3-5	6-10	H&S	DFM	ADA	EE
Site							
Technology System Improvements	380,625	56,250	0	•			
Fire Alarm/Life Safety	156,250	0	0	•			
Exterior Lighting Efficiency Improvements	16,250	0	0	•			•
Fencing and Gates Upgrades	4,500	413	0				
Landscaping, Irrigation, and Play Field Improvements	6,250	0	1,395,661	•	•	•	•
Site Drainage Improvements	108,175	0	0				
Classroom Plumbing Replacement	13,031	8,688	82,531			•	
Site Plumbing Renovations	201,250	0	0				
Transportation and Parking Lot Improvements	152,842	0	418,500			•	
Exterior Power Distribution Energy Improvements	157,500	0	0				
Exterior Lighting Efficiency Improvements	0	82,500	0	•			•
Building Lighting Efficiency Improvements	42,500	0	0	•			•
Site Concrete, Ramps, Stairs, and ADA Improvements	554,991	0	24,210	•		•	
Subtotals	\$ 1,794,164	\$ 147,850	\$ 1,920,903				
Administration							
Building Power Distribution Energy Improvements	0	16,250	0				•
Expand and/or reconfigure Administration building	0	1,225,000	0				
HVAC/Chiller Upgrade and/or Replacement	2,600	6,491	71,984	•			•
Technology System Improvements	123,125	12,500	141,250	•			
Toilet Room Plumbing Replacement.	0	5,188	1,828			•	•
Repair and/or replace floors and floor coverings	0	36,969	0		•		
Repair and/or replace interior ceilings	0	212,500	0				
Repair and/or replace interior wall finishes	0	4,625	0				
Repair and/or replace window, door and hardware systems	0	6,156	0			•	•
Paint interior and/or exterior walls	0	8,438	0		•		
Building Lighting Efficiency Improvements	22,500	0	0	•			•
Classroom Plumbing Replacement	3,984	8,656	10,750			•	
HVAC/Chiller Upgrade and/or Replacement	0	0	63,208	•			•
ADA Required upgrades	0	167,663	0			•	
Subtotals	\$ 152,209	\$ 1,710,434	\$ 289,020				

H&S Health and Safety
ADA Americans with Disability Act Compliance

DFM Deferred Maintenance
EE Energy Efficiency





Summary by Location, Priority and Special Categories

Clovis West High School	1-2	3-5	6-10	H&S	DFM	ADA	EE
Bldg B							
Repair and/or replace interior wall finishes	0	1,250	0				
Repair and/or replace interior ceilings	0	2,500	0				
Repair and/or Replace casework	0	15,000	0			•	
Repair and/or replace window, door and hardware systems	0	3,078	0			•	•
Classroom Plumbing Replacement	1,734	0	3,203			•	
Repair and/or replace floors and floor coverings	0	62,219	0		•		
Toilet Room Plumbing Replacement.	0	0	7,016			•	•
Paint interior and/or exterior walls	0	2,531	0		•		
ADA Required upgrades	0	2,181	0			•	
Building Lighting Efficiency Improvements	10,000	0	0	•			•
Building Power Distribution Energy Improvements	0	7,500	0				•
HVAC/Chiller Upgrade and/or Replacement	7,800	3,891	0	•			•
Technology System Improvements	48,125	1,000	6,875	•			
Subtotals	\$ 67,659	\$ 101,150	\$ 17,094				
Bldg C							
HVAC/Chiller Upgrade and/or Replacement	2,600	3,891	44,589	•			•
Repair and/or replace floors and floor coverings	0	144,844	0		•		
Repair and/or Replace casework	0	9,375	0			•	
Replace and/or repair roofing, roof fences and fascia	0	356,250	0				
Paint interior and/or exterior walls	0	4,219	0		•		
Technology System Improvements	48,125	1,000	6,875	•			
Repair and/or replace interior ceilings	0	40,625	0				
Classroom Plumbing Replacement	14,203	27,875	19,406			•	
Building Lighting Efficiency Improvements	0	10,000	0	•			•
Building Power Distribution Energy Improvements	0	7,500	0				•
Subtotals	\$ 64,928	\$ 605,578	\$ 70,870				



Summary by Location, Priority and Special Categories

Clovis West High School	1-2	3-5	6-10	H&S	DFM	ADA	EE
Bldg E							
Expand and/or reconfigure Classroom building	0	612,500	0				
Building Power Distribution Energy Improvements	0	7,500	0				•
Repair and/or replace interior ceilings	0	15,000	0				
ADA Required upgrades	0	192,375	0			•	
Paint interior and/or exterior walls	0	7,031	0		•		
Building Lighting Efficiency Improvements	10,000	0	0	•			•
Technology System Improvements	48,125	1,000	6,875	•			
Classroom Plumbing Replacement	6,844	57,656	178,188			•	
HVAC/Chiller Upgrade and/or Replacement	5,200	3,891	27,489	•			•
Repair and/or replace floors and floor coverings	0	9,813	0		•		
Repair and/or Replace casework	0	10,219	0			•	
Subtotals	\$ 70,169	\$ 916,984	\$ 212,552				
Bldg J							
HVAC/Chiller Upgrade and/or Replacement	0	10,063	0	•			•
Building Power Distribution Energy Improvements	0	7,500	0				•
Building Lighting Efficiency Improvements	10,000	0	0	•			•
Classroom Plumbing Replacement	0	26,828	26,078			•	
Repair and/or replace floors and floor coverings	0	154,375	0		•		
HVAC/Chiller Upgrade and/or Replacement	7,800	3,891	143,616	•			•
Technology System Improvements	48,125	1,000	6,875	•			
Paint interior and/or exterior walls	0	4,219	0		•		
ADA Required upgrades	0	53,081	0			•	
Subtotals	\$ 65,925	\$ 260,956	\$ 176,569				
Bldg K							
Repair and/or replace floors and floor coverings	0	118,750	0		•		
Technology System Improvements	48,125	1,000	6,875	•			
Classroom Plumbing Replacement	2,250	4,156	1,906			•	
Building Lighting Efficiency Improvements	10,000	0	0	•			•
Paint interior and/or exterior walls	0	4,219	0		•		
ADA Required upgrades	0	1,781	0			•	
Building Power Distribution Energy Improvements	0	7,500	0				•
Subtotals	\$ 60,375	\$ 137,406	\$ 8,781				



Summary by Location, Priority and Special Categories

Clovis West High School	1-2	3-5	6-10	H&S	DFM	ADA	EE
Bldg L							
Technology System Improvements	48,125	1,000	6,875	●			
HVAC/Chiller Upgrade and/or Replacement	81,159	56,706	14,652	●			●
Toilet Room Plumbing Replacement.	0	5,453	18,328			●	●
Building Lighting Efficiency Improvements	0	10,000	0	●			●
Building Power Distribution Energy Improvements	0	7,500	0				●
Repair and/or replace interior ceilings	0	15,000	0				
Repair and/or replace floors and floor coverings	0	1,406	0		●		
Paint interior and/or exterior walls	0	4,219	0		●		
Subtotals	\$ 129,284	\$ 101,284	\$ 39,855				
Bldg M							
Classroom Plumbing Replacement	0	0	3,203			●	
Technology System Improvements	48,125	1,000	6,875	●			
Repair and/or replace interior ceilings	0	25,000	0				
HVAC/Chiller Upgrade and/or Replacement	0	61,889	0	●			●
Building Lighting Efficiency Improvements	0	10,000	0	●			●
Building Power Distribution Energy Improvements	0	7,500	0				●
Repair and/or replace floors and floor coverings	0	69,688	0		●		
Paint interior and/or exterior walls	0	8,438	0		●		
ADA Required upgrades	0	891	0			●	
Subtotals	\$ 48,125	\$ 184,405	\$ 10,078				
Bldg N							
Technology System Improvements	48,125	1,000	6,875	●			
Building Power Distribution Energy Improvements	0	7,500	0				●
Building Lighting Efficiency Improvements	0	10,000	0	●			●
HVAC/Chiller Upgrade and/or Replacement	2,600	49,417	0	●			●
Toilet Room Plumbing Replacement.	4,344	16,297	22,813			●	●
Subtotals	\$ 55,069	\$ 84,214	\$ 29,688				



Summary by Location, Priority and Special Categories

Clovis West High School	1-2	3-5	6-10	H&S	DFM	ADA	EE
Bldg S							
Paint interior and/or exterior walls	0	5,625	0		•		
Repair and/or replace interior ceilings	0	50,000	0				
Repair and/or replace interior wall finishes	0	156,000	0				
Repair and/or replace window, door and hardware systems	0	12,406	0			•	•
Toilet Room Plumbing Replacement.	953	59,953	165,563			•	•
ADA Required upgrades	0	145,178	0			•	
Renovate toilet rooms	0	32,250	0				
Technology System Improvements	96,250	2,000	13,750	•			
Repair and/or replace floors and floor coverings	0	528,838	0		•		
Building Power Distribution Energy Improvements	0	15,000	0				•
Building Lighting Efficiency Improvements	0	20,000	0	•			•
Repair and/or Replace casework	0	2,278	0			•	
Subtotals	\$ 97,203	\$ 1,029,528	\$ 179,313				
Large Gym							
Classroom Plumbing Replacement	4,266	813	22,531			•	
Toilet Room Plumbing Replacement.	0	37,969	30,797			•	•
Renovate toilet rooms	0	181,250	0				
ADA Required upgrades	0	31,294	0			•	
Paint interior and/or exterior walls	0	39,375	0		•		
Building Lighting Efficiency Improvements	10,000	0	0	•			•
Repair and/or Replace casework	0	25,425	0			•	
Repair and/or replace floors and floor coverings	0	68,938	0		•		
Repair and/or replace interior ceilings	0	58,594	0				
Repair and/or replace interior wall finishes	0	12,500	0				
Repair and/or replace window, door and hardware systems	0	10,625	0			•	•
HVAC/Chiller Upgrade and/or Replacement	48,994	15,438	115,931	•			•
Technology System Improvements	48,125	1,000	6,875	•			
Building Power Distribution Energy Improvements	0	7,500	0				•
Subtotals	\$ 111,384	\$ 490,719	\$ 176,134				



Summary by Location, Priority and Special Categories

Clovis West High School	1-2	3-5	6-10	H&S	DFM	ADA	EE
Library Media Center							
Technology System Improvements	123,125	12,500	141,250	●			
Expand and/or reconfigure Library Media Center building	0	612,500	0				
Building Lighting Efficiency Improvements	0	22,500	0	●			●
ADA Required upgrades	0	16,188	0			●	
Paint interior and/or exterior walls	0	8,438	0		●		
Repair and/or replace interior ceilings	0	3,750	0				
Repair and/or replace window, door and hardware systems	0	4,250	0			●	●
Replace and/or repair roofing, roof fences and fascia	0	237,500	0				
Repair and/or replace floors and floor coverings	0	285,000	0		●		
Classroom Plumbing Replacement	953	2,594	8,484			●	
Building Power Distribution Energy Improvements	0	16,250	0				●
Subtotals	\$ 124,078	\$ 1,221,469	\$ 149,734				
Maintenance							
HVAC/Chiller Upgrade and/or Replacement	11,047	29,653	14,427	●			●
Building Lighting Efficiency Improvements	0	10,000	0	●			●
Building Power Distribution Energy Improvements	0	7,500	0				●
Technology System Improvements	55,000	1,000	0	●			
Toilet Room Plumbing Replacement.	0	3,891	4,703			●	●
Subtotals	\$ 66,047	\$ 52,044	\$ 19,130				
Multipurpose							
Building Lighting Efficiency Improvements	0	10,000	0	●			●
Building Power Distribution Energy Improvements	0	7,500	0				●
Repair and/or replace interior wall finishes	0	24,750	0				
Repair and/or replace interior ceilings	0	2,500	0				
Repair and/or replace floors and floor coverings	0	3,918	0		●		
ADA Required upgrades	0	294,488	0			●	
Technology System Improvements	48,125	1,000	6,875	●			
Toilet Room Plumbing Replacement.	0	2,609	6,250			●	●
Classroom Plumbing Replacement	3,203	953	5,453			●	
Repair and/or replace window, door and hardware systems	0	51,594	0			●	●
Subtotals	\$ 51,328	\$ 399,312	\$ 18,578				



Summary by Location, Priority and Special Categories

Clovis West High School	1-2	3-5	6-10	H&S	DFM	ADA	EE
Portables							
ADA Required upgrades	0	31,500	0			•	
Paint interior and/or exterior walls	0	1,969	0		•		
Repair and/or replace floors and floor coverings	0	190,000	0		•		
Technology System Improvements	96,250	2,000	13,750	•			
Building Lighting Efficiency Improvements	0	20,000	0	•			•
Building Power Distribution Energy Improvements	0	15,000	0				•
HVAC/Chiller Upgrade and/or Replacement	0	0	462,375	•			•
Subtotals	\$ 96,250	\$ 260,469	\$ 476,125				
Rr-a							
Repair and/or replace window, door and hardware systems	0	2,125	0			•	•
ADA Required upgrades	0	1,350	0			•	
HVAC/Chiller Upgrade and/or Replacement	5,200	3,891	0	•			•
Toilet Room Plumbing Replacement.	0	17,484	44,313			•	•
Subtotals	\$ 5,200	\$ 24,850	\$ 44,313				
Small Gym							
HVAC/Chiller Upgrade and/or Replacement	0	77,717	0	•			•
Classroom Plumbing Replacement	0	2,250	23,297			•	
Toilet Room Plumbing Replacement.	1,625	11,188	27,297			•	•
HVAC/Chiller Upgrade and/or Replacement	0	15,519	0	•			•
Subtotals	\$ 1,625	\$ 106,673	\$ 50,594				
Snack Bar							
Toilet Room Plumbing Replacement.	0	16,328	7,938			•	•
Repair and/or replace window, door and hardware systems	0	2,125	0			•	•
Paint interior and/or exterior walls	0	5,906	0		•		
HVAC/Chiller Upgrade and/or Replacement	0	0	25,688	•			•
ADA Required upgrades	0	178,125	0			•	
Subtotals	\$ 0	\$ 202,484	\$ 33,625				

HMC Architects • 1827 E. Fir Avenue, Suite 103, Fresno, CA 93720
t. 559-322-2444, f. 559-322-2445, www.hmcarchitects.com



HMC
Architects