

Southampton Union Free School District

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

2020



ENVIROSCIENCE
CONSULTANTS INC.

**2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org**

Project #19878

Districtwide Lead in Drinking Water
Sampling and Remediation Plan

Performed for:

Southampton Union Free School District
70 Leland Lane
Southampton, NY 11968

September 2020
Updated January 18, 2021

Prepared by:

Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #19878

President



Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

I. Executive Summary

II. Sampling Methodology

III. Initial Results

Appendix A – Southampton Elementary School

Appendix B – Southampton Intermediate School

Appendix C – Southampton High School

Appendix D – Bus Garage

Appendix E – District Office

January 18, 2021

Marcus DaSilva
Southampton UFSD
70 Leland Lane
Southampton, NY 11968

I. Executive Summary

Southampton Union Free School District has developed their 2020 Lead in Drinking Water Sampling and Remediation Plan, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

The following locations within the Southampton district buildings have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Elementary grade classroom sinks
- 5) Bathroom sinks
- 6) Home Economics and Cooking Career focused classroom sinks
- 7) Nurse's Office and Faculty Room sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. The chains of custody are available upon request. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Southampton district buildings were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks
- 2) Art Room sinks
- 3) Technical Classroom sinks
- 4) Outside spigots
- 5) Custodial Closet sinks

In these cases, the Southampton staff have placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Technical sinks - classrooms in this category often include wood shop or auto mechanics classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Methodology

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Southampton buildings on September 30, 2020. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours

before the facilities opened. The water sources were not used for at least 8 hours and not more than 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes, source designations, remediation type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain

Source Designations


App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement
 plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed


Sampling Location Schematics

KITCHEN DIAGRAM

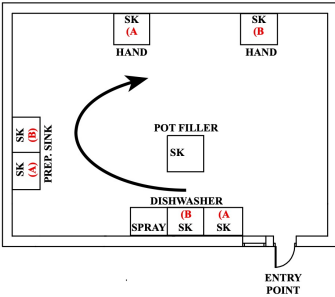


ENTRY POINT

HOME ECONOMICS / CAREER DIAGRAM

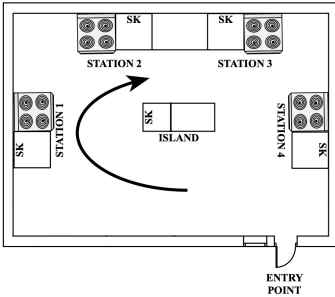

ENTRY POINT

GANG BATHROOM DIAGRAM

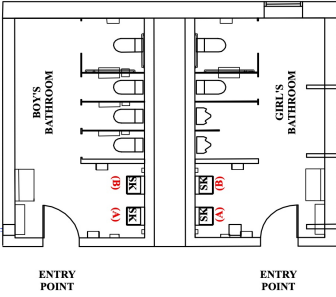

ENTRY POINT

SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Kitchen Dishwash Station @ (A)	SK
Kitchen Dishwash Station @ (B)	SK
Kitchen Dishwasher	SPRAY
Prep. Sink @ (A)	SK
Prep. Sink @ (B)	SK
Kitchen Hand Wash @ (A)	SK
Kitchen Hand Wash @ (B)	SK
Kitchen Pot Filler	SK


SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Career RM - Station 1	SK
Career RM - Station 2	SK
Career RM - Station 3	SK
Career RM - Station 4	SK
Career RM - Island	SK

SAMPLE IDENTIFICATION (example)


LOCATION	SOURCE
Girl's BR @ (A)	SK
Girl's BR @ (B)	SK
Boy's BR @ (A)	SK
Boy's BR @ (B)	SK

SCIENCE ROOM TYPE 1 DIAGRAM

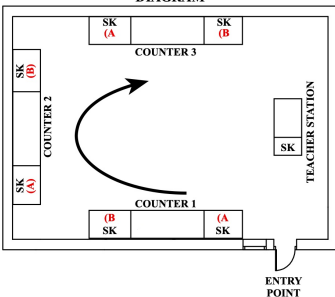


ENTRY POINT

SCIENCE ROOM TYPE 2 DIAGRAM

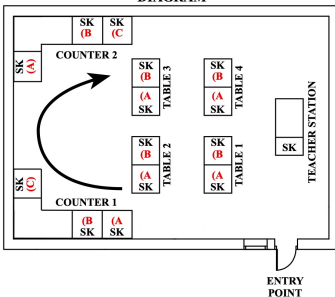

ENTRY POINT

SCIENCE ROOM TYPE 3 DIAGRAM

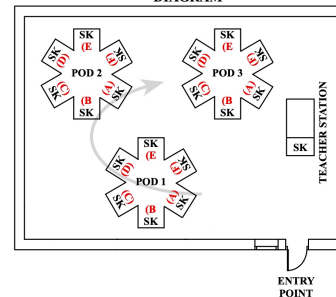

ENTRY POINT

SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Room 200 - Teacher Station	SK
Room 200 - Counter 1 @ (A)	SK
Room 200 - Counter 1 @ (B)	SK
Room 200 - Counter 2 @ (A)	SK
Room 200 - Counter 2 @ (B)	SK
Room 200 - Counter 3 @ (A)	SK
Room 200 - Counter 3 @ (B)	SK

SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Room 200 - Teacher Station	SK
Room 200 - Table 1 @ (A)	SK
Room 200 - Table 1 @ (B)	SK
Room 200 - Table 2 @ (A)	SK
Room 200 - Table 2 @ (B)	SK
Room 200 - Table 3 @ (A)	SK
Room 200 - Table 3 @ (B)	SK
Room 200 - Table 4 @ (A)	SK
Room 200 - Table 4 @ (B)	SK
Room 200 - Counter 1 @ (A)	SK
Room 200 - Counter 1 @ (B)	SK
Room 200 - Counter 1 @ (C)	SK
Room 200 - Counter 2 @ (A)	SK
Room 200 - Counter 2 @ (B)	SK
Room 200 - Counter 2 @ (C)	SK

SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Room 200 - Teacher Station	SK
Room 200 - POD 1 @ (A)	SK
Room 200 - POD 1 @ (B)	SK
Room 200 - POD 1 @ (C)	SK
Room 200 - POD 1 @ (D)	SK
Room 200 - POD 1 @ (E)	SK
Room 200 - POD 1 @ (F)	SK
Room 200 - POD 2 @ (A)	SK
Room 200 - POD 2 @ (B)	SK
Room 200 - POD 2 @ (C)	SK
Room 200 - POD 2 @ (D)	SK
Room 200 - POD 2 @ (E)	SK
Room 200 - POD 2 @ (F)	SK
Room 200 - POD 3 @ (A)	SK
Room 200 - POD 3 @ (B)	SK
Room 200 - POD 3 @ (C)	SK
Room 200 - POD 3 @ (D)	SK
Room 200 - POD 3 @ (E)	SK
Room 200 - POD 3 @ (F)	SK

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through E).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Southampton Elementary School

Room 237	SK	20.2
----------	----	------

Southampton Intermediate School

Kitchen Dishwasher Room	SK	39.2
Home Economics Counter 1 @ A	SK	47.1

Southampton High School

Kitchen Food Prep/Produce	SK	22.1
Music Office by Practice Room C	SK	39.2
Team Office 182A Bathroom	SK	18.7
Boy's Coach's Office Bathroom	SK	211
Stage Dressing Room B	SK	38.4
Stage Dressing Room A Bathroom	SK	19

District Bus Garage

No Exceedances

District Office

No Exceedances

- 1) Science Laboratory sinks
- 2) Art Room sinks
- 3) Technical Classroom sinks
- 4) Outside spigots
- 5) Custodial Closet sinks

In these cases, the Southampton staff have placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Technical sinks - classrooms in this category often include wood shop or auto mechanics classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Methodology

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Southampton buildings on September 30, 2020. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours

before the facilities opened. The water sources were not used for at least 8 hours and not more than 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes, source designations, remediation type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain

Source Designations


App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement
 plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed


Sampling Location Schematics

KITCHEN DIAGRAM

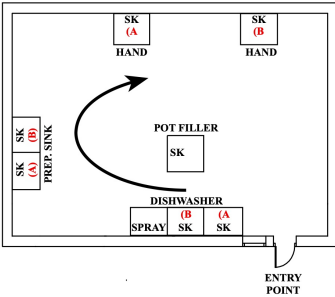


ENTRY POINT

HOME ECONOMICS / CAREER DIAGRAM

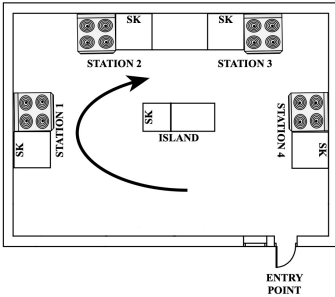

ENTRY POINT

GANG BATHROOM DIAGRAM

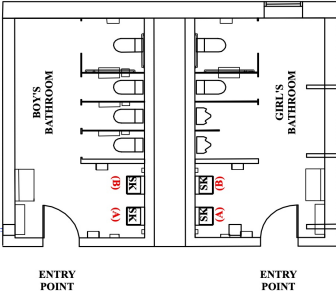

ENTRY POINT

SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Kitchen Dishwash Station @ (A)	SK
Kitchen Dishwash Station @ (B)	SK
Kitchen Dishwasher	SPRAY
Prep. Sink @ (A)	SK
Prep. Sink @ (B)	SK
Kitchen Hand Wash @ (A)	SK
Kitchen Hand Wash @ (B)	SK
Kitchen Pot Filler	SK


SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Career RM - Station 1	SK
Career RM - Station 2	SK
Career RM - Station 3	SK
Career RM - Station 4	SK
Career RM - Island	SK

SAMPLE IDENTIFICATION (example)


LOCATION	SOURCE
Girl's BR @ (A)	SK
Girl's BR @ (B)	SK
Boy's BR @ (A)	SK
Boy's BR @ (B)	SK

SCIENCE ROOM TYPE 1 DIAGRAM

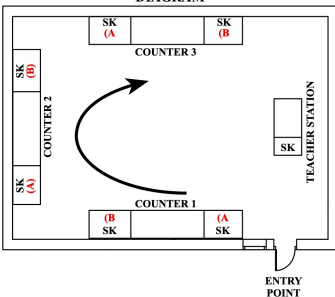


ENTRY POINT

SCIENCE ROOM TYPE 2 DIAGRAM

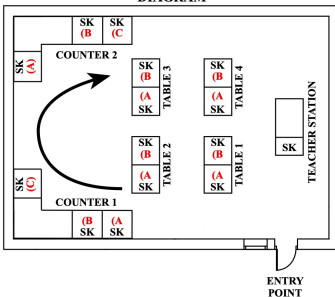

ENTRY POINT

SCIENCE ROOM TYPE 3 DIAGRAM

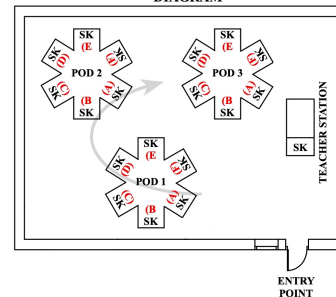

ENTRY POINT

SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Room 200 - Teacher Station	SK
Room 200 - Counter 1 @ (A)	SK
Room 200 - Counter 1 @ (B)	SK
Room 200 - Counter 2 @ (A)	SK
Room 200 - Counter 2 @ (B)	SK
Room 200 - Counter 3 @ (A)	SK
Room 200 - Counter 3 @ (B)	SK

SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Room 200 - Teacher Station	SK
Room 200 - Table 1 @ (A)	SK
Room 200 - Table 1 @ (B)	SK
Room 200 - Table 2 @ (A)	SK
Room 200 - Table 2 @ (B)	SK
Room 200 - Table 3 @ (A)	SK
Room 200 - Table 3 @ (B)	SK
Room 200 - Table 4 @ (A)	SK
Room 200 - Table 4 @ (B)	SK
Room 200 - Counter 1 @ (A)	SK
Room 200 - Counter 1 @ (B)	SK
Room 200 - Counter 1 @ (C)	SK
Room 200 - Counter 2 @ (A)	SK
Room 200 - Counter 2 @ (B)	SK
Room 200 - Counter 2 @ (C)	SK

SAMPLE IDENTIFICATION (example)

LOCATION	SOURCE
Room 200 - Teacher Station	SK
Room 200 - POD 1 @ (A)	SK
Room 200 - POD 1 @ (B)	SK
Room 200 - POD 1 @ (C)	SK
Room 200 - POD 1 @ (D)	SK
Room 200 - POD 1 @ (E)	SK
Room 200 - POD 1 @ (F)	SK
Room 200 - POD 2 @ (A)	SK
Room 200 - POD 2 @ (B)	SK
Room 200 - POD 2 @ (C)	SK
Room 200 - POD 2 @ (D)	SK
Room 200 - POD 2 @ (E)	SK
Room 200 - POD 2 @ (F)	SK
Room 200 - POD 3 @ (A)	SK
Room 200 - POD 3 @ (B)	SK
Room 200 - POD 3 @ (C)	SK
Room 200 - POD 3 @ (D)	SK
Room 200 - POD 3 @ (E)	SK
Room 200 - POD 3 @ (F)	SK

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through E).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Southampton Elementary School

Room 237	SK	20.2
----------	----	------

Southampton Intermediate School

Kitchen Dishwasher Room	SK	39.2
Home Economics Counter 1 @ A	SK	47.1

Southampton High School

Kitchen Food Prep/Produce	SK	22.1
Music Office by Practice Room C	SK	39.2
Team Office 182A Bathroom	SK	18.7
Boy's Coach's Office Bathroom	SK	211
Stage Dressing Room B	SK	38.4
Stage Dressing Room A Bathroom	SK	19

District Bus Garage

No Exceedances

District Office

No Exceedances

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Serving Area	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1001-2	Kitchen Prep Sink	SK	App	5.25	9/30/2020	-	-	-	None	-	-	-
1001-3	Kitchen 2-Bay @ A	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1001-4	Kitchen 2-Bay @ A	SPY	App	12	9/30/2020	-	-	-	None	-	-	-
1001-5	Kitchen 2-Bay @ B	SK	App	7.15	9/30/2020	-	-	-	None	-	-	-
1001-6	Kitchen Handwash	SK	N/A		9/30/2020	-	-	-	Sign Required	-	-	-
1001-7	Kitchen by Dishwasher	SK	App	8.57	9/30/2020	-	-	-	None	-	-	-
1001-8	Kitchen by Dishwasher	SPY	App	4.78	9/30/2020	-	-	-	None	-	-	-
1002-1	Boy's Bathroom by Cafeteria @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1002-2	Boy's Bathroom by Cafeteria @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1003-1	Hall by Cafeteria	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1003-2	Hall by Cafeteria	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1004-1	Girl's Bathroom by Cafeteria @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1004-2	Girl's Bathroom by Cafeteria @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1005-1	Faculty Bathroom by Cafeteria @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1005-2	Faculty Bathroom by Cafeteria @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1006-1	Faculty Handicap Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1007-1	Custodial Closet by Basement Entrance	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1008-1	Consulting Center Break Room	SK	App	11.4	9/30/2020	-	-	-	None	-	-	-
1009-1	Main Office Copy Room	SK	App	2.2	9/30/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1010-1	Hall by Room 112	WF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1011-1	Girl's Bathroom by Room 112 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1011-2	Girl's Bathroom by Room 112 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1011-3	Girl's Bathroom by Room 112 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1011-4	Girl's Bathroom by Room 112 @ D	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1012-1	Nurse's Office	WC	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1012-2	Nurse's Office	SK	App	5.92	9/30/2020	-	-	-	None	-	-	-
1013-1	Custodial Closet 127	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1014-1	Room 124 Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1015-1	Room 131 Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1016-1	Hall by Room 131	WF	App	5.16	9/30/2020	-	-	-	None	-	-	-
1017-1	Boy's Bathroom by Room 131 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1017-2	Boy's Bathroom by Room 131 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1017-3	Boy's Bathroom by Room 131 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1018-1	Room 133 Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1019-1	Room 132 Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1020-1	Room 135	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1021-1	Room 136	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1022-1	Custodial Closet 142	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1023-1	Faculty Bathroom by 142	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1024-1	Room 145	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1024-2	Room 145	SK	App	2.34	9/30/2020	-	-	-	None	-	-	-
1025-1	Room 144	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1025-2	Room 144	SK	App	3.53	9/30/2020	-	-	-	None	-	-	-
1026-1	Room 147	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1026-2	Room 147	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1027-1	Room 146	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1027-2	Room 146	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1028-1	Hall by Exit Ramp (left)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1028-2	Hall by Exit Ramp (right)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1028-2	Hall by Exit Ramp (right)	BF	App	9.45	9/30/2020	-	-	-	None	-	-	-
2001-1	Room 237	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2001-2	Room 237	SK	App	20.2	9/30/2020				None	Permanent Sign Posted		
2002-1	Room 236	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2002-2	Room 236	SK	App	9.76	9/30/2020	-	-	-	None	-	-	-
2003-1	Girl's Bathroom by Room 237 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2003-2	Girl's Bathroom by Room 237 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2003-3	Girl's Bathroom by Room 237 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2004-1	Boy's Bathroom by Room 236 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2004-2	Boy's Bathroom by Room 236 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2004-3	Boy's Bathroom by Room 236 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2005-1	Room 233	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2005-2	Room 233	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
2006-1	Room 232	WF	App		9/30/2020	-	-	-	None	-	-	-
2006-2	Room 232	SK	App	1.03	9/30/2020	-	-	-	None	Removed from Service	-	-
2007-1	2nd Floor Faculty Bathroom by Elevator	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2008-1	2nd Floor Custodial Closet by Elevator	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2009-1	Hall by Room 224	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2010-1	Boy's Bathroom by Room 224 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2010-2	Boy's Bathroom by Room 224 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2010-3	Boy's Bathroom by Room 224 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2010-4	Boy's Bathroom by Room 224 @ D	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2011-1	Custodial Closet by Library	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-1	Faculty Room 215	WC	App	2.37	9/30/2020	-	-	-	None	-	-	-
2012-2	Faculty Room 215	SK	App	12	9/30/2020	-	-	-	None	-	-	-
2012-3	Faculty Room 215 Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2013-1	Girl's Bathroom by Room 211 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2013-2	Girl's Bathroom by Room 211 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2013-3	Girl's Bathroom by Room 211 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2013-4	Girl's Bathroom by Room 211 @ D	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2014-1	Conference Room Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2015-1	Hall by Room 211	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2015-1	Hall by Room 211	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
3001-1	Room 330	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
3001-2	Room 330	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
3002-1	Girl's Bathroom by Room 330	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3003-1	Boy's Bathroom by Room 330	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3004-1	Room 329	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
3004-2	Room 329	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
3005-1	3rd Floor Faculty Bathroom by Elevator	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3006-1	Room 321 Counter @ A	SK	App	10.6	9/30/2020	-	-	-	None	-	-	-
3006-2	Room 321 Counter @ B	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
3007-1	Hall by Room 322	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
3007-1	Hall by Room 322	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
3008-1	Boy's Bathroom by Room 322 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3008-2	Boy's Bathroom by Room 322 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3008-3	Boy's Bathroom by Room 322 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3008-4	Boy's Bathroom by Room 322 @ D	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3009-1	Room 318 Art-left	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
3009-2	Room 318 Art-right	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3010-1	Room 314	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
3011-1	Girl's Bathroom by Room 313 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3011-2	Girl's Bathroom by Room 313 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3011-3	Girl's Bathroom by Room 313 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3011-4	Girl's Bathroom by Room 313 @ D	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
3012-1	Hall by Room 313	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
0001-1	Outside Fountain by Playground	WF	App		9/30/2020	-	-	-	None	Removed from Service		
0002-1	Outside Bathroom by Playground (left)	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required		
0003-1	Outside Bathroom by Playground (right)	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required		

Laboratory Report

NYE Report #: 2203915-15745

October 5, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: 19878; Southampton Elementary School, Southampton, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 01, 2020. New York Environmental analyzed the samples on October 02, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	30 Sep 2020
Date Received:	01 Oct 2020
Date Analyzed:	02 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201001L069	1	Kitchen Serving Area-SK; Initial	1.00	<1.00	µg/L	
201001L070	2	Kitchen Prep Sink-SK; Initial	1.00	5.25	µg/L	
201001L071	3	Kitchen 2-Bay @ A-SK; Initial	1.00	<1.00	µg/L	
201001L072	4	Kitchen 2-Bay @ A-SPY; Initial	1.00	12.0	µg/L	
201001L073	5	Kitchen 2-Bay @ B-SK; Initial	1.00	7.15	µg/L	
201001L074	6	Kitchen by Dishwasher-SK; Initial	1.00	8.57	µg/L	
201001L075	7	Kitchen by Dishwasher-SPY; Initial	1.00	4.78	µg/L	
201001L076	8	Hall by Cafeteria-BF; Initial	1.00	<1.00	µg/L	
201001L077	9	Consulting Center Break Room-SK; Initial	1.00	11.4	µg/L	
201001L078	10	Main Office Copy Room-SK; Initial	1.00	2.20	µg/L	
201001L079	11	Hall by Room 112-BF; Initial	1.00	<1.00	µg/L	
201001L080	12	Nurse's Office-WC; Initial	1.00	<1.00	µg/L	
201001L081	13	Nurse's Office-SK; Initial	1.00	5.92	µg/L	
201001L082	14	Hall by Room 131-WF; Initial	1.00	5.16	µg/L	
201001L083	15	Room 145-SK; Initial	1.00	2.34	µg/L	
201001L084	16	Room 144-SK; Initial	1.00	3.53	µg/L	
201001L085	17	Room 147-SK; Initial	1.00	<1.00	µg/L	
201001L086	18	Room 146-SK; Initial	1.00	<1.00	µg/L	
201001L087	19	Hall by Exit Ramp (right)-BF; Initial	1.00	9.45	µg/L	
201001L088	20	Room 237-SK; Initial	1.00	20.2	µg/L	H
201001L089	21	Room 236-SK; Initial	1.00	9.76	µg/L	
201001L090	22	Room 233-SK; Initial	1.00	<1.00	µg/L	
201001L091	23	Room 232-SK; Initial	1.00	1.03	µg/L	
201001L092	24	Faculty Room 215-WC; Initial	1.00	2.37	µg/L	
201001L093	25	Faculty Room 215-SK; Initial	1.00	12.0	µg/L	
201001L094	26	Hall by Room 211-BF; Initial	1.00	<1.00	µg/L	



Date Collected:	30 Sep 2020
Date Received:	01 Oct 2020
Date Analyzed:	02 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
201001L095	27	Room 330-SK; Initial	1.00	<1.00	µg/L	
201001L096	28	Room 329-SK; Initial	1.00	<1.00	µg/L	
201001L097	29	Room 321 Counter @ A-SK; Initial	1.00	10.6	µg/L	
201001L098	30	Room 321 Counter @ B-SK; Initial	1.00	<1.00	µg/L	
201001L099	31	Hall by Room 322-BF; Initial	1.00	<1.00	µg/L	
201001L100	32	Room 318 Art-right-SK; Initial	1.00	<1.00	µg/L	
201001L101	33	Room 318 Art-left-SK; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Ice Machine	IM	App	4.15	9/30/2020	-	-	-	None	-	-	-
1002-1	Kitchen Bathroom	SK	App	3.83	9/30/2020	-	-	-	None	-	-	-
1002-2	Kitchen Handwash @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1002-3	Kitchen Food Prep by Stove	SK	App	4.51	9/30/2020	-	-	-	None	-	-	-
1002-4	Kitchen Sanitizer Station	SK	App	1.34	9/30/2020	-	-	-	None	-	-	-
1002-5	Kitchen Handwash at Serving Line	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1002-6	Kitchen Dishwasher Room	SK	App	39.2	9/30/2020				None	Permanent Sign Posted		
1002-7	Kitchen Dishwasher Room	SPY	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1003-1	Custodial Closet by Kitchen	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1003-2	Custodial Closet by Kitchen	SPY	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1004-1	Receiving Area	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1005-1	Cafeteria	WF	App		9/30/2020	-	-	-		Removed from Service	-	-
1006-1	Men's Bathroom Across fr Room B151	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1007-1	Custodial Closet Across fr Room B151	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1008-1	Women's Bathroom Across fr Room B151	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1009-1	Girl's Bathroom by Room B134 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1009-2	Girl's Bathroom by Room B134 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1010-1	Hall by Room B134	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1011-1	Room B131 Counter @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1011-2	Room B131 Counter @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-1	Custodial Closet Across fr Room B126	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1013-1	Women's Bathroom Across fr Room B125	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1014-1	Room B125 Counter @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1014-2	Room B125 Counter @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1015-1	Faculty Room	SK	App	14.9	9/30/2020	-	-	-	None	-	-	-
1015-2	Faculty Room	WC	App	4.74	9/30/2020	-	-	-	None	-	-	-
1016-1	Hall by Faculty Room	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1016-2	Hall by Faculty Room	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1017-1	Boy's Bathroom by Faculty Room @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1017-2	Boy's Bathroom by Faculty Room @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1018-1	Girl's Bathroom by Room A107 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1018-2	Girl's Bathroom by Room A107 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1018-3	Girl's Bathroom by Room A107 @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1019-1	Hall Across from Guidance Office	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1020-1	Custodial Closet Across from Guidance Office	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1021-1	Boy's Bathroom by Nurse's Office @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1021-2	Boy's Bathroom by Nurse's Office @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1021-3	Boy's Bathroom by Nurse's Office @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1022-1	Nurse's Office	SK	App	5.33	9/30/2020	-	-	-	None	-	-	-
1022-2	Nurse's Office Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1023-1	Unisex Bathroom by Assistant Principal's Office	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1024-1	Unisex Bathroom Across from Main Office	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1025-1	Principal's Office Bathroom	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1026-1	Library Office	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1027-1	Hall by Kitchen	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1027-2	Hall by Kitchen	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1028-1	Home Economics Counter 1 @ A	SK	App	47.1	9/30/2020				Additional Sampling Required	Fixture Replacement	<1.0	12/8/2020
1028-2	Home Economics Counter 1 @ B	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1028-3	Home Economics Counter 1 @ C	SK	App	8.56	9/30/2020	-	-	-	None	-	-	-
1028-4	Home Economics Counter 2 @ A	SK	App	1.9	9/30/2020	-	-	-	None	-	-	-
1029-1	Girl's Bathroom by Girl's Locker Room @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1029-2	Girl's Bathroom by Girl's Locker Room @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1030-1	Girl's Locker Room (left)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1030-2	Girl's Locker Room (right)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1030-3	Girl's Locker Room (right)	BF	App	2.22	9/30/2020	-	-	-	None	-	-	-
1030-4	Girl's Locker Room Bathroom @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1030-5	Girl's Locker Room Bathroom @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1031-1	Girl's Locker Room Coach's Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1032-1	Gymnasium	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1033-1	Gymnasium Vestibule	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1034-1	Boy's Locker Room (left)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1034-2	Boy's Locker Room (right)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1034-3	Boy's Locker Room (right)	BF	App	4.23	9/30/2020	-	-	-	None	-	-	-
1034-4	Boy's Locker Room Bathroom @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1034-5	Boy's Locker Room Bathroom @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1035-1	Boy's Locker Room Coach's Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1036-1	Boy's Bathroom by Boiler Room @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1036-2	Boy's Bathroom by Boiler Room @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1037-1	Custodial Closet by Boy's Locker Room	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1038-1	Art Room Unit @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1038-2	Art Room Unit @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1038-3	Art Room Unit @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1038-4	Art Room Unit @ D	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1038-5	Art Room Dark Room	SK	N/A		9/30/2020	-	-	-	None	CAPPED	-	-
1039-1	Wood Shop Trough @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1039-2	Wood Shop Trough @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1039-3	Wood Shop Trough @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1039-4	Wood Shop Bathroom	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1040-1	Weight Room	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2001-1	Girl's Bathroom by Room B218 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2001-2	Girl's Bathroom by Room B218 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2002-1	Hall by Room B218	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2003-1	Room B309 Counter @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2003-2	Room B309 Counter @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2004-1	Custodial Closet Across From Room B204	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2005-1	Men's Bathroom Across from Room B203	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2006-1	Room B203 Counter @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2006-2	Room B203 Counter @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2007-1	Hall by Room B203	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2007-2	Hall by Room B203	BF	App	2.45	9/30/2020	-	-	-	None	-	-	-
2008-1	Boy's Bathroom by Room B218 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2008-2	Boy's Bathroom by Room B218 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2009-1	Hall by Room A203	WF	N/A		9/30/2020	-	-	-	None	CAPPED	-	-
2010-1	Room A203 Counter @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-2	Room A203 Counter @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-3	Room A203 Counter @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-4	Room A203 Counter @ D	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-5	Room A203 Counter @ E	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-6	Room A203 Counter @ F	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-7	Room A203 Counter @ G	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2010-8	Room A203 Counter @ H	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-9	Room A203 Counter @ I	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2011-1	Room A218 Teacher's Station	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-8	Room A203 Counter @ H	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-9	Room A203 Counter @ I	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2011-1	Room A218 Teacher's Station	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-1	Room A206 Counter 1 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-2	Room A206 Counter 1 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-3	Room A206 Counter 1 @ C	SK	N/A		9/30/2020	-	-	-	None	CAPPED	-	-
2012-4	Room A206 Counter 1 @ D	SK	N/A		9/30/2020	-	-	-	None	CAPPED	-	-
2012-5	Room A206 Counter 1 @ E	SK	N/A		9/30/2020	-	-	-	None	CAPPED	-	-
2012-6	Room A206 Counter 1 @ F	SK	N/A		9/30/2020	-	-	-	None	CAPPED	-	-
2012-7	Room A206 Counter 2 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-8	Room A206 Counter 2 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-9	Room A206 Counter 3 @ A	SK	N/A		9/30/2020	-	-	-	None	CAPPED	-	-
2012-10	Room A206 Counter 3 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-11	Room A206 Counter 3 @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-12	Room A206 Counter 3 @ D	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-1	Girl's Bathroom by Room A206 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-2	Girl's Bathroom by Room A206 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2013-3	Girl's Bathroom by Room A206 @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2014-1	Hall by Room A206	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2014-2	Hall by Room A206	BF	App	5.67	9/30/2020	-	-	-	None	-	-	-
2015-1	Boy's Bathroom by Room A210 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-2	Boy's Bathroom by Room A210 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-3	Boy's Bathroom by Room A210 @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0001-1	Outside Spigot by Weight Room	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0002-1	Outside Spigot by Weight Room-East	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0003-1	Outside Spigot by Gymnasium	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0004-1	Outside Spigot by Home Economics	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0005-1	Outside Spigot by Room A104	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0006-1	Outside Spigot by Room A140	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0007-1	Outside Spigot by Room B125	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0008-1	Outside Spigot by Room B128	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0009-1	Outside Spigot by Room B151	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0010-1	Outside Spigot by Musict Room	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0011-1	Outside Spigot by Cafeteria	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2203914-15744

October 5, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: 19878; Southampton Intermediate School, Southampton, NY

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 01, 2020. New York Environmental analyzed the samples on October 02, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Sep 2020
Date Received:	01 Oct 2020
Date Analyzed:	02 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201001L046	1	Kitchen-IM; Initial	1.00	4.15	µg/L	
201001L047	2	Kitchen Bathroom-SK; Initial	1.00	3.83	µg/L	
201001L048	3	Kitchen Sanitizer Station-SK; Initial	1.00	1.34	µg/L	
201001L049	4	Kitchen Food Prep by Stove-SK; Initial	1.00	4.51	µg/L	
201001L050	5	Kitchen Dishwasher Room-SK; Initial	1.00	39.2	µg/L	H
201001L051	6	Faculty Room-SK; Initial	1.00	14.9	µg/L	
201001L052	7	Faculty Room-WC; Initial	1.00	4.74	µg/L	
201001L053	8	Hall by Faculty Room-BF; Initial	1.00	<1.00	µg/L	
201001L054	9	Nurse's Office-SK; Initial	1.00	5.33	µg/L	
201001L055	10	Principal's Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
201001L056	11	Library Office-SK; Initial	1.00	<1.00	µg/L	
201001L057	12	Hall by Kitchen-BF; Initial	1.00	<1.00	µg/L	
201001L058	13	Home Economics Counter 1 @ A-SK; Initial	1.00	47.1	µg/L	H
201001L059	14	Home Economics Counter 1 @ B-SK; Initial	1.00	<1.00	µg/L	
201001L060	15	Home Economics Counter 1 @ C-SK; Initial	1.00	8.56	µg/L	
201001L061	16	Home Economics Counter 2 @ A-SK; Initial	1.00	1.90	µg/L	
201001L062	17	Girl's Locker Room (right)-BF; Initial	1.00	2.22	µg/L	
201001L063	18	Boy's Locker Room (right)-BF; Initial	1.00	4.23	µg/L	
201001L064	19	Wood Shop Bathroom-SK; Initial	1.00	<1.00	µg/L	
201001L065	20	Hall by Room B203-BF; Initial	1.00	2.45	µg/L	
201001L066	21	Hall by Room A206-BF; Initial	1.00	5.67	µg/L	
201001L067	22	Nurse's Office-WC; Initial	1.00	4.05	µg/L	
201001L068	23	Gym-BF; Initial	1.00	4.71	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



Laboratory Report

NYE Report #: 2204922-16424

December 11, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Southampton Intermediate School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 09, 2020. New York Environmental analyzed the samples on December 10, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	08 Dec 2020
Date Received:	09 Dec 2020
Date Analyzed:	10 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
201209K052	1	Home Economics Counter 1 @ A-SK	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Vestibule Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1002-1	Kitchen Vestibule Custodial Closet	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1003-1	Kitchen Locker Room @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1003-2	Kitchen Locker Room @ B	SK	App	4.36	9/30/2020	-	-	-	None	-	-	-
1004-1	Kitchen Handwash @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1004-2	Kitchen Food Prep/Produce	SK	App	22.1	9/30/2020				Additional Sampling Required	Fixture Replacement	3.37	12/8/2020
1004-3	Kitchen by Sanitizer Station	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1004-4	Kitchen by Sanitizer Station	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1004-5	Kitchen Sanitizer Station @A	SK	App	1.17	9/30/2020	-	-	-	None	-	-	-
1004-6	Kitchen Sanitizer Station @A	SK	App	1.23	9/30/2020	-	-	-	None	-	-	-
1004-7	Kitchen Sanitizer Station @B	SPY	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1004-8	Kitchen by Dishwasher	SPY	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1004-9	Kitchen Handwash @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1004-10	Kitchen Handwash @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1004-11	Kitchen Island by Pizza Oven	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1004-12	Kitchen Island by Stove	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1004-13	Kitchen Island 2-Bay by Walk-in	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1004-14	Kitchen Kettle	PF	App	3.4	9/30/2020	-	-	-	None	-	-	-
1004-15	Kitchen by Stove	PF	App	12.5	9/30/2020	-	-	-	None	-	-	-
1005-1	Serving Line Handwash @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1005-2	Serving Line Handwash @ B	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1005-3	Serving Line Island w/Coffee Makers	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1005-4	Serving Line Handwash @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1005-5	Serving Line Ice Machine	IM	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1006-1	Cafeteria by 160A Storage	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1006-2	Cafeteria by 160A Storage	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1006-3	Cafeteria by 160C Storage	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1006-4	Cafeteria by 160C Storage	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1007-1	Room 145 Station 1	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1007-2	Room 145 Station 2	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1007-3	Room 145 Station 3	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1007-4	Room 145 Station 4	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1007-5	Room 145 Counter	SK	App	14.2	9/30/2020	-	-	-	None	-	-	-
1008-1	Hall by Room 143	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1009-1	Room 143 Station 1	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1009-2	Room 143 Counter	SK	App	14.2	9/30/2020	-	-	-	None	-	-	-
1010-1	Music Office by Practice Room C	SK	App	39.2	9/30/2020				None	Permanently Removed From Service		
1011-1	Girl's Locker Room Coach's Office Bathroom	SK	App	11.8	9/30/2020	-	-	-	None	-	-	-
1011-2	Girl's Locker Room	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1011-3	Girl's Locker Room Coach's Office 179E Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1011-4	Girl's Locker Room Bathroom @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1011-5	Girl's Locker Room Bathroom @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1011-6	Girl's Locker Room Bathroom @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1012-1	Girl's Bathroom Across from Room 137 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1012-2	Girl's Bathroom Across from Room 137 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1012-3	Girl's Bathroom Across from Room 137 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1013-1	Hall by Room 137	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1013-2	Hall by Room 137	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1014-1	Boy's Bathroom Across from Room 137 @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1014-2	Boy's Bathroom Across from Room 137 @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1014-3	Boy's Bathroom Across from Room 137 @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1015-1	Girl's Varsity Locker Room Vestibule (left)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1015-2	Girl's Varsity Locker Room Vestibule (right)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1016-1	Girl's Varsity Locker Room Bathroom @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1016-2	Girl's Varsity Locker Room Bathroom @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1016-3	Girl's Varsity Locker Room Bathroom @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1016-4	Girl's Varsity Locker Room Exit Vestibule Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1017-1	Team Office 182A Bathroom	SK	App	18.7	9/30/2020				None	Permanent Sign Posted		
1018-1	Boy's Team Locker Room	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1019-1	Boy's Locker Room	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1019-2	Boy's Locker Room Bathroom @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1019-3	Boy's Locker Room Bathroom @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1019-4	Boy's Locker Room Bathroom @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1019-5	Boy's Coach's Office Bathroom	SK	App	211	9/30/2020				None	Permanent Sign Posted		
1020-1	Athletic Office Kitchenette	SK	App	3.91	9/30/2020	-	-	-	None	-	-	-
1021-1	Laundry Storage 181A Ice Machine	IM	App		9/30/2020	-	-	-	None	-	-	-
1022-1	Auxillary Gym (left)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1022-2	Auxillary Gym (right)	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1023-1	Nurse's Office Bathroom	SK	App	8.91	9/30/2020	-	-	-	None	-	-	-
1023-2	Nurse's Office	SK	App	10.3	9/30/2020	-	-	-	None	-	-	-
1023-3	Nurse's Office Storage	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1024-1	Stage Dressing Room B	SK	App	38.4	9/30/2020				None	Permanent Sign Posted		
1024-2	Stage Dressing Room B Bathroom	SK	App	9.33	9/30/2020	-	-	-	None	-	-	-
1025-1	Stage Dressing Room A	SK	App	9.48	9/30/2020	-	-	-	None	-	-	-
1025-2	Stage Dressing Room A Bathroom	SK	App	19	9/30/2020				None	Permanent Sign Posted		
1026-1	Main Lobby by Storage 174	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1026-2	Main Lobby by Storage 174	BF	App	7.84	9/30/2020	-	-	-	None	-	-	-
1027-1	Main Lobby Girl's Bathroom @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1027-2	Main Lobby Girl's Bathroom @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1027-3	Main Lobby Girl's Bathroom @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1028-1	Main Lobby Family Bathroom	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1029-1	Main Lobby Boy's Bathroom @A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1029-2	Main Lobby Boy's Bathroom @B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1029-3	Main Lobby Boy's Bathroom @C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1030-1	Main Lobby by Storage 172	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1030-2	Main Lobby by Storage 172	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1031-1	Main Lobby Women's Faculty Bathroom @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1031-2	Main Lobby Women's Faculty Bathroom @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1032-1	Library Work Room	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
1033-1	Hall by Office 127A	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1034-1	Custodial Closet 111 A	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1035-1	Hall by Room 111	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1036-1	Main Office	SK	App	7.84	9/30/2020	-	-	-	None	-	-	-
1036-2	Main Office	WC	App	<1.0	9/30/2020	-	-	-	None	-	-	-
1037-1	Custodian's Office 157 Bathroom	SK	App	4.86	9/30/2020	-	-	-	None	-	-	-
1038-1	Custodial Closet by Room 154	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
1039-1	Hall by Room 154	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
1040-1	Room 154 Unit @ A	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-2	Room 154 Unit @ B	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-3	Room 154 Unit @ C	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1040-4	Room 154 Unit @ D	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-5	Room 154 Unit @ E	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-6	Room 154 Unit @ F	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-7	Room 154 Trough @ A	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-5	Room 154 Unit @ E	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-6	Room 154 Unit @ F	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-7	Room 154 Trough @ A	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-8	Room 154 Trough @ B	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1040-9	Room 154 Trough @ C	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1041-1	Room 152 Trough @ A	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1041-2	Room 152 Trough @ B	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1041-3	Room 152 Trough @ C	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1041-4	Room 152 Dark Room	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1042-1	Room 146 Trough @A	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1042-2	Room 146 Trough @B	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1042-3	Room 146 Trough @C	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1042-4	Room 146 Bathroom	SK	App	5.14	9/30/2020	-	-	-	None	-	-	-
1043-1	Room 148 Trough 1 @ A	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1043-2	Room 148 Trough 1 @ B	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1043-3	Room 148 Trough 1 @ C	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1043-4	Room 148 Trough 2 @ A	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1043-5	Room 148 Trough 2 @ B	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
1043-6	Room 148 Trough 2 @ C	SK	N/A		9/30/2020	-	-	-	Sign Rquired	-	-	-
2001-1	2nd Floor Main Lobby by Boy's Bathroom	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2001-2	2nd Floor Main Lobby by Boy's Bathroom	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
2002-1	2nd Floor Main Lobby Boy's Bathroom @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2002-2	2nd Floor Main Lobby Boy's Bathroom @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2002-3	2nd Floor Main Lobby Boy's Bathroom @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2003-1	2nd Floor Main Lobby Girl's Bathroom @ A	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2003-2	2nd Floor Main Lobby Girl's Bathroom @ B	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2003-3	2nd Floor Main Lobby Girl's Bathroom @ C	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2004-1	2nd Floor Main Lobby Custodial Closet	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2005-1	2nd Floor Main Lobby by Girl's Bathroom	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2005-2	2nd Floor Main Lobby by Girl's Bathroom	BF	App	<1.0	9/30/2020	-	-	-	None	-	-	-
2006-1	Women's Bathroom by Room 237	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2007-1	Men's Bathoom by Room 237	SK	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
2008-1	Chemical Storage 226	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2009-1	Hall by Chemical Storage 226	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
2010-1	Room 225 Teacher's Station	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-2	Room 225 Counter 1 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2010-3	Room 225 Counter 1 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-4	Room 225 Counter 1 @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-5	Room 225 Counter 2	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-6	Room 225 Counter 3 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2010-7	Room 225 Counter 3 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2011-1	Room 223 Counter @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2011-2	Room 223 Counter @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-1	Room 221 Teacher's Station	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-2	Room 221 Counter 1 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-3	Room 221 Counter 1 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-4	Room 221 Counter 1 @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-5	Room 221 Counter 2	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-6	Room 221 Counter 3 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2012-7	Room 221 Counter 3 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-1	Room 224 Teacher's Station	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-2	Room 224 Counter 1	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-3	Room 224 Table 1 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-4	Room 224 Table 1 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-5	Room 224 Table 2 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-6	Room 224 Table 2 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2013-7	Room 224 Table 3 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-8	Room 224 Table 3 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-9	Room 224 Table 4 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-10	Room 224 Table 4 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-11	Room 224 Table 5 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-12	Room 224 Table 5 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-13	Room 224 Table 6 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-14	Room 224 Table 6 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-15	Room 224 Table 7 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2013-16	Room 224 Table 7 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2014-1	Prep Room 222 Counter	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-1	Room 220 Teacher's Station	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-2	Room 220 Counter 1	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-3	Room 220 Table 1 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-4	Room 220 Table 1 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-5	Room 220 Table 2 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-6	Room 220 Table 2 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-7	Room 220 Table 3 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-8	Room 220 Table 3 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-9	Room 220 Table 4 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2015-10	Room 220 Table 4 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-11	Room 220 Table 5 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-12	Room 220 Table 5 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-13	Room 220 Table 6 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-14	Room 220 Table 6 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-15	Room 220 Table 7 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2015-16	Room 220 Table 7 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2016-1	Room 219 Teacher's Station	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2016-2	Room 219 Counter 1 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2016-3	Room 219 Counter 1 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2016-4	Room 219 Counter 1 @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2016-5	Room 219 Counter 2	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2016-6	Room 219 Counter 3 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2016-7	Room 219 Counter 3 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2017-1	Prep Room 217 Counter @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2017-2	Prep Room 217 Counter @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2018-1	Room 215 Counter 1 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2018-2	Room 215 Counter 1 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2018-3	Room 215 Counter 2 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2018-4	Room 215 Counter 3 @ A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-5	Room 215 Counter 3 @ B	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2018-6	Room 215 Counter 3 @ C	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2019-1	Room 215A Counter 1	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2019-2	Room 215A Counter 2	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2019-3	Room 215A Counter 3	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2019-4	Room 215A Counter 4	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2019-5	Room 215A	SK	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2020-1	Custodial Closet 214	SS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
2021-1	Hall by Room 213	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
0001-1	Outside Spigot by Room 158	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0002-1	Outside Spigot by Room 164B	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0003-1	Outside Spigot by Room 145	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0004-1	Outside Spigot by Room 179	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0005-1	Outside by Storage 179G	WF	App		9/30/2020	-	-	-	None	Removed from Service	-	-
0006-1	Outside Bathroom by Storage 179G	OS	N/A		9/30/2020	-	-	-	None	Mixed Valve No Sampling Required	-	-
0007-1	Outside Spigot by Room 125	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0008-1	Outside Spigot by Room 111B	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-
0009-1	Outside Spigot by Room 148	OS	N/A		9/30/2020	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2203913-15743

October 5, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: 19878; Southampton High School, Southampton, NY

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 01, 2020. New York Environmental analyzed the samples on October 02, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Sep 2020
Date Received:	01 Oct 2020
Date Analyzed:	02 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201001L001	1	Kitchen Locker Room @ B-SK; Initial	1.00	4.36	µg/L	
201001L002	2	Kitchen Food Prep-SK; Initial	1.00	22.1	µg/L	H
201001L003	3	Kitchen by Sanitizer Station-BF; Initial	1.00	<1.00	µg/L	
201001L004	4	Kitchen Sanitizer Station @A-SK; Initial	1.00	1.17	µg/L	
201001L005	5	Kitchen Sanitizer Station @A-SPY; Initial	1.00	1.23	µg/L	
201001L006	6	Kitchen Sanitizer Station @B-SK; Initial	1.00	<1.00	µg/L	
201001L007	7	Kitchen by Dishwasher -SPY; Initial	1.00	<1.00	µg/L	
201001L008	8	Kitchen Island by Pizza Oven-SK; Initial	1.00	<1.00	µg/L	
201001L009	9	Kitchen Island by Stove-SK; Initial	1.00	<1.00	µg/L	
201001L010	10	Kitchen Island 2-Bay by Walk-in-SK; Initial	1.00	<1.00	µg/L	
201001L011	11	Kitchen Kettle-PF; Initial	1.00	3.40	µg/L	
201001L012	12	Serving Line Handwash @ B-SK; Initial	1.00	<1.00	µg/L	
201001L013	13	Serving Line Island w/Coffee Makers-SK; Initial	1.00	<1.00	µg/L	
201001L014	14	Serving Line Ice Machine-IM; Initial	1.00	<1.00	µg/L	
201001L015	15	Cafeteria by 160A Storage-BF; Initial	1.00	<1.00	µg/L	
201001L016	16	Cafeteria by 160C Storage-BF; Initial	1.00	<1.00	µg/L	
201001L017	17	Room 145 Station 1-SK; Initial	1.00	<1.00	µg/L	
201001L018	18	Room 145 Station 2-SK; Initial	1.00	<1.00	µg/L	
201001L019	19	Room 145 Station 3-SK; Initial	1.00	<1.00	µg/L	
201001L020	20	Room 145 Station 4-SK; Initial	1.00	<1.00	µg/L	
201001L021	21	Room 145 Counter-SK; Initial	1.00	1.65	µg/L	
201001L022	22	Room 143 Station 1-SK; Initial	1.00	<1.00	µg/L	
201001L023	23	Room 143 Counter-SK; Initial	1.00	14.2	µg/L	
201001L024	24	Music Office by Practice Room C-SK; Initial	1.00	39.2	µg/L	H
201001L025	25	Girl's Locker Room Coach's Office Bathroom-SK; Initial	1.00	11.8	µg/L	
201001L026	26	Hall by Room 137-BF; Initial	1.00	<1.00	µg/L	



Date Collected:	30 Sep 2020
Date Received:	01 Oct 2020
Date Analyzed:	02 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201001L027	27	Team Office 182A Bathroom-SK; Initial	1.00	18.7	µg/L	H
201001L028	28	Boy's Locker Room Coach's Office Bathroom-SK; Initial	1.00	211	µg/L	E,H
201001L029	29	Athletic Office Kitchenette-SK; Initial	1.00	3.91	µg/L	
201001L030	30	Nurse's Office Bathroom-SK; Initial	1.00	8.91	µg/L	
201001L031	31	Nurse's Office -SK; Initial	1.00	10.3	µg/L	
201001L032	32	Nurse's Office Storage-SK; Initial	1.00	<1.00	µg/L	
201001L033	33	Stage Dressing Room B-SK; Initial	1.00	38.4	µg/L	H
201001L034	34	Stage Dressing Room B Bathroom-SK; Initial	1.00	9.33	µg/L	
201001L035	35	Stage Dressing Room A-SK; Initial	1.00	9.48	µg/L	
201001L036	36	Stage Dressing Room A Bathroom -SK; Initial	1.00	19.0	µg/L	H
201001L037	37	Main Lobby by Storage 174-BF; Initial	1.00	<1.00	µg/L	
201001L038	38	Main Lobby by Storage 172-BF; Initial	1.00	<1.00	µg/L	
201001L039	39	Main Office-SK; Initial	1.00	7.84	µg/L	
201001L040	40	Main Office-WC; Initial	1.00	<1.00	µg/L	
201001L041	41	Custodian's Office 157 Bathroom-SK; Initial	1.00	4.86	µg/L	
201001L042	42	Room 146 Bathroom-SK; Initial	1.00	5.14	µg/L	
201001L043	43	2nd Floor Main Lobby by Boy's Bathroom-BF; Initial	1.00	<1.00	µg/L	
201001L044	44	2nd Floor Main Lobby by Girl's Bathroom-BF; Initial	1.00	<1.00	µg/L	
201001L045	45	Kitchen by Stove-PF; Initial	1.00	12.5	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2204919-16421

December 11, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Southampton High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 09, 2020. New York Environmental analyzed the samples on December 10, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	08 Dec 2020
Date Received:	09 Dec 2020
Date Analyzed:	10 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
201209K049	1	Kitchen Food Prep / Produce-SK	1.00	3.37	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix D

Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
Garage	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
Garage Bathroom	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
Kitchen	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
Kitchen Bathroom	SK	N/A		9/30/2020	-	-	-	Mixed Valve Sampling Not Required		-	-

Laboratory Report

NYE Report #: 2203919-15749

October 2, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: 19878; District Bus Garage, Southampton, NY

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 01, 2020. New York Environmental analyzed the samples on October 02, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Sep 2020
Date Received:	01 Oct 2020
Date Analyzed:	02 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
201001L111	1	Kitchen-SK, Initial	1.00	<1.00	µg/L	
201001L112	2	Garage Bathroom-SK, Initial	1.00	<1.00	µg/L	
201001L113	3	Garage-SS, Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix E

Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1st Floor Men's Bathroom	SK	App	1.38	9/30/2020	-	-	-	None	-	-	-
1st Floor Women's Bathroom	SK	App	<1.0	9/30/2020	-	-	-	None	-	-	-
2nd Floor Men's Bathroom	SK	App	3.63	9/30/2020	-	-	-	None	-	-	-
2nd Floor Women's Bathroom	SK	App	2.53	9/30/2020	-	-	-	None	-	-	-
Faculty Kitchen	SK	App	1.31	9/30/2020	-	-	-	None	-	-	-
Faculty Kitchen	WC	App	<1.0	9/30/2020	-	-	-	None	-	-	-
Superintendent's Office Bathroom	SK	App	1.2	12/8/2020	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2203918-15748

October 2, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: District Office, Southampton, NY

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 01, 2020. New York Environmental analyzed the samples on October 02, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Sep 2020
Date Received:	01 Oct 2020
Date Analyzed:	02 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
201001L105	1	1st Floor Men's Bathroom-SK, Initial	1.00	1.38	µg/L	
201001L106	2	1st Floor Women's Bathroom-SK, Initial	1.00	<1.00	µg/L	
201001L107	3	2nd Floor Men's Bathroom-SK, Initial	1.00	3.63	µg/L	
201001L108	4	2nd Floor, Women's Bathroom-SK, Initial	1.00	2.53	µg/L	
201001L109	5	Faculty Kitchen-SK, Initial	1.00	1.31	µg/L	
201001L110	6	Faculty Kitchen-WC, Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

NA: Sample not analyzed per customer request.

Laboratory Report

NYE Report #: 2204920-16422

December 11, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: District Office

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 09, 2020. New York Environmental analyzed the samples on December 10, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	08 Dec 2020
Date Received:	09 Dec 2020
Date Analyzed:	10 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
201209K050	1	Superintendent's Office Bathroom-SK	1.00	1.20	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation